

amlee

+

AS-BUILT REPAIR QUANTITY TABLE										
BENT 2 SPAN B FACE	QUANTITIES									
DENT 2 STAN DTACE	ESTI	ΜΑΤΕ	ACTUAL							
SHOTCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.						
CAP	0.0	0.0								
COLUMN	0.0	0.0								
CONCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.						
CAP	0.0	0.0								
COLUMN	0.0	0.0								
EPOXY RESIN INJECTIO	LIN.FT.	LIN.FT.								
САР	42.7									
COLUMN	0.0									
EPOXY COATING	SQ.FT.	SQ.FT.								
TOP OF BENT CAP	406.0									

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT. SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING. EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP. THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE MASONRY PLATES. FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

CONCRETE REPAIRS MAYBE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

SHOTCRETE REPAIR AREA



CONCRETE REPAIR AREA



TH CAR

SEAL 031021

ERI - EPOXY RESIN INJECTION

PROJECT NO. 15BPR.40 BUNCOMBE \_\_\_\_ COUNTY BRIDGE NO. 100705

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION

SUBSTRUCTURE REPAIR BENT 2 SPAN B FACE

DocuSigned by: MMWD Mare B04B5A4F2FAD484							
5/29/2019	REVISIONS						SHEET NO.
DOCUMENT NOT CONSIDERED	NO.	BY:	DATE:	NO.	BY:	DATE:	S3-26
FINAL UNLESS ALL	1			3			TOTAL SHEETS
SIGNATURES COMPLETED	2			4			36