

+

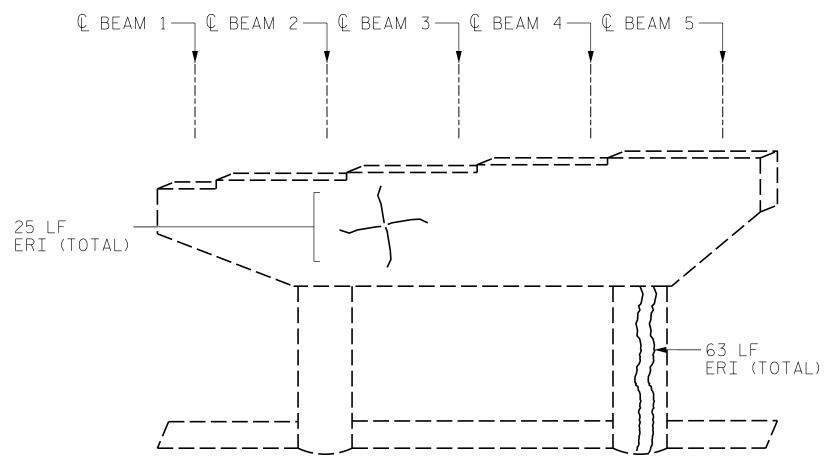

BENT 1 (WEST FACE)

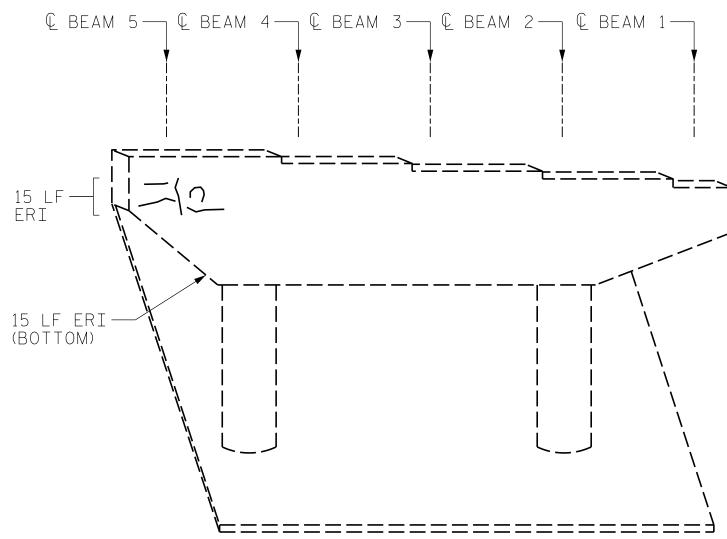

RFN	T ·	1
	I.,	

(EAST	FACE)

DRAWN BY :		JACOB H	.DUKE	DATE :	06/2021	
CHECKED BY	o 	FIDEL L.	FLORES	DATE :	06/2021	
DESIGN ENGI	INEER OF RE	CORD:	JACOB H.DUKE	DATE :	06/2021	

8/25/2021 I5939\_SMU\_SBR01\_770096.dgn fflores

	LEGEND	
	CONCRETE REPAIR AREA (CR)	
SH(	SHOTCRETE REPAIR AREA (SCR)	
	- EPOXY RESIN INJECTION (ERI)	
СОГ		
EP(		

DOCUMENT NOT FINAL UNL SIGNATURES COMPLETED NC FIRM LICENSE: C-1506

AS-BUILT REPAIR QUANTITY TABLE					
QUANTITIES					
ESTI	MATE	ACT	UAL		
AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
LIN.FT.		LIN.FT.			
55.0					
63.0					
AREA SQ.FT.		AREA SQ.FT.			
111.6					
	ESTI AREA SQ. FT. AREA SQ. FT. LIN 55 63 AR SQ.	QUANT ESTIMATE AREA SQ.FT. VOLUME CU.FT. AREA SQ.FT. VOLUME CU.FT. IIN.FT. 55.0 63.0 AREA SQ.FT.	QUANTITIESESTIMATEACTAREA SQ.FT.VOLUME CU.FT.AREA SQ.FT.AREA SQ.FT.VOLUME CU.FT.AREA SQ.FT.LIN.FT.LIN.LIN.55.063.0AREA SQ.FT.		

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

## NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >= $\frac{1}{16}$ " as described in the special PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3" ON THE CAP AND FROM  $1^{1}/_{2}$ " TO 2" ON THE PILES. ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING.FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.

PERFORM ALL CONCRETE REPAIRS PRIOR TO APPLYING THE EPOXY COATINGS.

TOP OF THE CAPS SHOULD BE CLEAN AND CLEAR OF ALL DEBRIS PRIOR TO THE APPLICATION OF THE EPOXY COATING.

COAT ALL THE FREE SURFACE AREA ON THE TOP OF CAPS, INCLUDING CHAMFERS, WITH EPOXY COATINGS.DO NOT COAT UNDER BEARING AREAS.

FOR EPOXY COATING, SEE SPECIAL PROVISION AND STANDARD SPECIFICATIONS SECTION 420-18.

	PROJEC F BRIDGE	ROBES	SON	-5939 co 70096	UNTY
Jacoba Kaka CARO/ 2900 Several Same SS / 01/4 SEAL 043777 B H DUNIN 8/25/2021	STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE REPAIRS				TION
KCA	BENT 1				
KISINGER CAMPO					SHEET NO.
CONSIDERED & ASSOCIATES 301 FAYETTEVILLE ST., SUITE 1500	NO. BY:	DATE:	NO. BY:	DATE:	S7-7
ESS ALL RALEIGH, NC 27601 (919) 882-7839   COMPLETED NC FIRM LICENSE: C-1506	1		3		TOTAL SHEETS
COMPLETED NC FIRM LICENSE: C-1506	2		<b>4</b>		9