

+

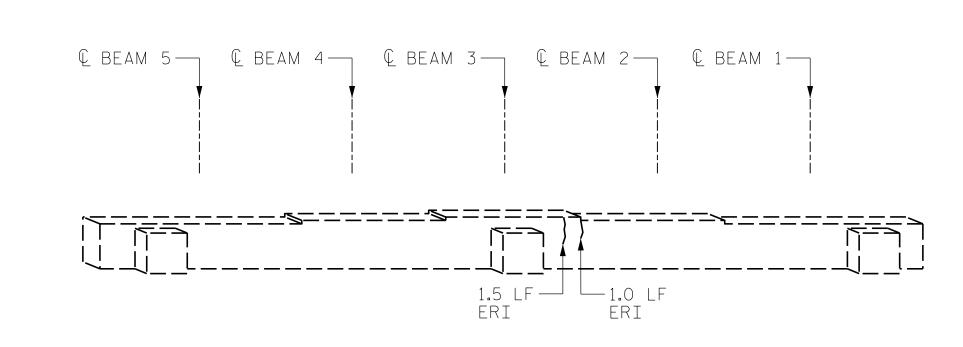

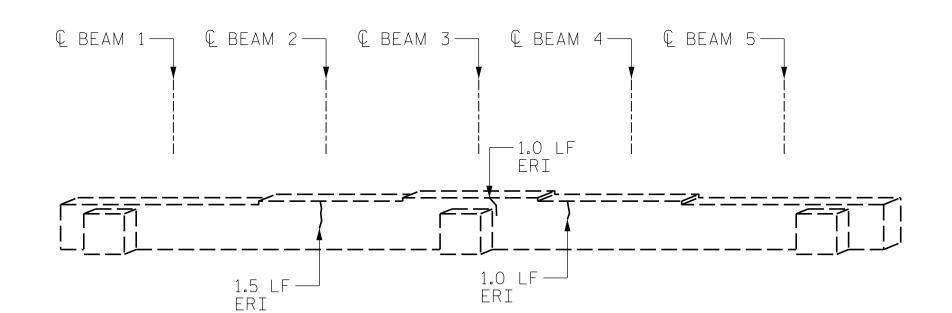





—

 END	D	
(W	EST	FAC

DRAWN BY :	JACOB	H.DUKE	DATE :	06/2021
CHECKED BY :	FIDEL I	FLORES	DATE :	06/2021
DESIGN ENGINEER	OF RECORD:	JACOB H.DUKE	DATE :	06/2021

8/25/2021 I5939_SMU_SBR00_770130.dgn fflores

	LEGEND	
	CONCRETE REPAIR AREA (CR)	
	SHOTCRETE REPAIR AREA (SCR)	SH
	EPOXY RESIN INJECTION (ERI)	
		СО
		ΕP
		ΕP

FND RFNT 2

ACE)

DOCUMENT	NOT	CON	ISIDERE
FINAL	UNL	ESS	ALL
SIGNATU	res	COMF	PLETED

AS-BUILT REPAIR QUANTITY TABLE					
	QUANTITIES				
ESTI	ESTIMATE		UAL		
AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.		
LIN.FT.		LIN.FT.			
6.0					
AREA SQ.FT.		AREA SQ.FT.			
22	228.7				
	ESTI AREA SQ. FT. AREA SQ. FT. LIN 6 AR SQ.	QUANT ESTIMATE AREA SQ.FT. VOLUME CU.FT. AREA SQ.FT. VOLUME CU.FT. LIN.FT. 6.0	OUANTITIESESTIMATEACTAREA SQ.FT.VOLUME CU.FT.AREA SQ.FT.AREA SQ.FT.VOLUME CU.FT.AREA SQ.FT.LIN.FT.LIN.LIN.6.0AREA SQ.FT.AREA SQ.FT.		

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >= $\frac{1}{16}$ as described in the special PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3" ON THE CAP AND FROM $1^{1}/_{2}$ " to 2" on the piles. Actual concrete cover shall be determined BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING.FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.

PERFORM ALL CONCRETE REPAIRS PRIOR TO APPLYING THE EPOXY COATINGS.

TOP OF THE CAPS SHOULD BE CLEAN AND CLEAR OF ALL DEBRIS PRIOR TO THE APPLICATION OF THE EPOXY COATING.

COAT ALL THE FREE SURFACE AREA ON THE TOP OF CAPS, INCLUDING CHAMFERS, WITH EPOXY COATINGS. DO NOT COAT UNDER BEARING AREAS.

FOR EPOXY COATING, SEE SPECIAL PROVISION AND STANDARD SPECIFICATIONS SECTION 420-18.

NC FIRM LICENSE: C-1506

		PROJEC F BRIDGE	ROBE	SON	-5939 co 7Ø130	UNTY
	DocuSigned by: JACOK VILLE CARO/ 2000 CAROLESS/OV SEAL 043777 VG INEF OB H DUNING 8/25/2021	STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE REPAIRS			TION	
	KCA		END [BENTS	1 & 2	
OT CONSIDERED	KISINGER CAMPO & ASSOCIATES 301 FAYETTEVILLE ST., SUITE 1500	NO. ВҮ:	REVIS DATE:	SIONS NO. BY:	DATE:	SHEET NO. S13-7 Total sheets
NLESS ALL	RALEIGH, NC 27601 (919) 882-7839					SHEETS