NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR CAP REPAIR DETAILS, SEE "TYPICAL CAP REPAIR DETAILS" SHEET.

FOR "SHOTCRETE REPAIRS", SEE SPECIAL PROVISIONS.

FOR "EPOXY RESIN INJECTION", SEE SPECIAL PROVISIONS.

SHOT CAP CAP PILE PILE EP0> САР

VALUES REMOVA MIN.2″

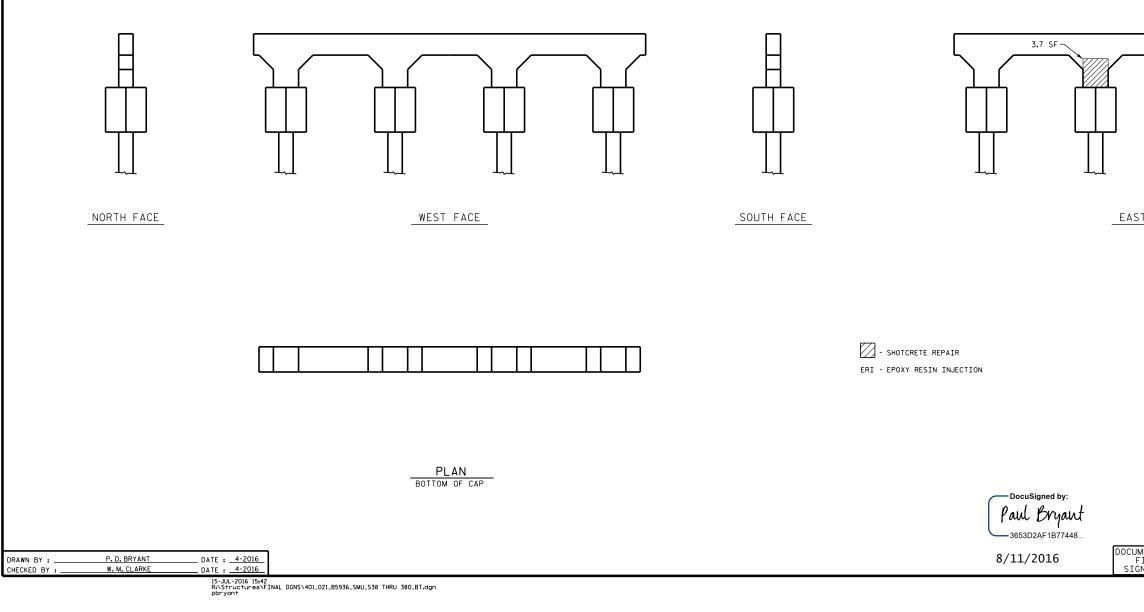

+

+

.

REPAIR QUANTITY TABLE				
QUANTITIES				
REPAIRS BENT 27-S	ESTI	IMATE ACTUAL		
SHOTCRETE REPAIRS	AREA	VOLUME	AREA	VOLUME
	SF 3.7	CF	SF	CF
CAP (VERTICAL FACE) CAP (HORIZONTAL, CORNER)	0.0	1.5 0.0		
PILE COLLAR (VERT FACE)	0.0	0.0		L
PILE COLLAR (HORIZ FACE)	0.0	0.0		
EPOXY RESIN INJECTI	ON	LN.FT.		LN.FT.
CAP		0.0		
ALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND AIN. 2"CL TO SAWCUT. SEE REPAIR DETAILS.				
		10 RELL)		
SEAL 23739		STATE OF NORTH	ANSPORTA	TION
D. BRIT	E	BENT 2	21-2	
\vdash		REVISIONS		SHEET NO.
DOCUMENT NOT CONSIDERED	BY: DATE	: NO. BY:	DATE:	S-342
FINAL UNLESS ALL 🚺		3		TOTAL SHEETS
SIGNATURES COMPLETED 🙎		4		394

.

.