
NOTES: REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE. REPAIRS BENT 56-S SHOTCRETE REPAIRS 0.0 CAP (VERTICAL FACE) CAP (HORIZONTAL, CORNER) 0.0 FOR CAP REPAIR DETAILS, SEE "TYPICAL CAP REPAIR DETAILS" SHEET. 0.0 PILE COLLAR (VERT FACE) FOR "SHOTCRETE REPAIRS", SEE SPECIAL PROVISIONS. PILE COLLAR (HORIZ FACE) FOR "EPOXY RESIN INJECTION", SEE SPECIAL PROVISIONS. EPOXY RESIN INJECTION NORTH FACE WEST FACE SOUTH FACE EAST FACE PLAN NO REPAIRS NOTED DURING INSPECTION BY STRUCTURES MANAGEMENT UNIT. THE CONTRACTOR AND ENGINEER SHALL INSPECT THE BENT PRIOR TO BEGINNING WORK. BOTTOM OF CAP DocuSigned by: Paul Bryant -3653D2AF1B77448... 8/11/2016 DATE : <u>4-2016</u> DATE : <u>4-2016</u>

REPAIR QUANTITY TABLE QUANTITIES ESTIMATE ACTUAL VOLUME CF VOLUME CF 0.0 0.0 0.0 0.0 0.0 LN.FT. LN.FT. 0.0 VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN. 2"CL TO SAWCUT. SEE REPAIR DETAILS.

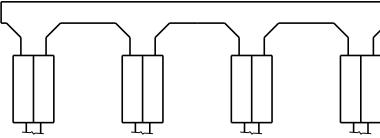

B-5936 PROJECT NO. TYRRELL COUNTY 7 BRIDGE NO.

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION

BENT 56-S

REVISIONS DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

P. D. BRYANT

DRAWN BY : CHECKED BY :