NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR CAP REPAIR DETAILS, SEE "TYPICAL CAP REPAIR DETAILS" SHEET.

FOR "SHOTCRETE REPAIRS", SEE SPECIAL PROVISIONS.

FOR "EPOXY RESIN INJECTION", SEE SPECIAL PROVISIONS.

CAP CAP PILE PILE EP0> САР

VALUES REMOVA MIN.2″

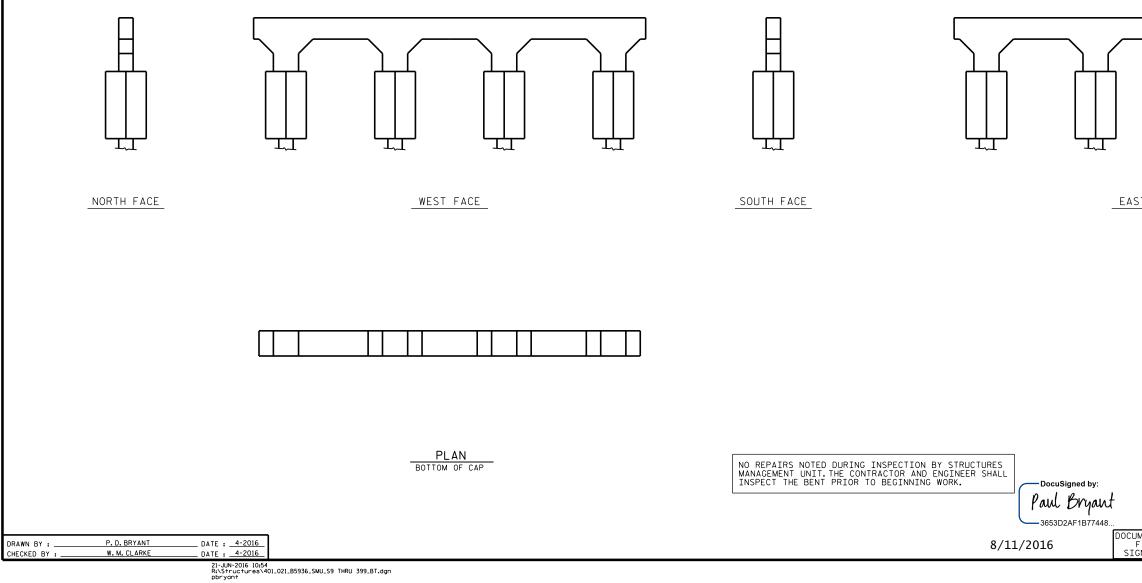

+

+

.

REPAIR QUANTITY TABLE				
REPAIRS BENT 60-S	QUANTITIES ESTIMATE ACTUAL			
SHOTCRETE REPAIRS	AREA	VOLUME	AREA	VOLUME
CAP (VERTICAL FACE)	0.0	0.0		
CAP (HORIZONTAL, CORNER)	0.0	0.0		
PILE COLLAR (VERT FACE)	0.0	0.0		
PILE COLLAR (HORIZ FACE)	0.0	0.0		
EPOXY RESIN INJECTI	ON	LN.FT.		LN.FT.
САР		0.0		
		10 RELL_)		
AND IN CAROLE SEAL 23739 Sentes Conserved		STATE OF NORTH NT OF TR RALEIGH	ANSPORT	ATION
·		REVISIONS	0	SHEET NO.
DOCUMENT NOT CONSIDERED NO. FINAL UNLESS ALL 1	BY: DATE	: NO. BY:	DATE:	S-375 TOTAL SHEETS
FINAL UNLESS ALL 1 SIGNATURES COMPLETED 2		4		394

.

.