## NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR CAP REPAIR DETAILS, SEE "TYPICAL CAP REPAIR DETAILS" SHEET.

FOR "SHOTCRETE REPAIRS", SEE SPECIAL PROVISIONS.

FOR "EPOXY RESIN INJECTION", SEE SPECIAL PROVISIONS.

SHOT CAP CAP PILE PILE EP0> САР

VALUES REMOVA MIN.2″

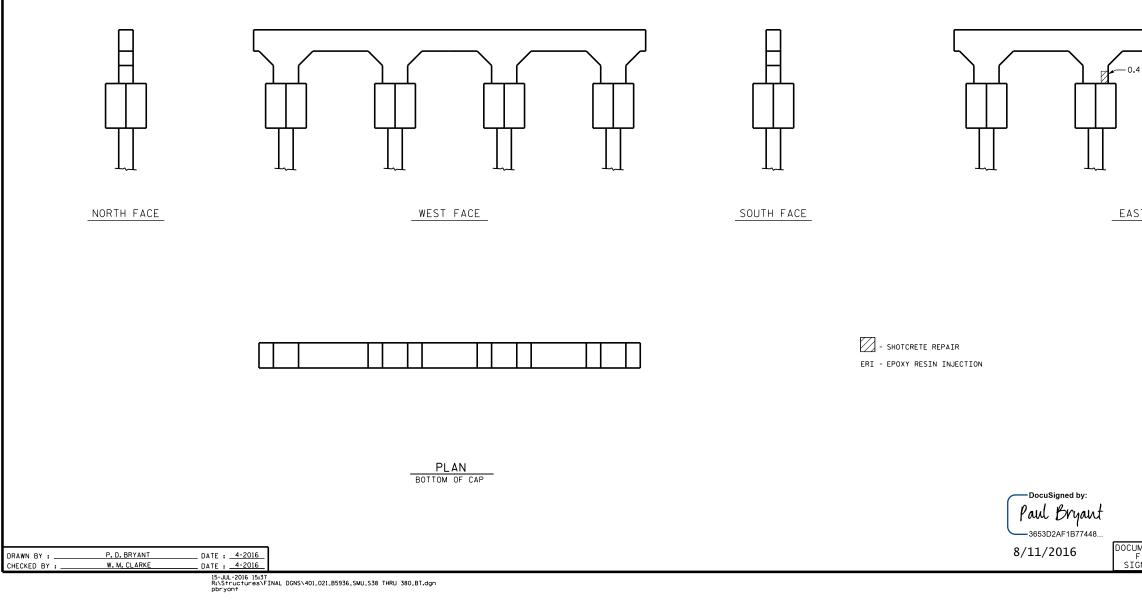

+

+

.

REPAIR QUANTITY TABLE				
REPAIRS BENT 26-S				
NEFAINS DENI 20-3	ESTI			UAL
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP (VERTICAL FACE)	0.4	0.2		
CAP (HORIZONTAL, CORNER)	0.0	0.0		
PILE COLLAR (VERT FACE) PILE COLLAR (HORIZ FACE)	0.0	0.0		
EPOXY RESIN INJECTION		LN.FT.		LN.FT.
CAP		0.0		
/ALUES IN CHART REPRESENT EST; REMOVAL OF UNSOUND CONCRETE, M AIN. 2"CL TO SAWCUT. SEE REPAIR	UE TAILS.			
O.4 SF				
EAST FACE				
PROJECT NO. <u>B-5936</u>				
-	<u> </u>	RELL	C	OUNTY
	DGE NO	<b>`</b>	7	
BKI	DUE NU		•	
SEAL 23739		STATE OF NORTH NT OF TR RALEIGH	ANSPORT	ATION
┣	F	REVISIONS		SHEET NO.
	BY: DATE	NO. BY:	DATE:	S-341
FINAL UNLESS ALL		3		TOTAL SHEETS

.

.