

AS-BUILT REPAIR QUANTITY TABLE QUANTITIES END BENT 2 REPAIRS ACTUAL ESTIMATE AREA SF VOLUME VOLUME SHOTCRETE REPAIRS CURTAIN WALL 7.5 3.8 VOLUME VOLUME CONCRETE REPAIRS CF CAP 3.9 2.0 CURTAIN WALL 0 AREA AREA EPOXY COATING CAP 186

NOTES

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MINIMUM OF 1"BEHIND REBAR AND MINIMUM OF 2" CLEARANCE TO SAWCUT. FOR REPAIR DETAILS, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.


CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING. EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP AND TO THE TOP SURFACE OF THE PILE CAPS. THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE MASONRY PLATES. FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

CONCRETE REPAIRS MAY BE SUBSTITIUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.


FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR EPOXY RESIN INJECTION (ERI), SEE SPECIAL PROVISIONS.



SHOTCRETE REPAIR AREA



CONCRETE REPAIR AREA (FORM AND POUR)




EPOXY RESIN INJECTION (ERI)

PROJECT NO. I-5769

MECKLENBURG COUNTY

BRIDGE NO. 590243

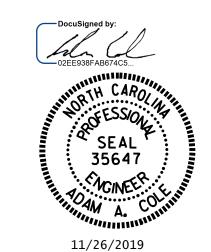

DEPARTMENT OF TRANSPORTATION
RALEIGH

SUBSTRUCTURE END BENT 2

REVISIONS

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

REVISIONS

DATE: NO. BY: DATE: NO. BY: DATE: S7-08

SIGNATURES COMPLETED

REVISIONS

SHEET NO. S7-08

STOTAL SHEETS

8

DATE: 11/2018 DATE: 09/2019

D.A. CANTRELL

H.A. LOCKLEAR

DRAWN BY : .

CHECKED BY :

26-NOV-2019 08:06 A:\Structures\FinalPlans\407_131_I5769_SMU_EB02_S7-08_590243.dgn