PRELIMINARY SITE ASSESSMENT

SR 1100 (BRAWLEY SCHOOL ROAD) IMPROVEMENTS TIP NO. R-3833C, WBS NO. 34554.2.4

NCDOT PARCEL NO. 74 OWNER: COUNTRY ROADS OF THE CAROLINAS, LLC 2861 CHARLOTTE HIGHWAY MOORESVILLE, IREDELL COUNTY, NORTH CAROLINA



PREPARED FOR: NORTH CAROLINA DEPARTMENT OF TRANSPORTATION C/O STANTEC 801 JONES FRANKLIN ROAD SUITE 300 RALEIGH NORTH CAROLINA 27606-3394

PREPARED BY: FALCON ENGINEERING, INC. 1210 TRINITY ROAD, SUITE 110 CARY, NC 27513

PROJECT NUMBER: G18063.02 OCTOBER 27, 2019





October 27, 2019

Mr. A. Dean Sarvis PE Stantec 801 Jones Franklin Road, Suite 300 Raleigh, North Carolina 27606-3394

Re: Preliminary Site Assessment SR 1100 (Brawley School Road) Improvements TIP No. R-3833C, WBS No. 34554.2.4 Parcel No. 74 Owner: Country Roads of the Carolinas, LLC 2861 Charlotte Highway Mooresville, Iredell County, North Carolina

Dear: Mr. Sarvis:

Falcon is pleased to present the following Preliminary Site Assessment in support of the above-mentioned Project. Specifically, Falcon sampled soil in proximity to the project limits on this parcel in general accordance with the approved scope of work. Soils requiring remediation or special handling during construction were not identified.

Falcon recommends if drums, USTs, above ground storage tanks (ASTs), petroleum odors or sheen are observed during any excavation associated with any property involved in the project that all work in the vicinity stop until further assessment takes place. Further assessment can include but is not limited to; sampling the soil and groundwater, excavation, and proper handling and disposal of contaminated soils and groundwater.

Please review this report and advise us if you have any questions or concerns. We appreciate this opportunity to provide services to you and look forward to partnering with you on future projects. If you have any questions, please give Falcon a call at (919) 871-0800.

Sincerely, **FALCON ENGINEERING, INC.**

ristopten Buthart

Christopher J. Burkhardt Environmental Services Manager

Imt

Jeremy R. Hamm, PE Geotechnical Services Manager

TABLE OF CONTENTS

SECTION	1: INTRODUCTION	5
	1.1 DESCRIPTION	5
	1.2 SCOPE OF WORK	5
SECTION	2: HISTORY	5
	2.1 PARCEL USAGE	5
	2.2 FACILITY IDENTIFICATION NUMBER	5
	2.3 GROUNDWATER INCIDENT NUMBER	5
SECTION	3: SITE OBSERVATIONS	7
	3.1 GROUNDWATER MONITORING WELLS	7
	3.2 ACTIVE USTS	7
	3.3 FEATURES APPARENT BEYOND ROW/EASEMENT	7
SECTION	4: METHODOLOGY8	3
	4.1 GEOPHYSICS	3
	4.2 BORINGS	3
	4.3 SAMPLE PROTOCOL	3
SECTION	5: RESULTS)
SECTION	5: RESULTS	
SECTION)
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10)
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11)))
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11)) 1 1
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11)) 1 1
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12)) 1 1 2
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12)) 1 1 2 2
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13	
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13	
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13	
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13 6.3 SAMPLING 13	
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 TABLE NO. 4 SOIL OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13 6.3 SAMPLING 13 6.4 QUANTITIES 13	
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13 6.3 SAMPLING 13 6.4 QUANTITIES 13 7: RECOMMENDATIONS 14))))))))))))))))))))))))))))))))))))))
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 TABLE NO. 4 SOIL OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13 6.3 SAMPLING 13 6.4 QUANTITIES 13))))))))))))))))))))))))))))))))))))))

LIST OF FIGURES AND ATTACHMENTS

VICINITY MAP USGS TOPOGRAPHIC MAP PARCEL LOCATION MAP BORING LOCATION MAP SITE PHOTOGRAPHS LABORATORY RESULTS GEOPHYSICAL SURVEY

SECTION 1: INTRODUCTION

1.1 DESCRIPTION

Falcon Engineering, Inc. (Falcon) has completed a Preliminary Site Assessment of NCDOT TIP No. R-3833C Parcel No. 74. Parcel No. 74 is addressed as 2861 Charlotte Highway, Mooresville, Iredell County, North Carolina. NCDOT is proposing to improve SR 1100 (Brawley School Road) from SR 1116 (Talbert Road) to 1,000' east of US 21, including improvements to a number of intersecting roads and driveways throughout this corridor. The limits of the assessment are between the existing edge of NCDOT maintained pavement (within the existing NCDOT ROW) where accessible, and the proposed NCDOT ROW and/or easement (whichever boundary represents the largest area). Boring locations were placed in the vicinity of proposed excavations for drainage features, utilities, and roadway/ditch cuts to determine if soils requiring remediation or special handling were present where excavation is planned to take place.

1.2 SCOPE OF WORK

Falcon's scope of work included coordination of; public and private utility location near the proposed borings, geophysical surveys, collecting soil samples with a geoprobe, and laboratory analysis. Samples were analyzed for petroleum via UVF technology.

SECTION 2: HISTORY

2.1 PARCEL USAGE

Falcon performed a Phase I Environmental Site Assessment (ESA) for R-3833C under Project No. G18063.01 dated March 2019. The ESA identified this parcel as a Recognized Environmental Condition (REC) based on the parcel's history as a suspect gas station. Kiser S. Service & Grocery is listed in City Directories at this address in 2000; however, the date of construction for the building is 1957. This commercial building is currently vacant. A concrete island and suspect fill pipes indicating the potential presence of at least one UST were observed at this location. Boards covered the windows blocking interior views. The concrete island is in front of the west facing elevation of the building. This facility is considered a REC based on the suspected presence of a UST and its potential for an unreported release.

2.2 FACILITY IDENTIFICATION NUMBER

A Facility Identification Number was not identified for this parcel.

2.3 GROUNDWATER INCIDENT NUMBER

A Groundwater Incident Number was not identified for this parcel.

SECTION 3: SITE OBSERVATIONS

3.1 GROUNDWATER MONITORING WELLS

Groundwater monitoring wells (MWs) were not observed on this parcel.

3.2 ACTIVE USTS

Active USTs were not observed within the project limits or registered at this parcel. However a suspect former dispenser Island was observed.

3.3 FEATURES APPARENT BEYOND ROW/EASEMENT

USTs, monitoring wells, remediation systems, or hydraulic lifts were not observed within the project limits. However, access to the building was not available. Windows with unobstructed views of the interior were not observed Therefore; USTs and hydraulic lifts on this parcel cannot be ruled out.

SECTION 4: METHODOLOGY

4.1 GEOPHYSICS

Pyramid Geophysical Services (Pyramid) was subcontracted to perform a geophysical survey of the assessment area. The assessment area consists of the property frontage between the existing edge of NCDOT maintained pavement (within the existing NCDOT ROW) where accessible, and the proposed NCDOT ROW and/or easement (whichever boundary represents the largest area). The survey was used to locate private utility lines, as well as possible indications of USTs, and/or their pits.

The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. Pyramid collected the EM data using a Geonics EM61-MK2 (EM61) metal detector integrated with a Geode External GPS/GLONASS receiver. The integrated GPS system allows the location of the instrument to be recorded in real-time during data collection, resulting in an EM data set that is georeferenced and can be overlain on aerial photographs and CADD drawings.

GPR data was acquired across select EM anomalies (where identified), using a Geophysical Survey Systems, Inc. (GSSI) UtilityScan DF unit equipped with a dual frequency 300/800 MHz antenna. Pyramid marked their findings on the surface with paint. A boundary grid was established around the perimeter of the site with marks every 10 feet to maintain orientation of the instrument throughout the survey and to obtain adequate coverage. A copy of the full Geophysical Report is included in the Attachments.

4.2 BORINGS

Regional Probing was subcontracted to advance soil borings using direct push technology. Regional Probing used a truck mounted Geoprobe® 5410 unit mounted on an off-road modified Ford F350 Diesel 4x4. The unit has auger-capabilities and is equipped with a GH-42 soil-probing hammer, with 21,700 pounds of down force and 28,900 pounds of retraction force. The unit has an on-board tank for decontaminating the geoprobe rods before advancing the probe at each sample location.

4.3 SAMPLE PROTOCOL

Prior to initiating sample collection Falcon contacted NC One Call and requested public utility locations be marked around the proposed sample locations. Sampling was in general accordance with the NC Department of Environmental Quality (DEQ) Division of Waste Management's (DWM) "Guidelines for Site Checks, Tank Closure, and Initial Response and Abatement for UST Releases" (March 1, 2007 Version Change 9 – February 1, 2019) guidance document. Sampling strategy was derived based upon the project scope and objectives as outlined above. Red Lab, LLC was selected to perform the UVF laboratory analytical analysis. Appropriate sterile containers were received by Falcon from Red Lab prior to beginning the fieldwork. The containers were labeled appropriately.

A Minirae 3000 photoionization detector (PID) was used to field screen samples for volatile organics to determine if a release had occurred. The instrument was calibrated per manufacturer instructions prior to use. Falcon staff bagged composite soil samples of each boring in approximately two-foot sections. Representative samples were placed in a sealed plastic bag for approximately 10 minutes to allow soil hydrocarbons to reach equilibrium within the headspace prior to scanning with the PID. One sample per boring was collected from the depth of the proposed cut or from the section above the depth of cut with the highest PID reading.

To avoid cross contamination, a new unused pair of non-powdered nitrile gloves was worn while extracting each sample. Samples were placed in the appropriate laboratory provided containers. The labels on each container were then completed so that each provided the date and time of sampling, method of analysis, sample collector, preservative used and sampling location identification. Samples were placed in an ice filled cooler and transported to the lab. Appropriate chain-of-custody procedures, including the completion of necessary forms, were followed.

SECTION 5: RESULTS

5.1 GEOPHYSICS

The geophysical investigation was performed on August 11 and 12, 2019 to investigate for the presence of unknown, metallic underground storage tanks (USTs) beneath the surface. The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. A total of six EM anomalies were identified. The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface. GPR was performed across areas containing significant metallic interference associated with reinforced concrete. Additional significant buried structures were not identified. Collectively, the geophysical data did not record evidence of metallic USTs within the survey area at Parcel No. 74.

5.2 SAMPLE DATA

Falcon and our subcontractor advanced four borings (B-15, B-16, B-17, and B-18) to 10 feet below ground surface in the area of the suspect former dispenser island. Groundwater was not observed. Please see the Boring Location Plan in the attachments for a visual depiction of the boring locations. The coordinates (latitude and longitude) that correspond to the boring locations are shown below in Table No. 1 Boring Coordinates.

Boring	Latitude	Longitude
B-15	35.5771213	-80.8410738
B-16	35.5770668	-80.8410769
B-17	35.5770358	-80.8411138
B-18	35.5770825	-80.841164

TABLE NO. 1 BORING COORDINATES

The PID screening results are presented in Table No. 2 PID Readings. Borings were field screened with a PID for evidence of volatile organics in sections as indicated in Table No. 2. PID readings for this parcel were consistently 0.0 which can be indicative of mis-calibrated or malfunctioning equipment. Falcon confirmed the PID was calibrated and confirmed normal functioning when VOCs were identifed after placing a permanent marker near the PID sensor. Falcon selected soil samples based on the needs of the project. Red Lab analyzed the selected samples and their full analytical report is attached. The results of the laboratory analysis are summarized in Table No. 3 Summary of UVF Soil Sampling Results.

Petroleum hydrocarbons above State Action Levels were not detected in the samples.

Boring	Depth BGS*	PID**
	0-2.5	0.0
B-15	2.5-5	0.0
D-15	5-7.5	0.0
	7.5-10	0.0
	0-2.5	0.0
B-16	2.5-5	0.0
D-10	5-7.5	0.0
	7.5-10	0.0
	0-2.5	0.0
D 17	2.5-5	0.0
B-17	5-7.5	0.0
	7.5-10	0.0
	0-2.5	0.0
D 10	2.5-5	0.0
B-18	5-7.5	0.0
	7.5-10	0.0

TABLE NO. 2 PID READINGS

*BGS = Depth below ground surface in feet

**PID readings are in parts per million

Samples shown in **bold** were selected for analysis

TABLE NO. 3 SUMMARY OF UVF SO	OIL SAMPLING RESULTS
-------------------------------	----------------------

	BTEX	GRO	DRO	ТРН	Total	16			Ratios		
Sample ID	(C6 - C9)	(C5 - C10)	(C10 - C35)	(C5 - C35)	Aromatics (C10-C35)	EPA PAHs	BaP	% light	% mid	% heavy	HC Fingerprint Match
B-15	<0.46	<0.46	0.59	0.59	0.59	< 0.15	< 0.018	0	59.2	40.8	V.Deg.PHC 72%,(FCM),(BO)
B-16	< 0.53	< 0.53	< 0.53	< 0.53	< 0.11	< 0.17	< 0.021	0	0	0	Residual HC
B-17	< 0.31	< 0.31	0.4	0.4	0.49	<0.1	< 0.012	0	50.1	49.9	Deg.Fuel 61%,(FCM)
B-18	< 0.35	< 0.35	< 0.35	0.17	0.17	<0.11	< 0.014	0	25.8	74.2	Residual HC

Results reported in mg/kg (milligrams per kilogram)

5.3 SAMPLE OBSERVATIONS

Obvious visual indications of a release (stained soils, odors, or oily sheen) were not observed. Table No. 4 Soil Observations lists visual soil observations of color and texture.

Sample ID	Depth	Color	Soil Type
	0-2.5	Red	Sandy Silt (A-4) w/ trace Mica
B-15	2.5-5	Red	Sandy Clayey Silt (A-4)
D-15	5-7.5	Brown	Silty Sand (A-2-4)
	7.5-10	Brown	Slightly Sandy Silt (A-4)
	0-2.5	Red	Clayey Silt (A-5) w/ trace Mica
B-16	2.5-5	Red	Clayey Silt (A-5) w/ trace Mica
D-10	5-7.5	Brown	Slightly Sandy Silt (A-4)
	7.5-10	Red Brown	Sandy Silt (A-4)
	0-2.5	Red	Clayey Silt (A-5) w/ trace Mica
B-17	2.5-5	Red Brown	Slightly Sandy Silt (A-4)
D-17	5-7.5	Brown	Slightly Sandy Silt (A-4) w/ trace Mica
	7.5-10	Brown	Slightly Sandy Silt (A-4) w/ trace Mica
	0-2.5	Red	Clayey Silt (A-5) w/ trace Mica
B-18	2.5-5	Red Brown	Sandy Clayey Silt (A-4) w/ trace Mica
D-10	5-7.5	Red	Clayey Sandy Silt (A-4)
	7.5-10	Brown	Sandy Silt (A-4) w/ trace Mica

TABLE NO. 4 SOIL OBSERVATIONS

Depth is in feet below ground surface

5.4 QUANTITIES CALCULATIONS

Soils requiring quantity calculations were not identified.

SECTION 6: CONCLUSIONS

6.1 INTERPRETATION OF RESULTS

This Preliminary Site Assessment was performed to evaluate the soils in proximity to the project limits on this parcel for the presence of petroleum hydrocarbons. The findings are as follows:

Soil sampling completed on the parcel did not identify contaminants in the soil sampled at levels requiring remediation.

6.2 GEOPHYSICS

The geophysical data did not record evidence of metallic USTs within the survey area at Parcel No. 74. Falcon does not anticipate USTs will be encountered within the project limits on this parcel during construction.

6.3 SAMPLING

Sampling results did not identify contaminants in the soil which require remediation in the areas sampled. Based on past project experience, Falcon does not anticipate soil remediation or special handling and disposal will be required during construction on this parcel.

6.4 QUANTITIES

Soils requiring quantities calculations were not identified.

SECTION 7: RECOMMENDATIONS


7.1 ADDITIONAL SAMPLING

Contaminants above the Industrial / Commercial Soil Cleanup Levels were not identified; therefore, additional assessment is not warranted at this time. Falcon recommends if drums, USTs, above ground storage tanks (ASTs), petroleum odors or sheen are observed during any excavation associated with any property involved in the project that all work in the vicinity stop until further assessment takes place. Further assessment can include but is not limited to; sampling the soil and groundwater, excavation, and proper handling and disposal of contaminated soils and groundwater.

7.2 SPECIAL HANDLING OF IMPACTED SOIL

Soils requiring special handling were not identified. If suspect contaminated soils are encountered during construction Falcon and the NCDOT GeoEnvironmental Group should be contacted for proper handling instructions.


NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 74 Vicinity Map

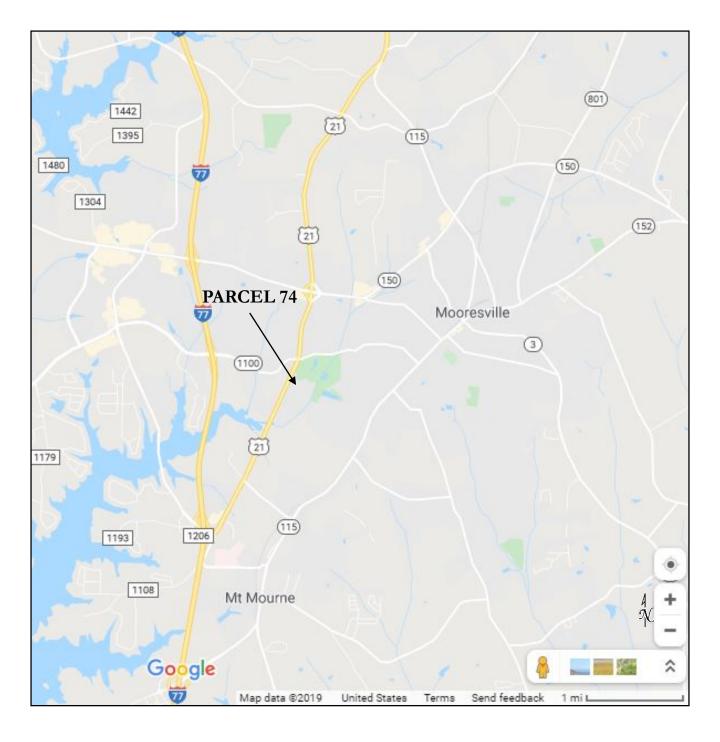

Project No.: G18063.02 Date: October 2019 Source: Google Maps




NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 74 Topographic Map

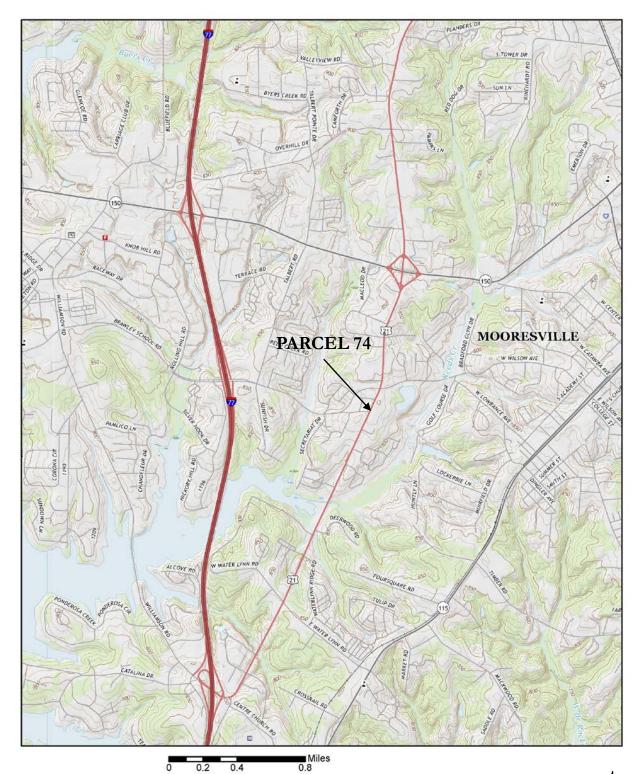

Project No.: G18063.02Date:October 2019Source:"Mooresville, NC" 2016 USGS Topographic Map


NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 74 Location Map



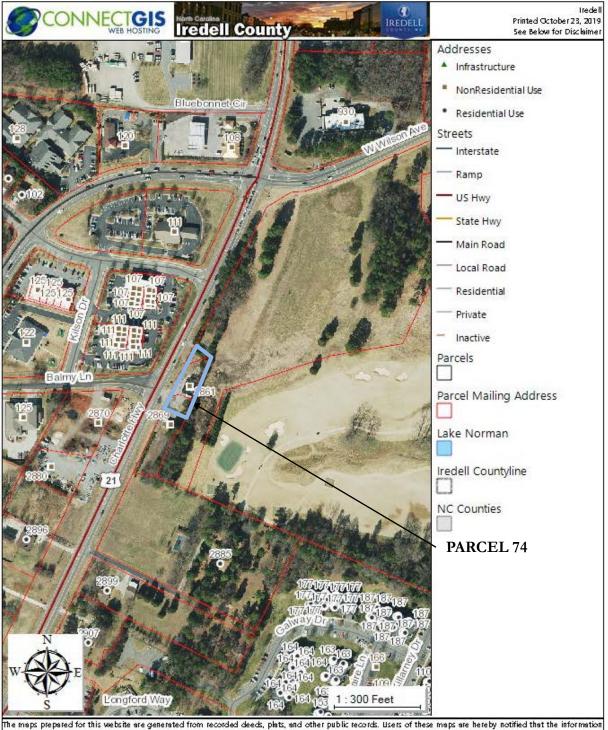

The maps prepared for this website are generated from recorded deeds, plats, and other public records. Users of these maps are hereby notified that the information provided herein should be verified. Iredell County assumes no legal responsibilities for any of the information contained on this site. Users are advised that the use of any of this information is at their own risk. All maps on this site were prepared using a 1000 Ser and the north Carolina State Plane Coordinate System from the 1983 North. American Datum. The delinquent real property tax overlay is updated monthly. The information presented is not intended to be used or relied upon as official notice of tax liens. For additional information regarding delinquent taxes, contact the Iredell County Tax Collector's Office.

Project No.: G18063.02 Date: October 2019 Source: Iredell County GIS Website

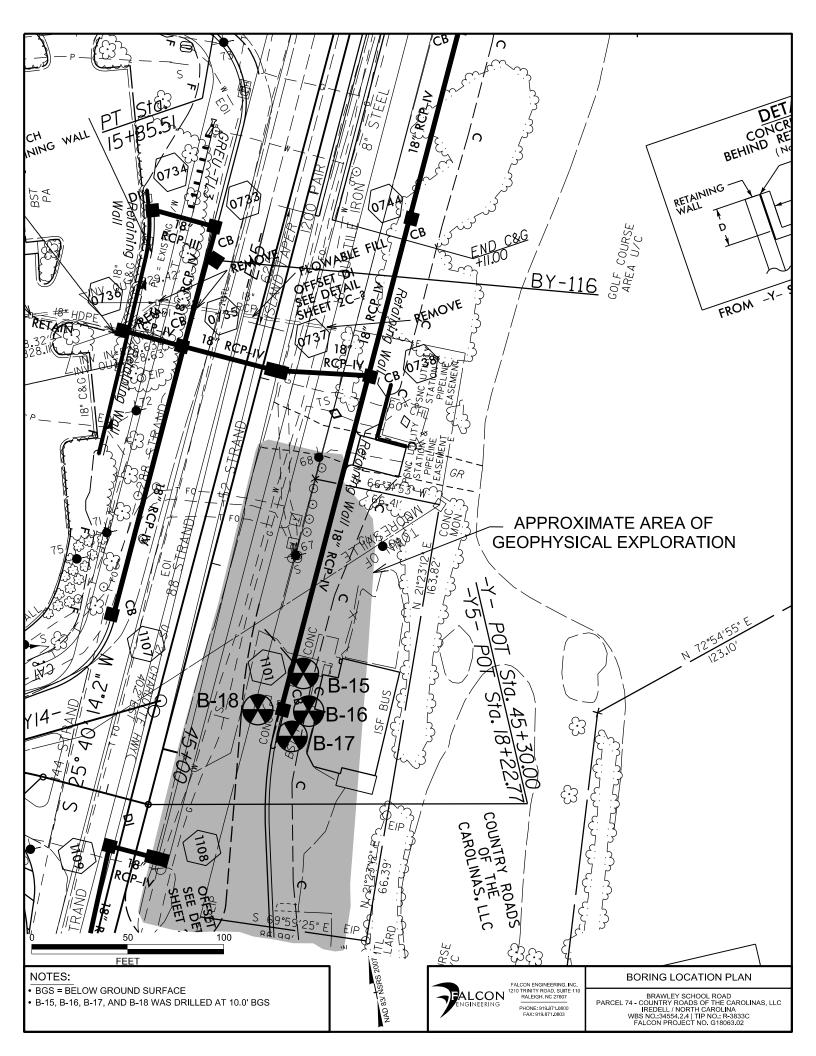







Photograph No. 1: General view of Boring B-15.



Photograph No. 2: General view of Boring B-16.







Photograph No. 3: General view of Boring B-17.



Photograph No. 4: General view of Boring B-18.


				Hydroca	rbon An	alysis R	esults						
Client: Address	FALCON 1210 TRINITY RD SUITE 110 CARY, NC 27513								Sa Sampl Sampl		acted		10/14 - 10/15/2019 10/14 - 10/15/2019 Wednesday, October 16, 2019
Contact:	C. Burkhardt									Ор	erator		Harry Wooten
Project:	G18063												
													U009
Matrix	Sample ID	Dilution used	BTEX (C6 - C9)	GRO (C5 - C10)	DRO (C10 - C35)	TPH (C5 - C35)	Total Aromatics (C10-C35)	16 EPA PAHs	BaP	q	% Ratios		HC Fingerprint Match
							(010-033)			C5 - C10	C10 - C18	C18	
s	B15	18.3	<0.46	<0.46	0.59	0.59	0.59	<0.15	<0.018	0	59.2	40.8	V.Deg.PHC 72%,(FCM),(BO)
s	B16	21.3	<0.53	<0.53	<0.53	<0.53	<0.11	<0.17	<0.021	0	0	0	Residual HC
S	B17	12.2	<0.31	<0.31	0.4	0.4	0.49	<0.1	<0.012	0	50.1	49.9	Deg.Fuel 61%,(FCM)
	B18	14.0	<0.35	<0.35	<0.35	0.17	0.17	<0.11	<0.014	0	25.8	74.2	Residual HC
S													
S													
S													
S		Calibrator							Final FC				99.1


QED Hydrocarbon Fingerprints

Project: G18063

QE

700

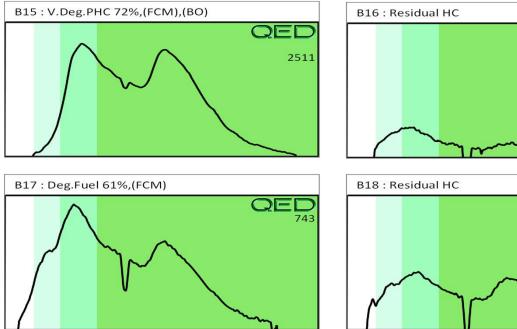

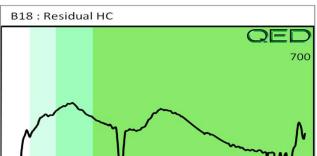



PYRAMID GEOPHYSICAL SERVICES (PROJECT 2019-260)

GEOPHYSICAL SURVEY

METALLIC UST INVESTIGATION: PARCEL 74 NCDOT PROJECT R-3833C

2861 CHARLOTTE HIGHWAY, MOORESVILLE, NC

September 6, 2019

Report prepared for:

Christopher J. Burkhardt, PWS Falcon Engineers 1210 Trinity Rd. #110 Raleigh, NC 27607

Prepared by:

Eric C. Cross, P.G. NC License #2181

Doug Canavello

Reviewed by:

Douglas A. Canavello, P.G. NC License #1066

503 INDUSTRIAL AVENUE, GREENSBORO, NC 27406 P: 336.335.3174 F: 336.691.0648 C257: GEOLOGY C1251: ENGINEERING

GEOPHYSICAL INVESTIGATION REPORT Parcel 74 - 2861 Charlotte Highway Mooresville, Iredell County, North Carolina

Table of Contents

Executive Summary	1
Introduction	
Field Methodology	2
Discussion of Results	
Discussion of EM Results	3
Discussion of GPR Results	
Summary & Conclusions	
Limitations	

Figures

Figure 1 – Parcel 74 – Geophysical Survey Boundaries and Site Photographs
Figure 2 – Parcel 74 – EM61 Results Contour Map
Figure 3 – Parcel 74 – GPR Transect Locations and Select Images
Figure 4 – Parcel 74 – Overlay of Metal Detection Results on NCDOT Engineering Plan

Appendices

Appendix A – GPR Transect Images

LIST OF ACRONYMS

CADD	Computer Assisted Drafting and Design
DF	
EM	
GPR	Ground Penetrating Radar
GPS	Global Positioning System
NCDOT	North Carolina Department of Transportation
ROW	Right-of-Way
UST	• •

EXECUTIVE SUMMARY

Project Description: Pyramid Environmental conducted a geophysical investigation for Falcon Engineers at Parcel 74, located at 2861 Charlotte Highway in Mooresville, NC. The survey was part of an NCDOT Right-of-Way (ROW) investigation (NCDOT Project R-3833C). The survey was designed to extend from the existing edge of pavement into the proposed ROW and/or easements, whichever distance was greater. Conducted from August 11-12, 2019, the geophysical investigation was performed to determine if unknown, metallic underground storage tanks (USTs) were present beneath the survey area.

Geophysical Results: The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. A total of six EM anomalies were identified. The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface. GPR was performed across areas containing significant metallic interference associated with reinforced concrete. No additional significant buried structures were identified. Collectively, the geophysical data <u>did not record any evidence of metallic USTs within the survey area at Parcel 74.</u>

INTRODUCTION

Pyramid Environmental conducted a geophysical investigation for Falcon Engineers at Parcel 74, located at 2861 Charlotte Highway in Mooresville, NC. The survey was part of an NCDOT Right-of-Way (ROW) investigation (NCDOT Project R-3833C). The survey was designed to extend from the existing edge of pavement into the proposed ROW and/or easements, whichever distance was greater. Conducted from August 11-12, 2019, the geophysical investigation was performed to determine if unknown, metallic underground storage tanks (USTs) were present beneath the survey area.

The site included a vacant building surrounded by concrete, gravel, grass, and asphalt surfaces. An aerial photograph showing the survey area boundaries and ground-level photographs are shown in **Figure 1**.

FIELD METHODOLOGY

The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. Pyramid collected the EM data using a Geonics EM61-MK2 (EM61) metal detector integrated with a Geode External GPS/GLONASS receiver. The integrated GPS system allows the location of the instrument to be recorded in real-time during data collection, resulting in an EM data set that is geo-referenced and can be overlain on aerial photographs and CADD drawings. A boundary grid was established around the perimeter of the site with marks every 10 feet to maintain orientation of the instrument throughout the survey and assure complete coverage of the area.

According to the instrument specifications, the EM61 can detect a metal drum down to a maximum depth of approximately 8 feet. Smaller objects (1-foot or less in size) can be detected to a maximum depth of 4 to 5 feet. The EM61 data were digitally collected at approximately 0.8-foot intervals along north-south trending or east-west trending, generally parallel survey lines, spaced five feet apart. The data were downloaded to a

computer and reviewed in the field and office using the Geonics NAV61 and Surfer for Windows Version 15.0 software programs.

GPR data were acquired across select EM anomalies on August 12, 2019, using a Geophysical Survey Systems, Inc. (GSSI) SIR 4000 controller equipped with a 350 MHz HS antenna. Data were collected both in reconnaissance fashion as well as along formal transect lines across EM features. The GPR data were viewed in real-time using a vertical scan of 512 samples, at a rate of 48 scans per second. GPR data were viewed down to a maximum depth of approximately 6 feet, based on dielectric constants calculated by the DF unit in the field during the reconnaissance scans. GPR transects across specific anomalies were saved to the hard drive of the DF unit for post-processing and figure generation.

Pyramid's classifications of USTs for the purposes of this report are based directly on the geophysical UST ratings provided by the NCDOT. These ratings are as follows:

Geophysical Surveys for Underground Storage Tan	ıks
on NCDOT Projects	

High Confidence	Intermediate Confidence	Low Confidence	No Confidence
Known UST Active tank - spatial location, orientation, and approximate depth determined by geophysics.	Probable UST Sufficient geophysical data from both magnetic and radar surveys that is characteristic of a tank. Interpretation may be supported by physical evidence such as fill/vent pipe, metal cover plate, asphal/concrete patch, etc.	Possible UST Sufficient geophysical data from either magnetic or radar surveys that is characteristic of a tank. Additional data is not sufficient enough to confirm or deny the presence of a UST.	Anomaly noted but not characteristic of a UST. Should be noted in the text and may be called out in the figures at the geophysicist's discretion.

DISCUSSION OF RESULTS

Discussion of EM Results

A contour plot of the EM61 results obtained across the survey area at the property is presented in **Figure 2**. Each EM anomaly is numbered for reference in the figure. The following table presents the list of EM anomalies and the cause of the metallic response, if known:

Metallic Anomaly #	Cause of Anomaly	Investigated with GPR			
1	Known Buried Utility				
2	Sign				
3	Utilities				
4	Reinforced Concrete	\checkmark			
5	Building				
6	Reinforced Concrete	\checkmark			

LIST OF METALLIC ANOMALIES IDENTIFIED BY EM SURVEY

The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface, including a sign, utilities, reinforced concrete, and a building. EM Anomaly 1 was associated with a known buried utility. This was consistent with site plans provided by the NCDOT, the NC 811 markings on the site, and the other parcels surveyed for this project. As such, the utility was confirmed with reconnaissance GPR only. No formal transects were saved and the utility will not be discussed in the GPR results section. EM Anomalies 4 and 6 were associated with reinforced concrete and were investigated with GPR to confirm the presence of reinforcement within the concrete and that the metallic interference from the reinforcement did not obscure any significant buried structures such as USTs.

Discussion of GPR Results

Figure 3 presents the locations of the formal GPR transects performed at the property as well as select transect images. All of the transect images are included in **Appendix A**. A total of sixteen formal GPR transects were performed at the site.

GPR Transects 1-16 were performed in a grid-like fashion across EM Anomalies 4 and 6. These transects confirmed the presence of reinforcement within the concrete slab. No evidence of any significant buried structures such as USTs was observed.

Collectively, the geophysical data <u>did not record any evidence of metallic USTs within the</u> <u>survey area at Parcel 74</u>. **Figure 4** provides an overlay of the metal detection results on the NCDOT MicroStation engineering plans for reference.

SUMMARY & CONCLUSIONS

Pyramid's evaluation of the EM61 and GPR data collected at Parcel 74 in Mooresville, North Carolina, provides the following summary and conclusions:

- The EM61 and GPR surveys provided reliable results for the detection of metallic USTs within the accessible portions of the geophysical survey area.
- The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface.
- GPR was performed across areas containing significant metallic interference associated with reinforced concrete. No additional significant buried structures were identified.
- Collectively, the geophysical data <u>did not record any evidence of metallic USTs</u> within the survey area at Parcel 74.

LIMITATIONS

Geophysical surveys have been performed and this report was prepared for Falcon Engineers in accordance with generally accepted guidelines for EM61 and GPR surveys. It is generally recognized that the results of the EM61 and GPR surveys are non-unique and may not represent actual subsurface conditions. The EM61 and GPR results obtained for this project have not conclusively determined the definitive presence or absence of metallic USTs, but the evidence collected is sufficient to result in the conclusions made in this report. Additionally, it should be understood that areas containing extensive vegetation, reinforced concrete, or other restrictions to the accessibility of the geophysical instruments could not be fully investigated.




APPROXIMATE BOUNDARIES OF GEOPHYSICAL SURVEY AREA



View of Survey Area (Facing Approximately North)




View of Survey Area (Facing Approximately South)



Ν

EM61 METAL DETECTION RESULTS

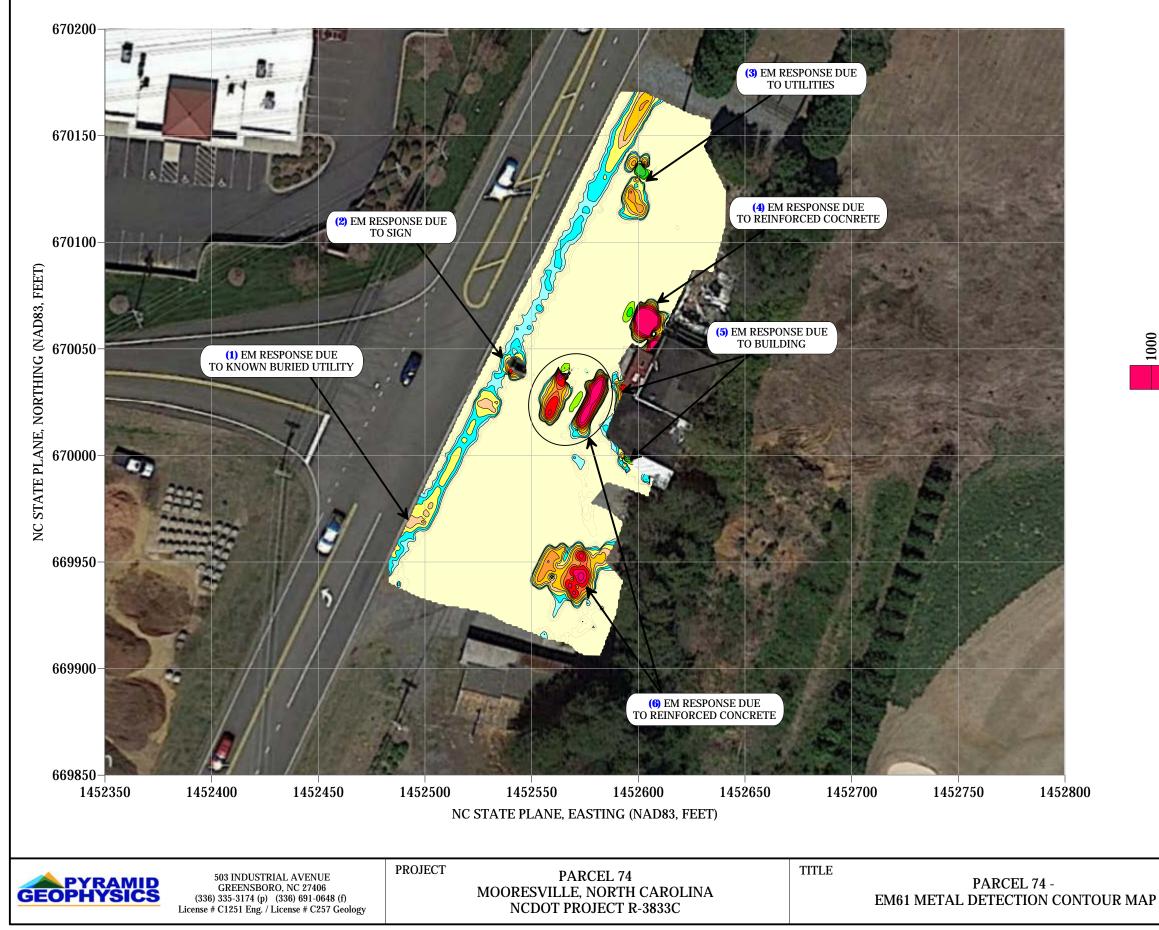

1000

NO EVIDENCE OF METALLIC USTs WAS OBSERVED.

The contour plot shows the differential results of the EM61 instrument in millivolts (mV). The differential results focus on larger metallic objects such as USTs and drums. The EM data were collected on August 11, 2019, using a Geonics EM61-MK2 instrument. Verification GPR data were collected using a GSSI SIR 4000 controller equipped with a 350 MHz HS antenna on August 12, 2019.

> EM61 Metal Detection Response (millivolts)


750	500	400	300	200	150	100	75	00	50	40	30	-90	-100	Ä	ā	-500




 $\overline{}$


DATE	9/3/2019	CLIENT FALCON ENGINEERS
PYRAMID PROJECT #:	2019-260	FIGURE 2

LOCATIONS OF GPR TRANSECTS

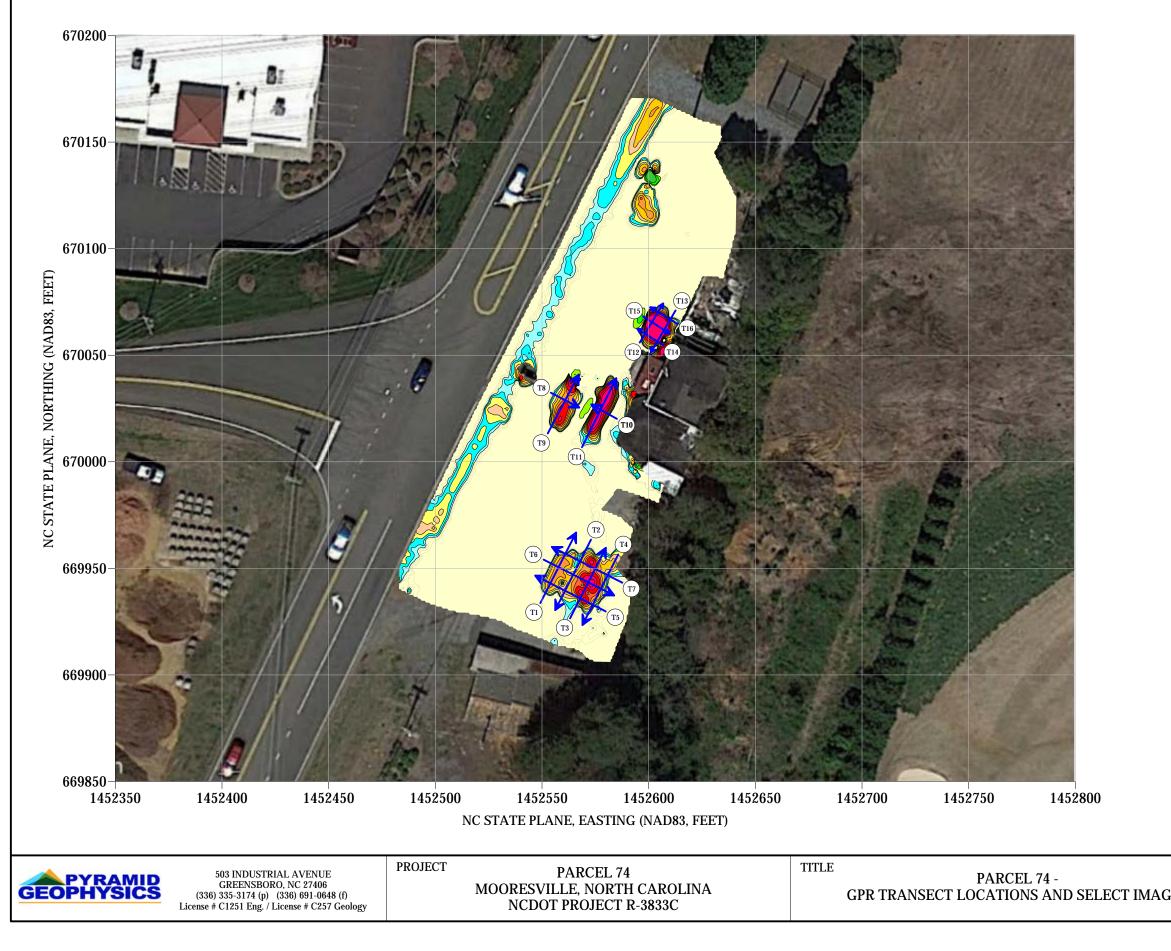


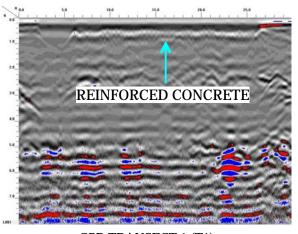

GPR TRANSECT 1 (T1)

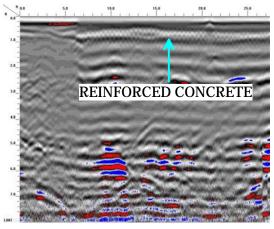


GPR TRANSECT 9 (T9)

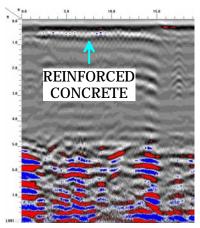


GPR TRANSECT 12 (T12)



	DATE	9/3/2019	CLIENT FALCON ENGINEER		
GES	PYRAMID PROJECT #:	2019-260		FIGURE 3	

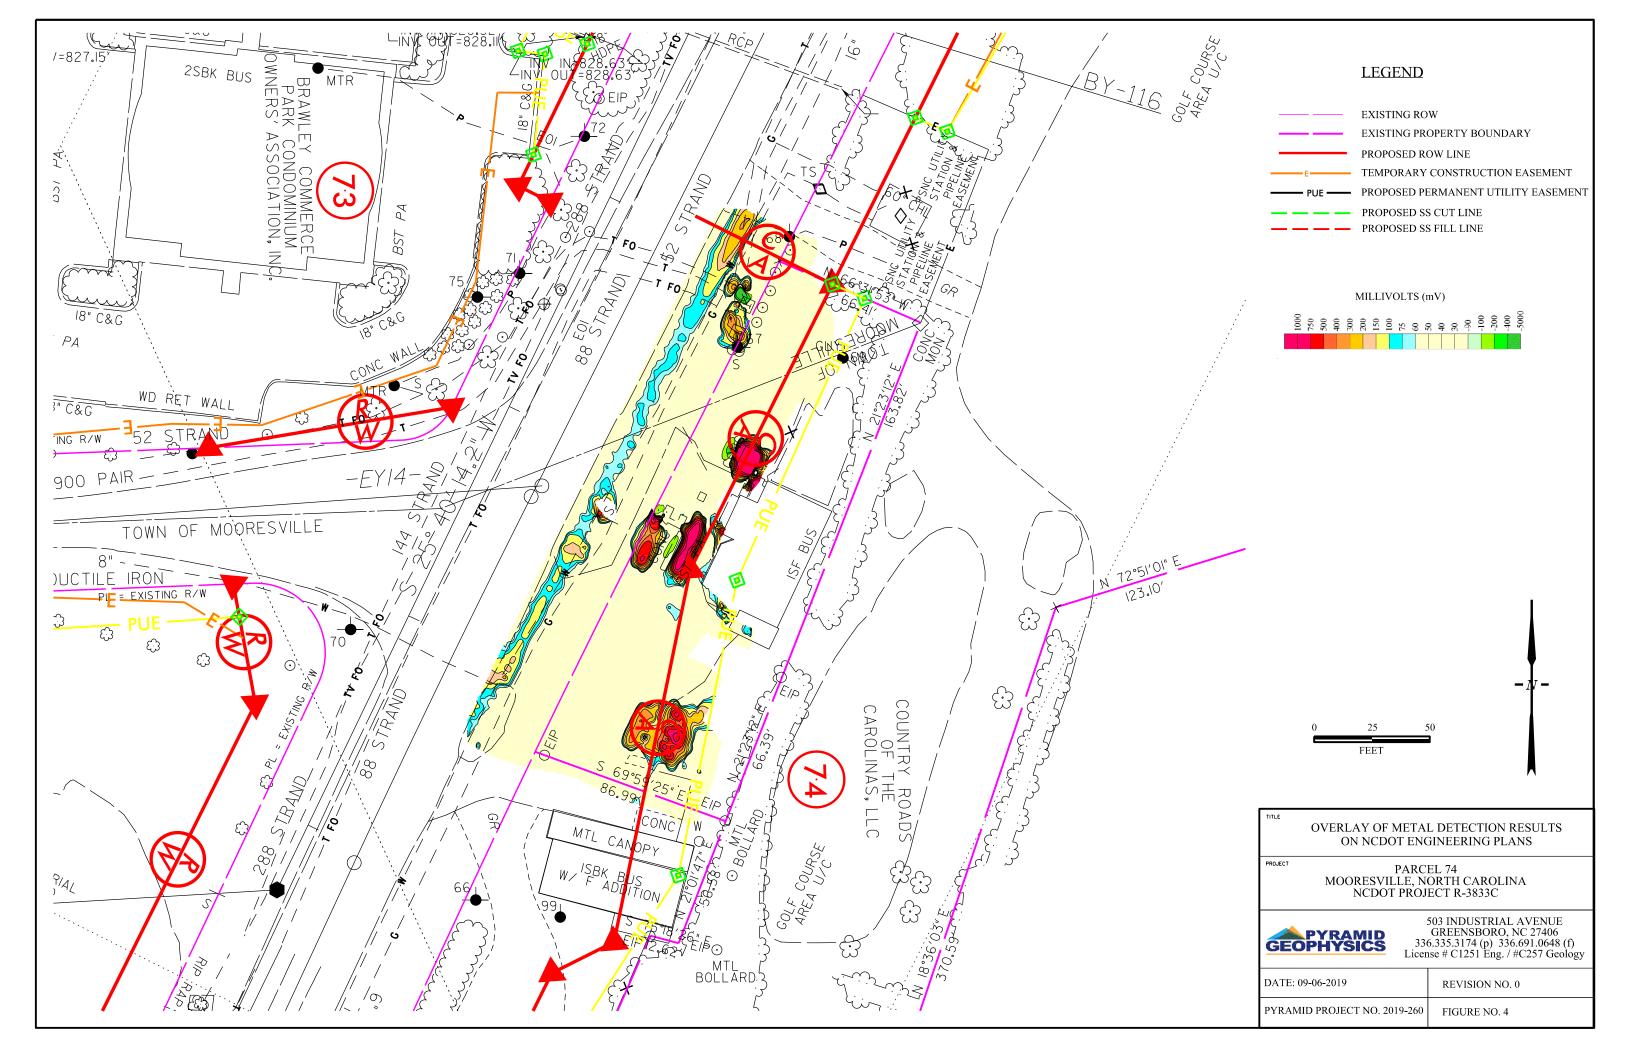


Appendix A – GPR Transect Images

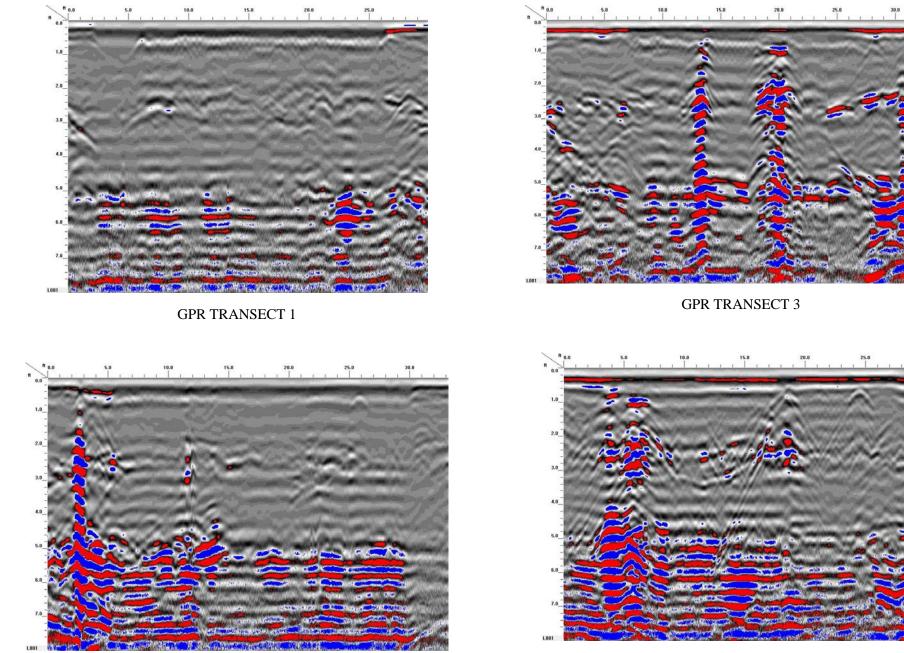


GPR TRANSECT 2


GPR TRANSECT 4

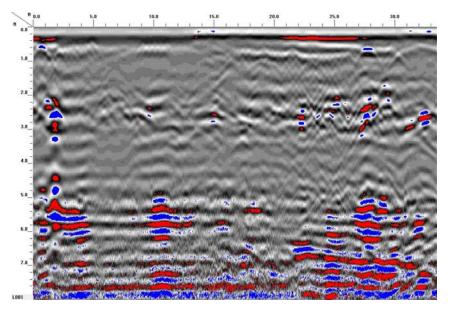


GPR TRANSECT 5

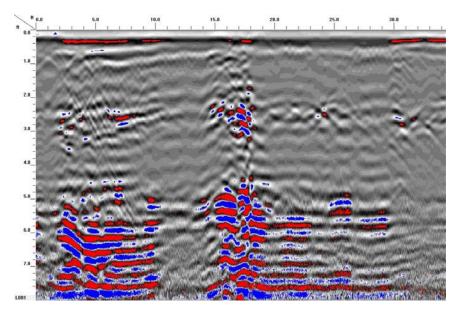


GPR TRANSECT 6

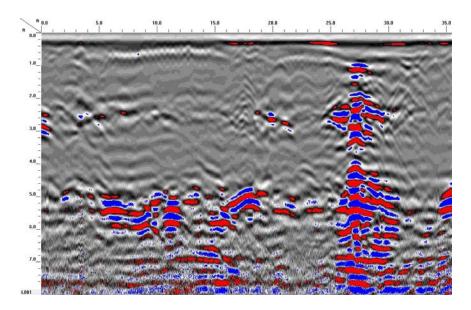


GPR TRANSECT 7

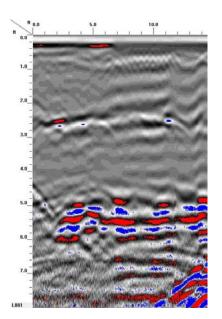


GPR TRANSECT 8

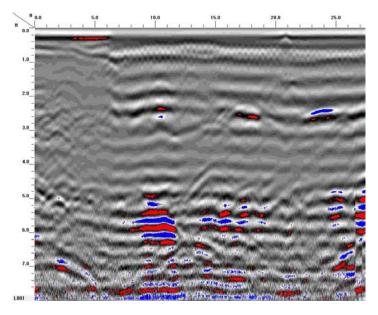


GPR TRANSECT 9

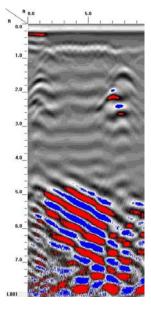


GPR TRANSECT 10

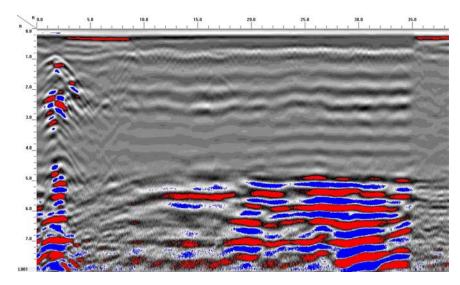


GPR TRANSECT 11

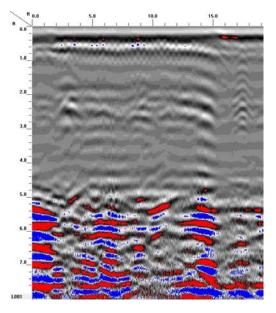


GPR TRANSECT 12

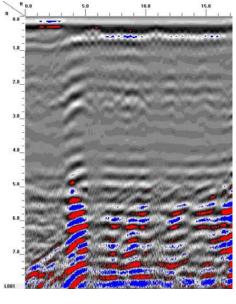


GPR TRANSECT 13

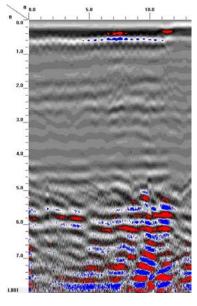

GPR TRANSECT 14

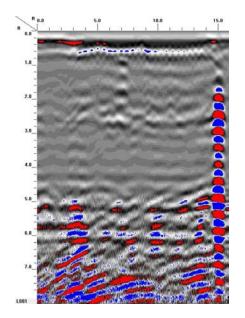

GPR TRANSECT 15

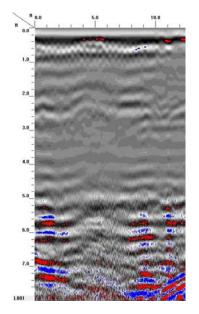

GPR TRANSECT 16

PRELIMINARY SITE ASSESSMENT

SR 1100 (BRAWLEY SCHOOL ROAD) IMPROVEMENTS TIP NO. R-3833C, WBS NO. 34554.2.4

NCDOT PARCEL NO. 76 OWNER: GEORGE HOWARD & LORRA LEE HOLSHOUSER 2869 CHARLOTTE HIGHWAY MOORESVILLE, IREDELL COUNTY, NORTH CAROLINA



PREPARED FOR: NORTH CAROLINA DEPARTMENT OF TRANSPORTATION C/O STANTEC 801 JONES FRANKLIN ROAD SUITE 300 RALEIGH NORTH CAROLINA 27606-3394

PREPARED BY: FALCON ENGINEERING, INC. 1210 TRINITY ROAD, SUITE 110 CARY, NC 27513

PROJECT NUMBER: G18063.02 OCTOBER 27, 2019





October 27, 2019

Mr. A. Dean Sarvis PE Stantec 801 Jones Franklin Road, Suite 300 Raleigh, North Carolina 27606-3394

Re: Preliminary Site Assessment SR 1100 (Brawley School Road) Improvements TIP No. R-3833C, WBS No. 34554.2.4 Parcel No. 76 Owner: George Howard & Lorra Lee Holshouser 2869 Charlotte Highway Mooresville, Iredell County, North Carolina

Dear: Mr. Sarvis:

Falcon is pleased to present the following Preliminary Site Assessment in support of the above-mentioned Project. Specifically, Falcon sampled soil in proximity to the project limits on this parcel in general accordance with the approved scope of work. Soils requiring remediation or special handling during construction were not identified. However, one suspected septic tank within the survey area was identified at Parcel No. 76

Falcon recommends if drums, USTs, above ground storage tanks (ASTs), petroleum odors or sheen are observed during any excavation associated with any property involved in the project that all work in the vicinity stop until further assessment takes place. Further assessment can include but is not limited to; sampling the soil and groundwater, excavation, and proper handling and disposal of contaminated soils and groundwater.

Please review this report and advise us if you have any questions or concerns. We appreciate this opportunity to provide services to you and look forward to partnering with you on future projects. If you have any questions, please give Falcon a call at (919) 871-0800.

Sincerely, **FALCON ENGINEERING, INC.**

histophen Buthant

Christopher J. Burkhardt Environmental Services Manager

-/mk

Jeremy R. Hamm, PE Geotechnical Services Manager

TABLE OF CONTENTS

SECTION	1: INTRODUCTION
	1.1 DESCRIPTION
	1.2 SCOPE OF WORK
SECTION	2: HISTORY
	2.1 PARCEL USAGE
	2.2 FACILITY IDENTIFICATION NUMBER
	2.3 GROUNDWATER INCIDENT NUMBER
SECTION	3: SITE OBSERVATIONS
	3.1 GROUNDWATER MONITORING WELLS
	3.2 ACTIVE USTS
	3.3 FEATURES APPARENT BEYOND ROW/EASEMENT
SECTION	4: METHODOLOGY
	4.1 GEOPHYSICS
	4.2 BORINGS
	4.3 SAMPLE PROTOCOL
SECTION	5: RESULTS10
SECTION	5: RESULTS 10 5.1 GEOPHYSICS 10
SECTION	
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13
	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6: CONCLUSIONS 13 6.1 INTERPRETATION OF RESULTS 13
	5.1 GEOPHYSICS105.2 SAMPLE DATA10TABLE NO. 1 BORING COORDINATES10TABLE NO. 2 PID READINGS11TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS115.3 SAMPLE OBSERVATIONS11TABLE NO. 4 SOIL OBSERVATIONS125.4 QUANTITIES CALCULATIONS126: CONCLUSIONS136.1 INTERPRETATION OF RESULTS136.2 GEOPHYSICS13
SECTION	5.1 GEOPHYSICS105.2 SAMPLE DATA10TABLE NO. 1 BORING COORDINATES10TABLE NO. 2 PID READINGS11TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS115.3 SAMPLE OBSERVATIONS11TABLE NO. 4 SOIL OBSERVATIONS125.4 QUANTITIES CALCULATIONS126: CONCLUSIONS136.1 INTERPRETATION OF RESULTS136.2 GEOPHYSICS136.3 SAMPLING13
SECTION	5.1 GEOPHYSICS 10 5.2 SAMPLE DATA 10 TABLE NO. 1 BORING COORDINATES 10 TABLE NO. 2 PID READINGS 11 TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS 11 5.3 SAMPLE OBSERVATIONS 11 TABLE NO. 4 SOIL OBSERVATIONS 12 5.4 QUANTITIES CALCULATIONS 12 6.1 INTERPRETATION OF RESULTS 13 6.2 GEOPHYSICS 13 6.3 SAMPLING 13 6.4 QUANTITIES 13

LIST OF FIGURES AND ATTACHMENTS

VICINITY MAP USGS TOPOGRAPHIC MAP PARCEL LOCATION MAP BORING LOCATION MAP SITE PHOTOGRAPHS LABORATORY RESULTS GEOPHYSICAL SURVEY

SECTION 1: INTRODUCTION

1.1 DESCRIPTION

Falcon Engineering, Inc. (Falcon) has completed a Preliminary Site Assessment of NCDOT TIP No. R-3833C Parcel No. 76. Parcel No. 76 is addressed as 2869 Charlotte Highway, Mooresville, Iredell County, North Carolina. NCDOT is proposing to improve SR 1100 (Brawley School Road) from SR 1116 (Talbert Road) to 1,000' east of US 21, including improvements to a number of intersecting roads and driveways throughout this corridor. The limits of the assessment are between the existing edge of NCDOT maintained pavement (within the existing NCDOT ROW) where accessible, and the proposed NCDOT ROW and/or easement (whichever boundary represents the largest area). Boring locations were placed in the vicinity of proposed excavations for drainage features, utilities, and roadway/ditch cuts to determine if soils requiring remediation or special handling were present where excavation is planned to take place.

1.2 SCOPE OF WORK

Falcon's scope of work included coordination of; public and private utility location near the proposed borings, geophysical surveys, collecting soil samples with a geoprobe, and laboratory analysis. Samples were analyzed for petroleum via UVF technology.

SECTION 2: HISTORY

2.1 PARCEL USAGE

Falcon performed a Phase I Environmental Site Assessment (ESA) for R-3833C under Project No. G18063.01 dated March 2019. The ESA identified this parcel as a Recognized Environmental Condition (REC) based on the parcel's history as Warren S Auto Service. The facility is listed in City Directories at this address in 2000; however, the date of construction for the building is 1955. This commercial building is currently vacant. Garage doors lead inside the building indicating auto repair work might have taken place inside. Boards covered the windows blocking interior views. This facility is considered a REC based on its history and the potential for an unreported release.

2.2 FACILITY IDENTIFICATION NUMBER

A Facility Identification Number was not identified for this parcel.

2.3 GROUNDWATER INCIDENT NUMBER

A Groundwater Incident Number was not identified for this parcel.

SECTION 3: SITE OBSERVATIONS

3.1 GROUNDWATER MONITORING WELLS

Groundwater monitoring wells (MWs) were not observed on this parcel.

3.2 ACTIVE USTS

Active USTs were not observed within the project limits or registered at this parcel.

3.3 FEATURES APPARENT BEYOND ROW/EASEMENT

USTs, monitoring wells, remediation systems, or hydraulic lifts were not observed within the project limits. However, access to the building was not available. Windows with unobstructed views of the interior were not observed. Therefore; USTs and hydraulic lifts on this parcel cannot be ruled out.

SECTION 4: METHODOLOGY

4.1 GEOPHYSICS

Pyramid Geophysical Services (Pyramid) was subcontracted to perform a geophysical survey of the assessment area. The assessment area consists of the property frontage between the existing edge of NCDOT maintained pavement (within the existing NCDOT ROW) where accessible, and the proposed NCDOT ROW and/or easement (whichever boundary represents the largest area). The survey was used to locate private utility lines, as well as possible indications of USTs, and/or their pits.

The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. Pyramid collected the EM data using a Geonics EM61-MK2 (EM61) metal detector integrated with a Geode External GPS/GLONASS receiver. The integrated GPS system allows the location of the instrument to be recorded in real-time during data collection, resulting in an EM data set that is georeferenced and can be overlain on aerial photographs and CADD drawings.

GPR data was acquired across select EM anomalies (where identified), using a Geophysical Survey Systems, Inc. (GSSI) UtilityScan DF unit equipped with a dual frequency 300/800 MHz antenna. Pyramid marked their findings on the surface with paint. A boundary grid was established around the perimeter of the site with marks every 10 feet to maintain orientation of the instrument throughout the survey and to obtain adequate coverage. A copy of the full Geophysical Report is included in the Attachments.

4.2 BORINGS

Regional Probing was subcontracted to advance soil borings using direct push technology. Regional Probing used a truck mounted Geoprobe® 5410 unit mounted on an off-road modified Ford F350 Diesel 4x4. The unit has auger-capabilities and is equipped with a GH-42 soil-probing hammer, with 21,700 pounds of down force and 28,900 pounds of retraction force. The unit has an on-board tank for decontaminating the geoprobe rods before advancing the probe at each sample location.

4.3 SAMPLE PROTOCOL

Prior to initiating sample collection Falcon contacted NC One Call and requested public utility locations be marked around the proposed sample locations. Sampling was in general accordance with the NC Department of Environmental Quality (DEQ) Division of Waste Management's (DWM) "Guidelines for Site Checks, Tank Closure, and Initial Response and Abatement for UST Releases" (March 1, 2007 Version Change 9 – February 1, 2019) guidance document. Sampling strategy was derived based upon the project scope and objectives as outlined above. Red Lab, LLC was selected to perform the UVF laboratory analytical analysis. Appropriate sterile containers were received by Falcon from Red Lab prior to beginning the fieldwork. The containers were labeled appropriately.

A Minirae 3000 photoionization detector (PID) was used to field screen samples for volatile organics to determine if a release had occurred. The instrument was calibrated per manufacturer instructions prior to use. Falcon staff bagged composite soil samples of each boring in approximately two-foot sections. Representative samples were placed in a sealed plastic bag for approximately 10 minutes to allow soil hydrocarbons to reach equilibrium within the headspace prior to scanning with the PID. One sample per boring was collected from the depth of the proposed cut or from the section above the depth of cut with the highest PID reading.

To avoid cross contamination, a new unused pair of non-powdered nitrile gloves was worn while extracting each sample. Samples were placed in the appropriate laboratory provided containers. The labels on each container were then completed so that each provided the date and time of sampling, method of analysis, sample collector, preservative used and sampling location identification. Samples were placed in an ice filled cooler and transported to the lab. Appropriate chain-of-custody procedures, including the completion of necessary forms, were followed.

SECTION 5: RESULTS

5.1 GEOPHYSICS

The geophysical investigation was performed on August 11 and 12, 2019 to investigate for the presence of unknown, metallic underground storage tanks (USTs) beneath the surface. The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. A total of six EM anomalies were identified. The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface. EM and GPR surveys identified a suspected septic tank just west of the building. The suspected septic tank (Suspected Septic Tank #1) measured approximately 9 feet long by 6.5 feet wide. Collectively, the geophysical data recorded evidence of one suspected septic tank within the survey area at Parcel No. 76.

5.2 SAMPLE DATA

Falcon and our subcontractor advanced three borings (B-19, B-20, and B-21) to the proposed excavation depth of the drainage features, utilities, or roadway/ditch cut being assessed. Groundwater was not observed. Please see the Boring Location Plan in the attachments for a visual depiction of the boring locations. The coordinates (latitude and longitude) that correspond to the boring locations are shown below in Table No. 1 Boring Coordinates.

TABLE NO. 1 BORING COORDINATES

Boring	Latitude	Longitude
B-19	35.5765764	-80.8413032
B-20	35.5765401	-80.8414673
B-21	35.5764401	-80.8415278

The PID screening results are presented in Table No. 2 PID Readings. Borings were field screened with a PID for evidence of volatile organics in sections as indicated in Table No. 2. Falcon selected soil samples based on the field screening results and the needs of the project. Red Lab analyzed the selected samples and their full analytical report is attached. The results of the laboratory analysis are summarized in Table No. 3 Summary of UVF Soil Sampling Results.

Petroleum hydrocarbons above State Action Levels were not detected in the samples.

Boring	Depth BGS*	PID**
B-19	0-2	0.0
D-19	2-4	3.3
B-20	0-2	0.0
B-20	2-4	0.0
B-21	0-2	0.1
D-21	2-4	0.0

TABLE NO. 2 PID READINGS

*BGS = Depth below ground surface in feet

**PID readings are in parts per million

Samples shown in **bold** were selected for analysis

Ormula	BTEX	GRO	DRO	TPH	Total	16			Ratios	-	HC	
Sample ID	(C6 - C9)	(C5 - C10)	(C10 - C35)	(C5 - C35)	5 - Aromatics EPA BaP		BaP	% light	% % mid heavy		Fingerprint Match	
B-19	< 0.33	1.2	0.33	1.53	0.3	< 0.11	< 0.013	91.6	5.5	2.9	Deg.PHC 77.1%,(FCM)	
B-20	<0.45	<0.45	0.45	0.45	0.29	<0.14	< 0.018	0	18.7	81.3	Deg Fuel 54.3%,(FCM)	
B-21	<0.44	<0.44	0.78	0.78	0.48	<0.14	< 0.018	0	69.3	30.7	Deg Fuel 71.9%,(FCM)	

TABLE NO. 3 SUMMARY OF UVF SOIL SAMPLING RESULTS

Results reported in mg/kg (milligrams per kilogram)

5.3 SAMPLE OBSERVATIONS

Obvious visual indications of a release (stained soils, odors, or oily sheen) were not observed. Table No. 4 Soil Observations lists visual soil observations of color and texture.

Sample ID	Depth	Color	Soil Type
B-19	0-2	Brown Red	Slightly Sandy Silt (A-4)
D-19	2-4	Brown Red	Slightly Sandy Silt (A-4)
B-20	0-2	Brown Tan	Slightly Sandy Silt (A-4)
D-20	2-4	Red Brown	Clayey Silt (A-5)
B-21	0-2	Red	Slightly Sandy Silt (A-4)
D-21	2-4	Brown Red	Slightly Sandy Silt (A-4)

TABLE NO. 4 SOIL OBSERVATIONS

Depth is in feet below ground surface

5.4 QUANTITIES CALCULATIONS

Soils requiring quantity calculations were not identified.

SECTION 6: CONCLUSIONS

6.1 INTERPRETATION OF RESULTS

This Preliminary Site Assessment was performed to evaluate the soils in proximity to the project limits on this parcel for the presence of petroleum hydrocarbons. The findings are as follows:

Soil sampling completed on the parcel did not identify contaminants in the soil sampled at levels requiring remediation.

6.2 GEOPHYSICS

Collectively, the geophysical data recorded evidence of one suspected septic tank within the survey area at Parcel No. 76.

6.3 SAMPLING

Sampling results did not identify contaminants in the soil which require remediation in the areas sampled. Based on past project experience, Falcon does not anticipate soil remediation or special handling and disposal will be required during construction on this parcel.

6.4 QUANTITIES

Soils requiring quantities calculations were not identified.

SECTION 7: RECOMMENDATIONS


7.1 ADDITIONAL SAMPLING

Contaminants above the Industrial / Commercial Soil Cleanup Levels were not identified; therefore, additional assessment is not warranted at this time. Falcon recommends if drums, USTs, above ground storage tanks (ASTs), petroleum odors or sheen are observed during any excavation associated with any property involved in the project that all work in the vicinity stop until further assessment takes place. Further assessment can include but is not limited to; sampling the soil and groundwater, excavation, and proper handling and disposal of contaminated soils and groundwater.

7.2 SPECIAL HANDLING OF IMPACTED SOIL

Soils requiring special handling were not identified. If suspect contaminated soils are encountered during construction Falcon and the NCDOT GeoEnvironmental Group should be contacted for proper handling instructions.


NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 76 Vicinity Map

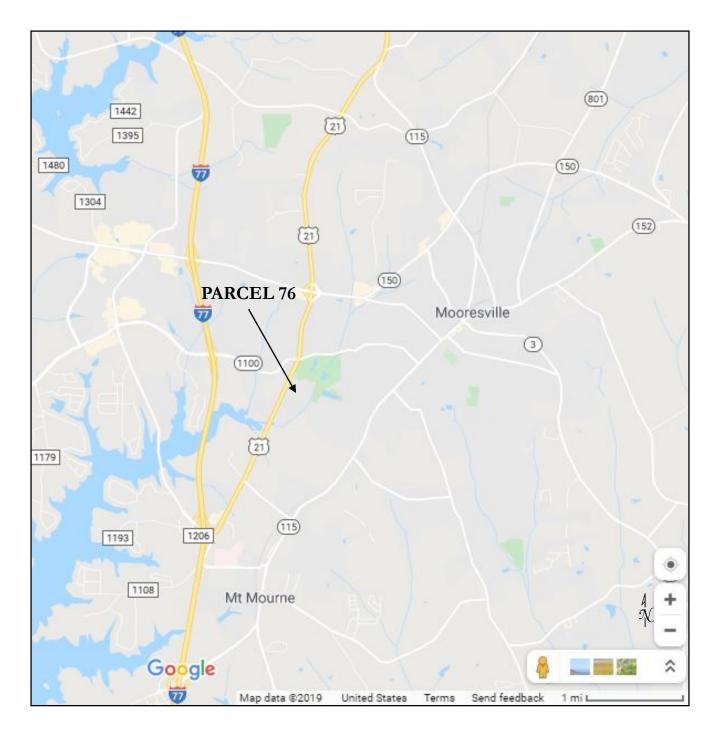

Project No.: G18063.02 Date: October 2019 Source: Google Maps




NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 76 Topographic Map

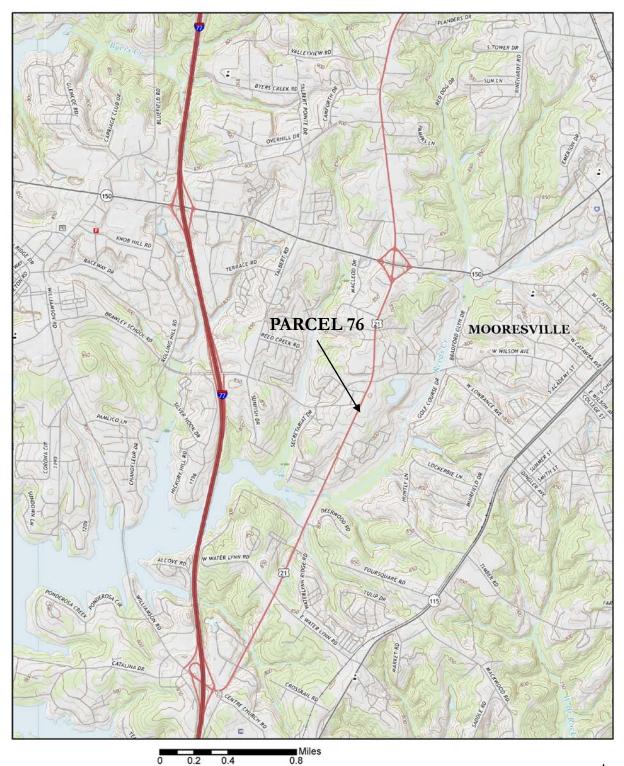

Project No.: G18063.02Date:October 2019Source:"Mooresville, NC" 2016 USGS Topographic Map


NCDOT R-3833C (SR 1100 Improvements) Preliminary Site Assessment Parcel 76 Location Map



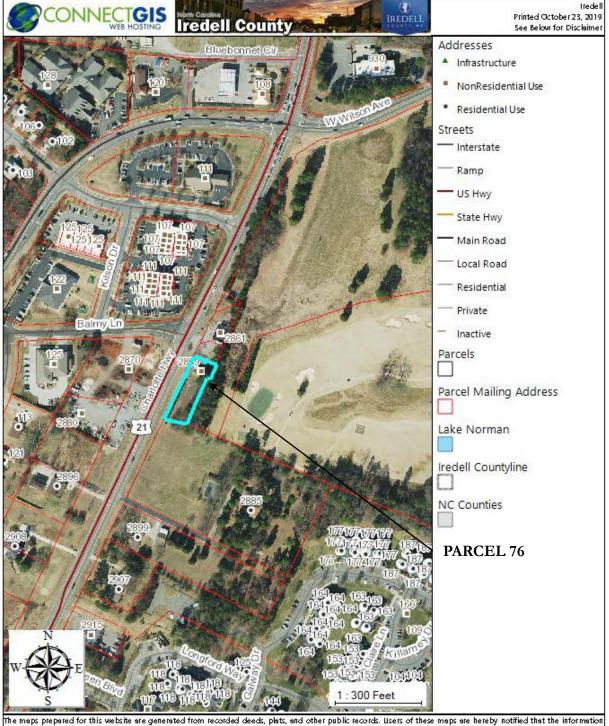

The maps prepared for this website are generated from recorded deeds, plats, and other public records. Users of these maps are hereby notified that the information provided herein should be verified. Iredell County assumes no legal responsibilities for any of the information contained on this site. Users are advised that the use of any of this information is at their own risk. All maps on this site were prepared using a 1000 Ser and the north Carolina State Plane Coordinate System from the 1983 North American Datum. The delinquent real property tax overlay is updated monthly. The information presented is not intended to be used or relied upon as official notice of tax liens. For additional information regarding delinquent taxes, contact the Iredell County Tax Collector's Office.

Project No.: G18063.02 Date: October 2019 Source: Iredell County GIS Website

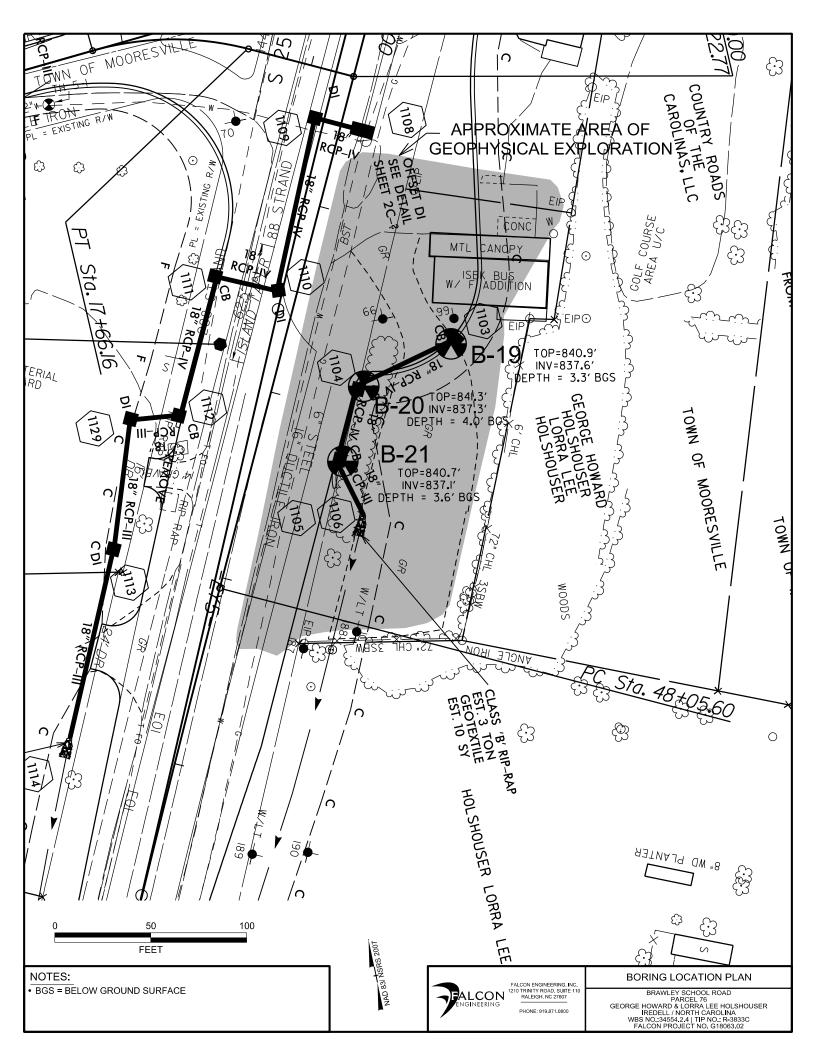





Photograph No. 1: General view of Boring B-19.



Photograph No. 2: General view of Boring B-20.











Photograph No. 3: General view of Boring B-21.


Q	ED												QROS		
				Hydroca	arbon An	alysis R	esults								
Address:	: FALCON ss: 1210 TRINITY RD SUITE 110									Samples taken Samples extracted Samples analysed			10/14 - 10/15/2019 10/14 - 10/15/2019 Wednesday, October 16, 2019		
Contact:	C. Burkhardt									Ор	erator		Harry Wooten		
Project:	G18063														
	1						Total						U0090		
Matrix	Sample ID	Dilution used	BTEX (C6 - C9)	GRO (C5 - C10)	DRO (C10 - C35)	TPH (C5 - C35)	Aromatics (C10-C35)	16 EPA PAHs	BaP	9	% Ratios		HC Fingerprint Match		
							(010 000)			C5 - C10	C10 - C18	C18			
s	B19	13.3	<0.33	1.2	0.33	1.53	0.3	<0.11	<0.013	91.6	5.5	2.9	Deg.PHC 77.1%,(FCM)		
S	B20	17.9	<0.45	<0.45	0.45	0.45	0.29	<0.14	<0.018	0	18.7	81.3	Deg Fuel 54.3%,(FCM)		
S	B21	17.5	<0.44	<0.44	0.78	0.78	0.48	<0.14	<0.018	0	69.3	30.7	Deg Fuel 71.9%,(FCM)		
	Initial	Calibrator	QC check	OK					Final FC	CM QC	Check	OK	99.1 9		
Abbreviatior B = Blank D	on values in mg/kg for soil samples and m ns :- FCM = Results calculated using Fun rift : (SBS)/(LBS) = Site Specific or Library timated aromatic carbon number proportion	damental Cal Background	ibration Moc Subtraction	le : % = confi applied to re	dence of hydr sult : (BO) = E	ocarbon iden 3ackground C	tification : (PFN Organics detect	и) = Poor F ed : (OCR)	ingerprint M	atch : (T) al range) = Turbi : (M) = N	d : (P) =	Particulate detected		

QED Hydrocarbon Fingerprints



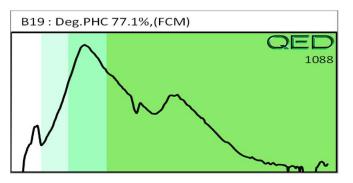

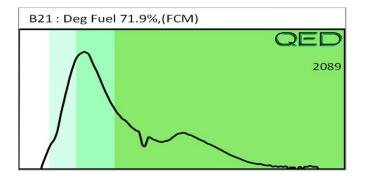

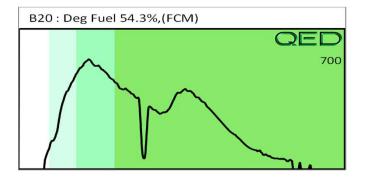



PYRAMID GEOPHYSICAL SERVICES (PROJECT 2019-260)

GEOPHYSICAL SURVEY

METALLIC UST INVESTIGATION: PARCEL 76 NCDOT PROJECT R-3833C

2869 CHARLOTTE HIGHWAY, MOORESVILLE, NC

September 6, 2019

Report prepared for:

Christopher J. Burkhardt, PWS Falcon Engineers 1210 Trinity Rd. #110 Raleigh, NC 27607

Prepared by:

Eric C. Cross, P.G. NC License #2181

Doug Canavello

Reviewed by:

Douglas A. Canavello, P.G. NC License #1066

503 INDUSTRIAL AVENUE, GREENSBORO, NC 27406 P: 336.335.3174 F: 336.691.0648 C257: GEOLOGY C1251: ENGINEERING

GEOPHYSICAL INVESTIGATION REPORT Parcel 76 - 2869 Charlotte Highway Mooresville, Iredell County, North Carolina

Table of Contents

Executive Summary	1
Introduction	
Field Methodology	2
Discussion of Results	
Discussion of EM Results	3
Discussion of GPR Results	4
Summary & Conclusions	
Limitations	

Figures

Figure 1 – Parcel 76 – Geophysical Survey Boundaries and Site Photographs
Figure 2 – Parcel 76 – EM61 Results Contour Map
Figure 3 – Parcel 76 – GPR Transect Locations and Images
Figure 4 – Parcel 76 – Location and Size of One Suspected Septic Tank
Figure 5 – Parcel 76 – Overlay of Metal Detection Results and One Suspected Septic
Tank on NCDOT Engineering Plans

LIST OF ACRONYMS

CADD	Computer Assisted Drafting and Design
DF	
EM	
GPR	Ground Penetrating Radar
GPS	Global Positioning System
NCDOT	North Carolina Department of Transportation
ROW	Right-of-Way
UST	• •

EXECUTIVE SUMMARY

Project Description: Pyramid Environmental conducted a geophysical investigation for Falcon Engineers at Parcel 76, located at 2869 Charlotte Highway in Mooresville, NC. The survey was part of an NCDOT Right-of-Way (ROW) investigation (NCDOT Project R-3833C). The survey was designed to extend from the existing edge of pavement into the proposed ROW and/or easements, whichever distance was greater. Conducted from August 11-12, 2019, the geophysical investigation was performed to determine if unknown, metallic underground storage tanks (USTs) were present beneath the survey area.

Geophysical Results: The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. A total of six EM anomalies were identified. The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface. EM and GPR surveys identified a suspected septic tank just west of the building. The suspected septic tank (Suspected Septic Tank #1) was approximately 9 feet long by 6.5 feet wide. Collectively, the geophysical data recorded evidence of one suspected septic tank within the survey area at Parcel 76.

INTRODUCTION

Pyramid Environmental conducted a geophysical investigation for Falcon Engineers at Parcel 76, located at 2869 Charlotte Highway in Mooresville, NC. The survey was part of an NCDOT Right-of-Way (ROW) investigation (NCDOT Project R-3833C). The survey was designed to extend from the existing edge of pavement into the proposed ROW and/or easements, whichever distance was greater. Conducted from August 11-12, 2019, the geophysical investigation was performed to determine if unknown, metallic underground storage tanks (USTs) were present beneath the survey area.

The site included a vacant building surrounded by concrete, grass, and asphalt surfaces. As per discussions with the property owner, there is possibly a septic tank just west of the building. An aerial photograph showing the survey area boundaries and ground-level photographs are shown in **Figure 1**.

FIELD METHODOLOGY

The geophysical investigation consisted of electromagnetic (EM) induction-metal detection and ground penetrating radar (GPR) surveys. Pyramid collected the EM data using a Geonics EM61-MK2 (EM61) metal detector integrated with a Geode External GPS/GLONASS receiver. The integrated GPS system allows the location of the instrument to be recorded in real-time during data collection, resulting in an EM data set that is georeferenced and can be overlain on aerial photographs and CADD drawings. A boundary grid was established around the perimeter of the site with marks every 10 feet to maintain orientation of the instrument throughout the survey and assure complete coverage of the area.

According to the instrument specifications, the EM61 can detect a metal drum down to a maximum depth of approximately 8 feet. Smaller objects (1-foot or less in size) can be detected to a maximum depth of 4 to 5 feet. The EM61 data were digitally collected at approximately 0.8-foot intervals along north-south trending or east-west trending,

generally parallel survey lines, spaced five feet apart. The data were downloaded to a computer and reviewed in the field and office using the Geonics NAV61 and Surfer for Windows Version 15.0 software programs.

GPR data were acquired across select EM anomalies on August 12, 2019, using a Geophysical Survey Systems, Inc. (GSSI) SIR 4000 controller equipped with a 350 MHz HS antenna. Data were collected both in reconnaissance fashion as well as along formal transect lines across EM features. The GPR data were viewed in real-time using a vertical scan of 512 samples, at a rate of 48 scans per second. GPR data were viewed down to a maximum depth of approximately 6 feet, based on dielectric constants calculated by the DF unit in the field during the reconnaissance scans. GPR transects across specific anomalies were saved to the hard drive of the DF unit for post-processing and figure generation.

Pyramid's classifications of USTs for the purposes of this report are based directly on the geophysical UST ratings provided by the NCDOT. These ratings are as follows:

Geophysical Surveys for Underground Storage Tanks on NCDOT Projects

High Confidence	Intermediate Confidence	Low Confidence	No Confidence
Known UST Active tank - spatial location, orientation, and approximate depth determined by geophysics.	Probable UST Sufficient geophysical data from both magnetic and radar surveys that is characteristic of a tank. Interpretation may be supported by physical evidence such as fill/vent pipe, metal cover plate, asphal/concrete patch, etc.	Possible UST Sufficient geophysical data from either magnetic or radar surveys that is characteristic of a tank. Additional data is not sufficient enough to confirm or deny the presence of a UST.	Anomaly noted but not characteristic of a UST. Should be noted in the text and may be called out in the figures at the geophysicist's discretion.

DISCUSSION OF RESULTS

Discussion of EM Results

A contour plot of the EM61 results obtained across the survey area at the property is presented in **Figure 2**. Each EM anomaly is numbered for reference in the figure. The

following table presents the list of EM anomalies and the cause of the metallic response, if known:

Metallic Anomaly #	Cause of Anomaly	Investigated with GPR
1	Utilities	
2	Known Buried Utility	
3	Suspected Septic Tank	\checkmark
4	Building	
5	Metal Debris on the Surface	
6	Fence	

LIST OF METALLIC ANOMALIES IDENTIFIED BY EM SURVEY

The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface, including utilities, a building, metal debris on the surface, and a fence. EM Anomaly 2 was associated with a known buried utility. This was consistent with site plans provided by the NCDOT, the NC 811 markings on the site, and the other parcels surveyed for this project. As such, the utility was confirmed with reconnaissance GPR only. No formal transects were saved and the utility will not be discussed in the GPR results section. EM Anomaly 3 was associated with a suspected septic tank and was further investigated with GPR.

Discussion of GPR Results

Figure 3 presents the locations of the formal GPR transects performed at the property as well as the transect images. A total of two formal GPR transects were performed at the site.

GPR Transects 1-2 were performed across the suspected septic tank (EM Anomaly 3), just west of the building. These transects showed lateral reflectors, consistent with what is typically observed with septic tanks. The suspected septic tank (Suspected Septic Tank #1) was approximately 9 feet long by 6.5 feet wide. **Figure 4** provides the location and size of the suspected septic tank overlain on an aerial, along with ground-level photographs.

Collectively, the geophysical data <u>recorded evidence of one suspected septic tank within</u> <u>the survey area at Parcel 76</u>. **Figure 5** provides an overlay of the metal detection results and the location of the suspected septic tank on the NCDOT MicroStation engineering plans for reference.

SUMMARY & CONCLUSIONS


Pyramid's evaluation of the EM61 and GPR data collected at Parcel 76 in Mooresville, North Carolina, provides the following summary and conclusions:

- The EM61 and GPR surveys provided reliable results for the detection of metallic USTs within the accessible portions of the geophysical survey area.
- The majority of the EM anomalies were directly attributed to visible cultural features at the ground surface.
- EM and GPR surveys identified a suspected septic tank just west of the building. The suspected septic tank (Suspected Septic Tank #1) was approximately 9 feet long by 6.5 feet wide.
- Collectively, the geophysical data <u>recorded evidence of one suspected septic tank</u> within the survey area at Parcel 76.

LIMITATIONS

Geophysical surveys have been performed and this report was prepared for Falcon Engineers in accordance with generally accepted guidelines for EM61 and GPR surveys. It is generally recognized that the results of the EM61 and GPR surveys are non-unique and may not represent actual subsurface conditions. The EM61 and GPR results obtained for this project have not conclusively determined the definitive presence or absence of metallic USTs, but the evidence collected is sufficient to result in the conclusions made in this report. Additionally, it should be understood that areas containing extensive vegetation, reinforced concrete, or other restrictions to the accessibility of the geophysical instruments could not be fully investigated.

APPROXIMATE BOUNDARIES OF GEOPHYSICAL SURVEY AREA

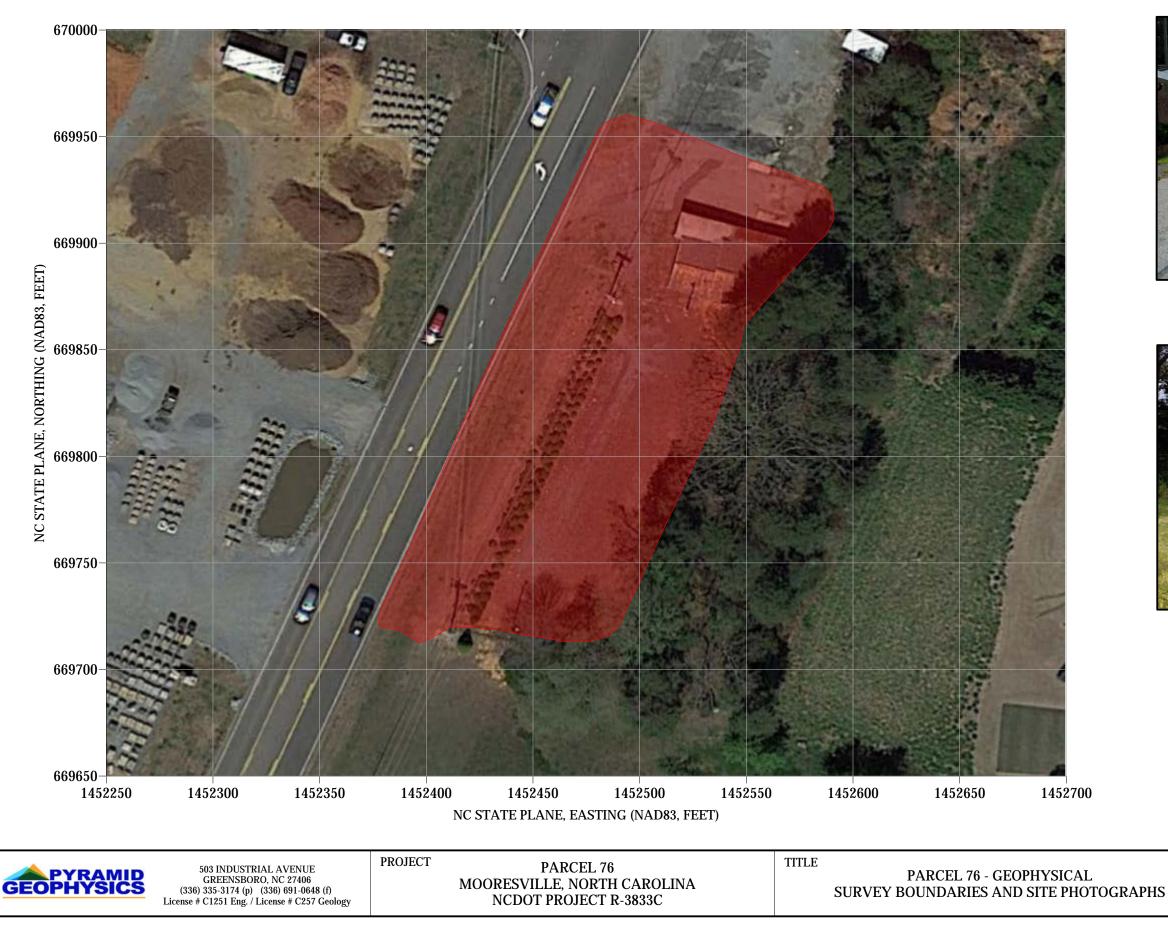




View of Survey Area (Facing Approximately South)




View of Survey Area (Facing Approximately South)



Ν

EM61 METAL DETECTION RESULTS

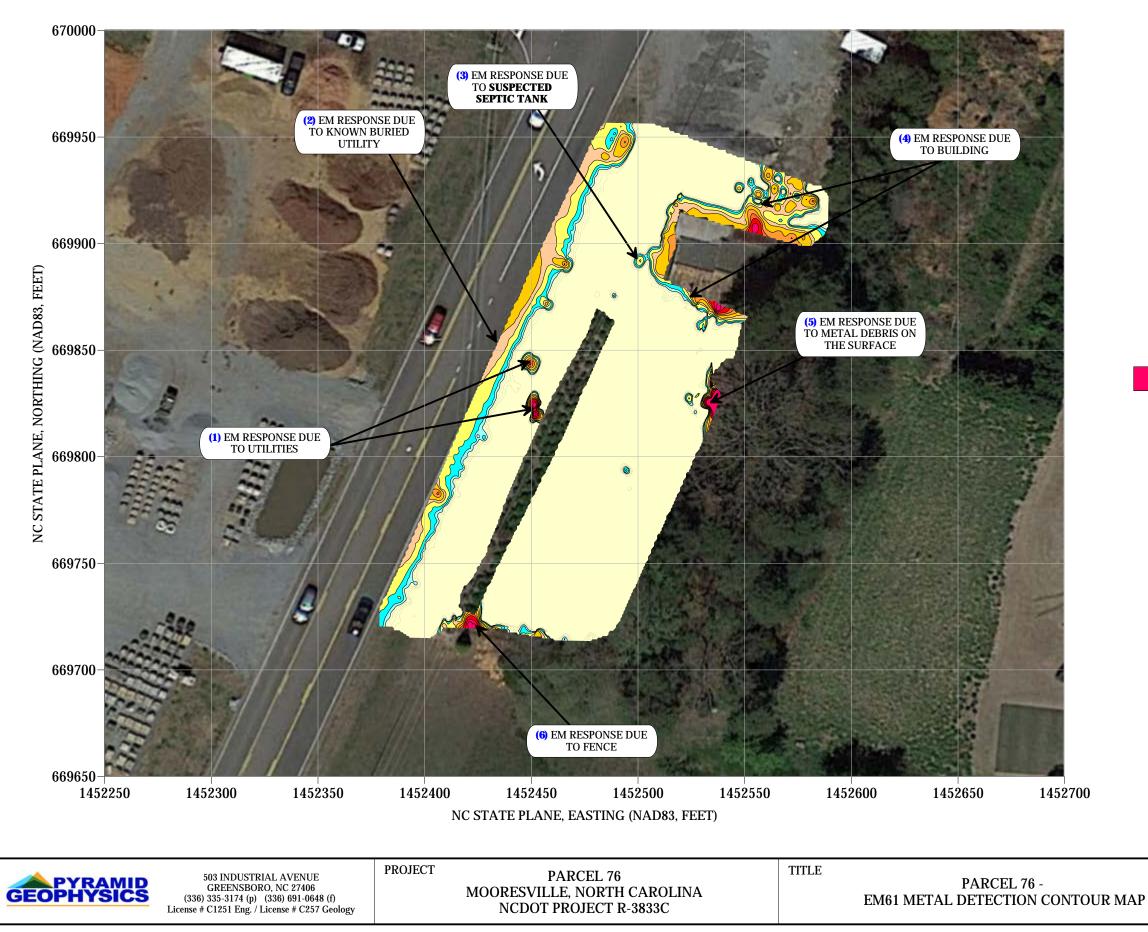

EVIDENCE OF ONE SUSPECTED SEPTIC TANK WAS OBSERVED.

The contour plot shows the bottom coil results of the EM61 instrument in millivolts (mV). The bottom coil presents a higher-amplitude response to any metal identified by the instrument. Differential data (difference between top and bottom coils) were not used for this parcel due to overhead electrical interference. The EM data were collected on August 11, 2019, using a Geonics EM61-MK2 instrument. Verification GPR data were collected using a GSSI SIR 4000 controller equipped with a 350 MHz HS antenna on August 12, 2019.

> EM61 Metal Detection Response (millivolts)

1000	750	500	400	300	200	150	100	75	60	50	40	30	-90	-100	-200	-400	-5000	




DATE	9/3/2019	CLIENT FALCON ENGINEERS
PYRAMID PROJECT #:	2019-260	FIGURE 2


LOCATIONS OF GPR TRANSECTS



NCDOT PROJECT R-3833C

GPR TRANSECT LOCATIONS AND IMAGES

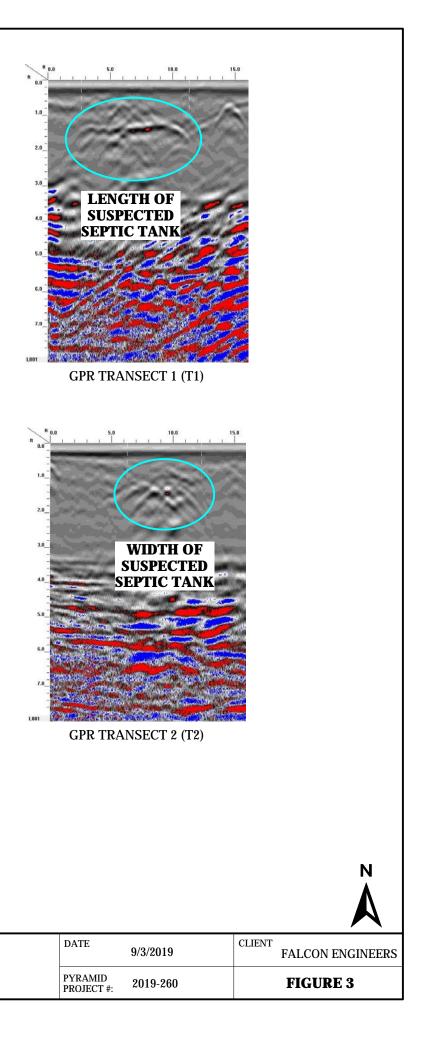

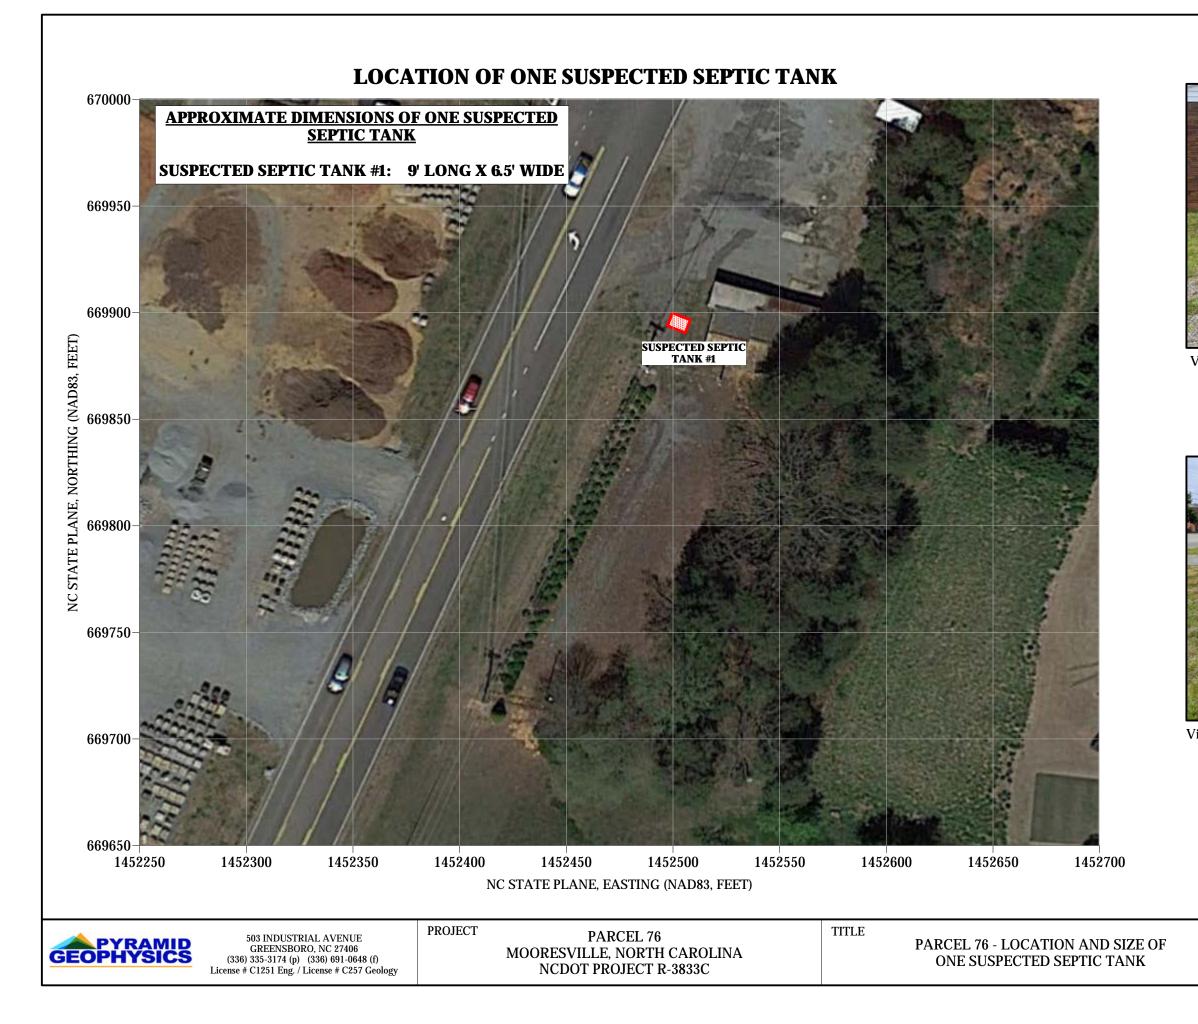



View of One Suspected Septic Tank Facing Approximately East



View of One Suspected Septic Tank Facing Approximately North

DATE	9/3/2019	CLIENT	FALCON ENGINEERS
PYRAMID PROJECT #:	2019-260		FIGURE 4

Ν

