



SHOULDER BERM GUTTER SUMMARY

EBL /WBL	MILEPOST	MILEPOST	LENGTH
MAP 1 – EBL	393.27	393.39	550
EBL	397.08	397.15	337.5
EBL	398.19	398.31	637.5
EBL	398.74	398.75	87.5
EBL	404.96	405.19	1187.5
EBL	405.63	405.68	225
EBL	407.16	407.25	250
MAP 2 – WBL	407.21	407.16	150
WBL	405.68	405.62	225
WBL	405.18	404.97	1025
WBL	398.72	398.70	75
WBL	398.23	398.14	400
WBL	397.15	397.08	325
WBL	395.64	395.62	50
WBL	393.38	393.29	450
		TOTAL:	5,975
		SAY:	5,975


DETAILS OF REPAIRING EXISTING PAVEMENT PRIOR TO RESURFACING FOR FULL DEPTH AND MILLING

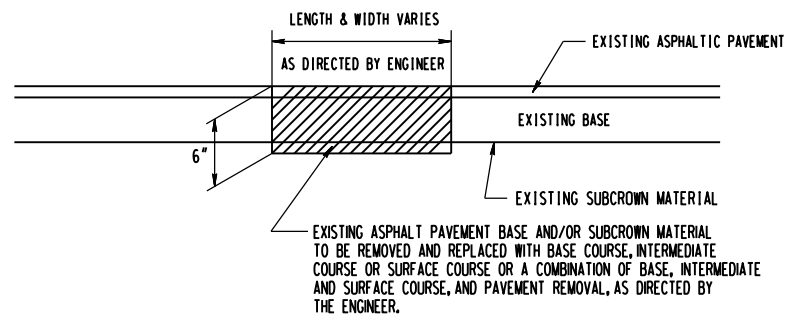


DETAIL NO. 1

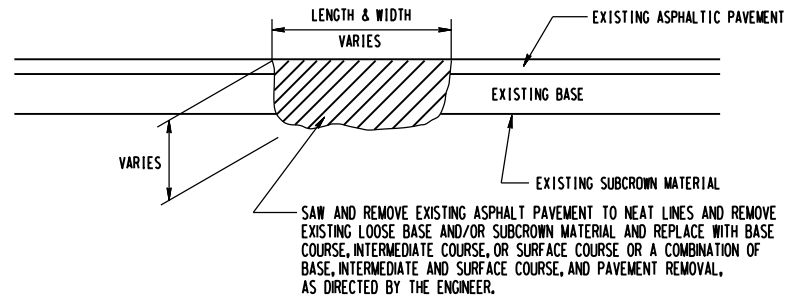


DETAIL NO. 2

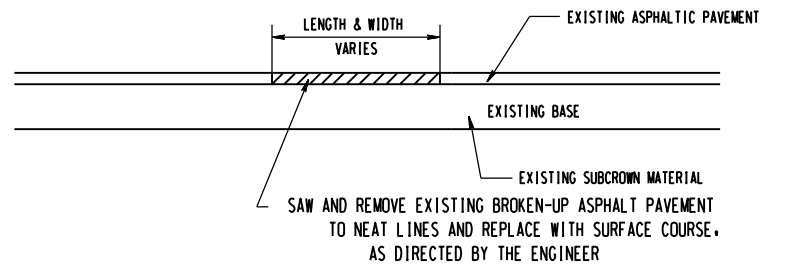

DETAIL NO. 3

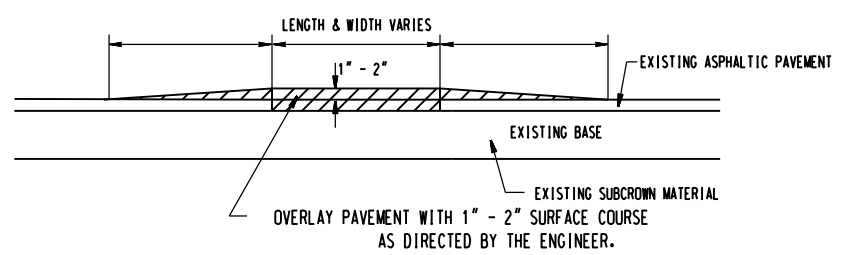

DETAIL NO. 4

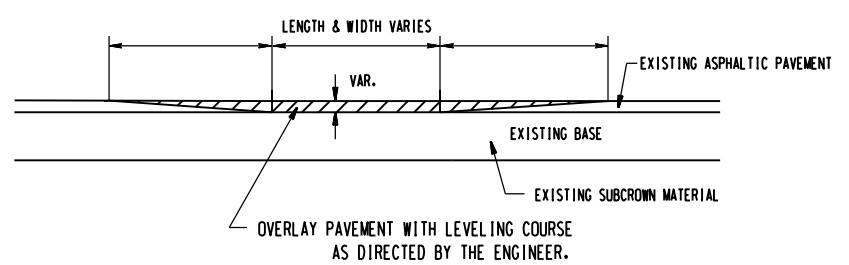

DETAIL NO. 5

REVISIONS
 16-DEC-2016 16:53
 S:\DIVISION\Rehab\2016\1-40 Resurfacing\Interstate Rehab\2016\1-40 Resurfacing\Revisions\121615\1-5722-1-40.Rdy.Patch & SBB.dgn
 \$\$\$SUBSTRNAME\$\$\$