



+

+

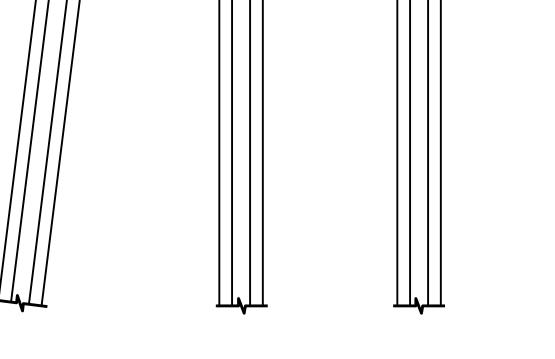

ELEVATION SOUTH SIDE

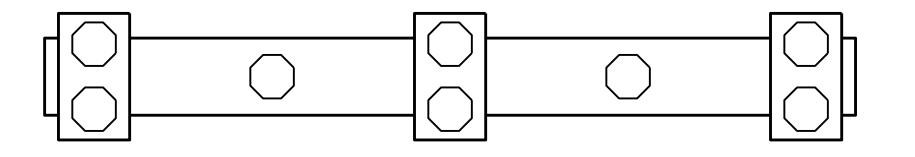

PLAN bottom of cap

DRAWN BY :	M.A.LEE	DATE : <u>8/2016</u>
CHECKED BY :	P.BRYANT	DATE : <u>8/2016</u>

NOTES:


REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR CAP AND COLUMN REPAIR DETAILS, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

FOR ``SHOTCRETE REPAIRS'', SEE SPECIAL PROVISIONS.


FOR "EPOXY RESIN INJECTION", SEE SPECIAL PROVISIONS.

FOR "EPOXY COATING", SEE SPECIAL PROVISIONS.

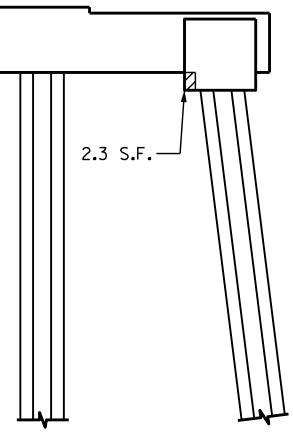

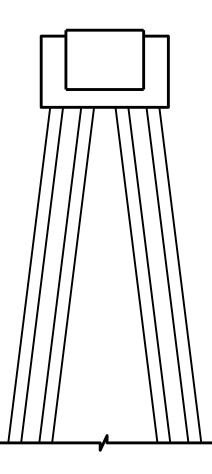



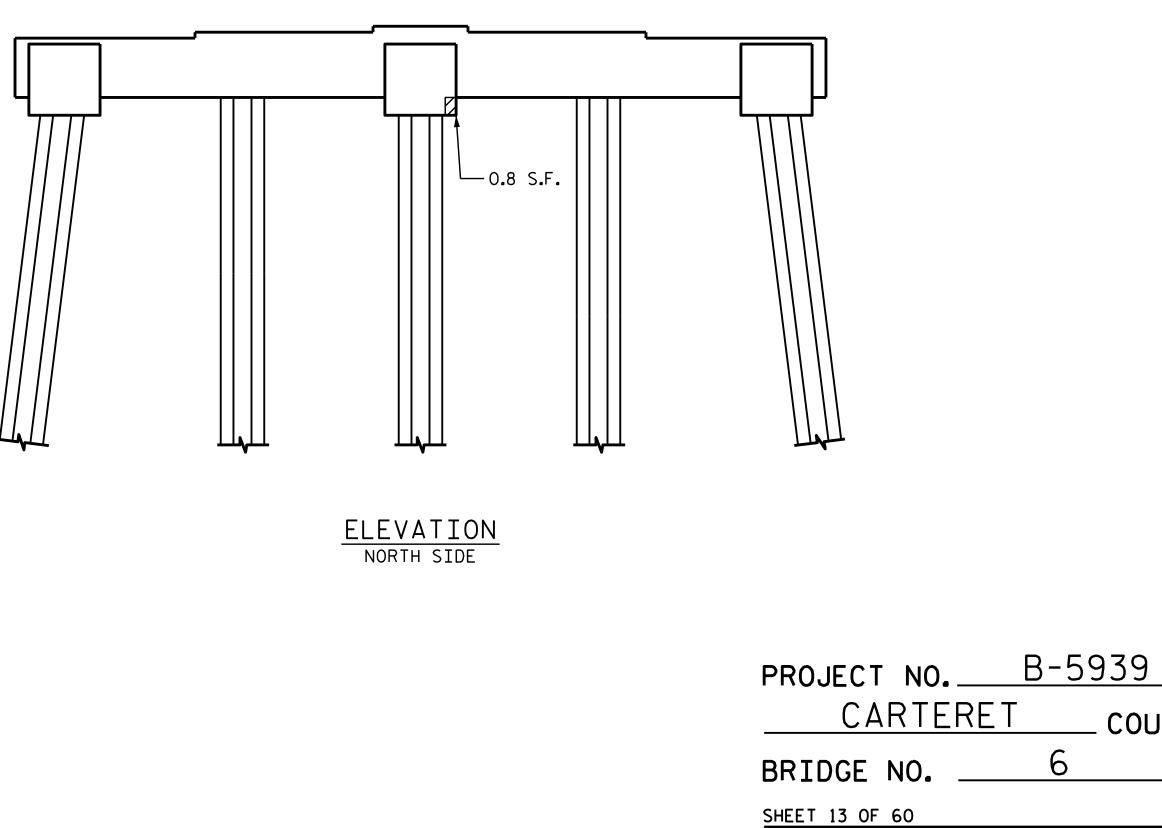

REPAIR QUANTITY TABLE									
REPAIRS BENT 12	QUANTITIES								
REFAINS DENT IZ	ESTIMATE		ACTUAL						
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF					
CAP (VERTICAL FACE)	3.1	1.6							
CAP (HORIZONTAL, CORNER)	0	0							
EPOXY RESIN INJECTI	LN.FT		LN.FT						
САР	0								
VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN. 2"CL TO SAWCUT. SEE REPAIR DETAILS.									

- SHOTCRETE REPAIR

ERI - EPOXY RESIN INJECTION

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION

6

COUNTY

SUBSTRUCTURES BENT 12

DocuSigned by: Greg Dickey 884E46B8CE5B4B6							
	REVISIONS					SHEET NO.	
DOCUMENT NOT CONSIDERED	N0.	BY:	DATE:	NO.	BY:	DATE:	S2-83
FINAL UNLESS ALL	1			3			TOTAL SHEETS
SIGNATURES COMPLETED	2			4			

ESSIN

SEAL 21271

SACINEE