

06-JUN-2017 08:43 R:\Structures\Plans\FinalDGN's\403_033_I5839_SMU_ B1_410131_S14.dgn jdhawk

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.


FOR CAP AND COLUMN REPAIR DETAILS, SEE "TYPICAL CAP AND COLU REPAIR DETAILS" SHEET.


FOR ``SHOTCRETE REPAIRS'', SEE SPECIAL PROVISIONS.


FOR ``EPOXY RESIN INJECTION'', SEE SPECIAL PROVISIONS.

	 •□•	•□•	
	 .□.		

SPAN B SPAN A



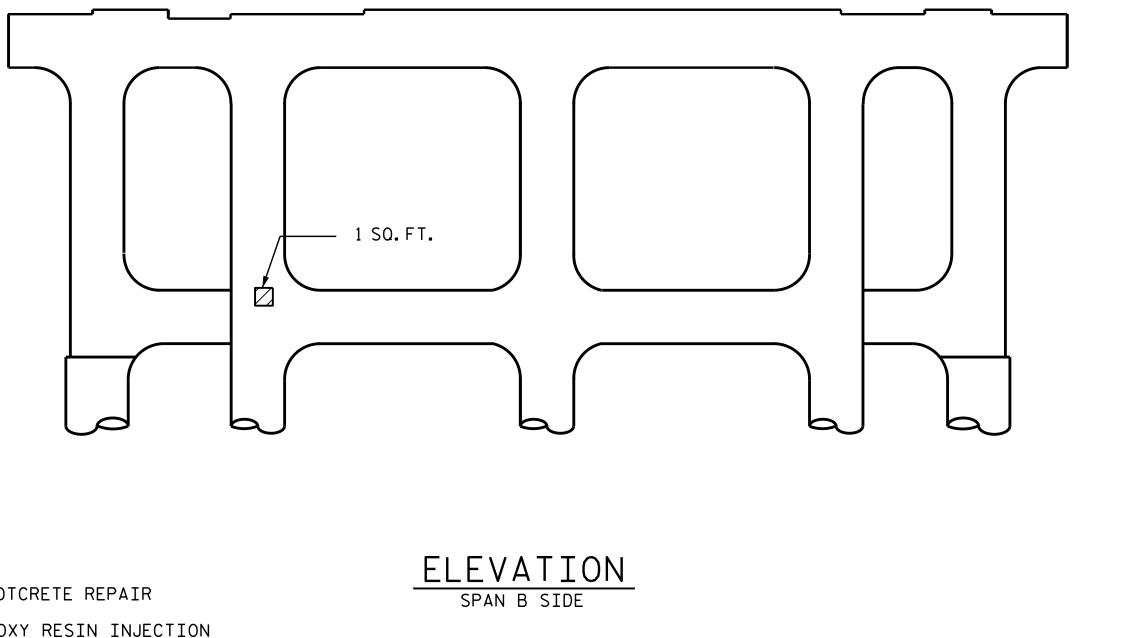



 	 1

REPAIR QUANTITY TABLE						
REPAIRS BENT 1	QUANTITIES					
NEFAINS DENT I	ESTI	ΜΑΤΕ	ACTUAL			
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF		
CAP (VERTICAL FACE)	0.0	0.0				
MN CAP (HORIZONTAL, CORNER)	0.0	0.0				
COLUMN	2.0	1.0				
STRUT	4.0	2.0				
FOOTER	0.0	0.0				
EPOXY RESIN INJECTI	EPOXY RESIN INJECTION			LN. FT		
САР	CAP					
COLUMN	COLUMN STRUT					
STRUT						
FOOTER		0.0				
EPOXY COATING	AREA SF					
TOP OF CAP	193.4					
VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN.1"CL TO SAWCUT.SEE REPAIR DETAILS.						

	PROJEC BRIDGE	HALIF		Х	-5839 co 31) UNTY
OROFESSION SEAL 030024 Docusigned by: Uster Abraha DDA094AED5104FD.	DEPARTMENT OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE BENT 1				TION	
6/6/2017	REVISIONS SHEET NO.					
DOCUMENT NOT CONSIDERED	NO. BY:	DATE:	NO. ଭ	BY:	DATE:	S-14
FINAL UNLESS ALL SIGNATURES COMPLETED	1		3 4			TOTAL SHEETS 42