

+

## NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE, IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

CONTRACTOR SHALL SAW CUT TO A MINIMUM OF  $\frac{1}{2}$ " BUT REINFORCING STEEL SHALL NOT BE DAMAGED.

CONTRACTOR SHALL REMOVE SURFACE CONCRETE TO VERIFY THAT SAWCUT DEPTH WILL NOT DAMAGE EXISTING REINFORCING STEEL.

CONCRETE REPAIRS MAY BE USED IN LIEU OF SHOTCRETE REPAIRS, WITH THE APPROVAL OF THE ENGINEER.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.


FOR CAP AND PILE REPAIR DETAILS, SEE "TYPICAL CAP AND PILE REPAIR DETAILS" SHEET S-56.

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 2" CLEAR TO SAWCUT, SEE REPAIR DETAILS.


FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

FOR GALVANIC CATHODIC PROTECTION INTEGRAL PILE JACKET, SEE SPECIAL PROVISIONS.


FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.



END VIEW SOUTH SIDE

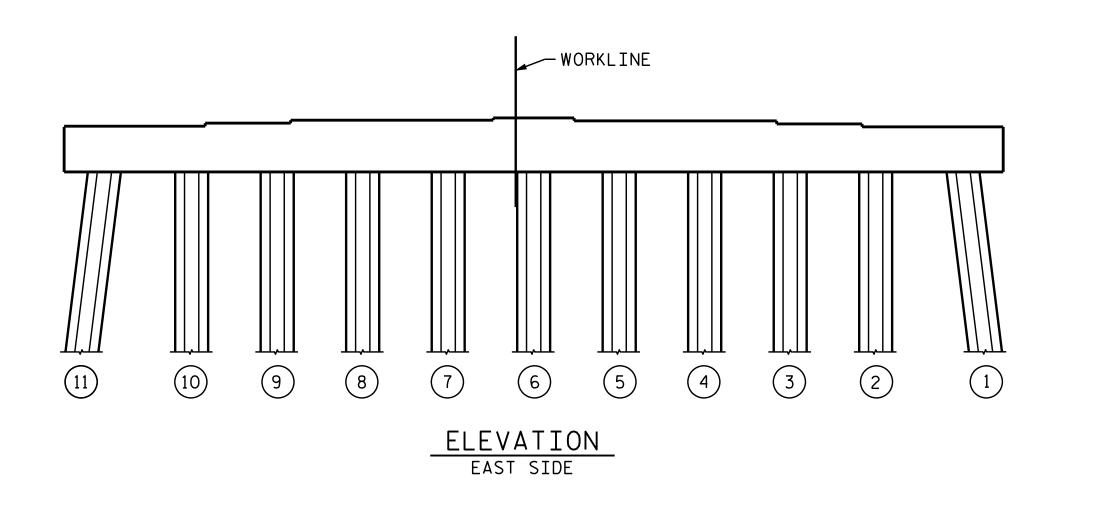

NOTES

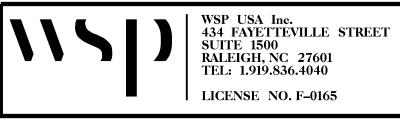

REPAIR QUANTITY TABLE				
BENT 1	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP (VERICAL FACE)				
CAP (HORIZONTAL FACE)				
22" OCT. PREST. CONC. PILES				
CONCRETE REPAIRS				
EPOXY COATING	AREA SF		AREA SF	
TOP OF CAP	170.0			
PILE JACKET	LENGTH LN.FT.		LENGTH LN.FT.	
PILE NUMBERS :				

## SHOTCRETE REPAIR

PROJECT NO. 15BPR.19 CONCRETE REPAIR NEW HANOVER COUNTY 640021 BRIDGE NO.\_ SHEET 2 OF 15 STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETE BENT 1 CAR REPAIRS ROFESSION SEAL Casey Howa SHEET NO. REVISIONS S-33 NO. BY: DATE: DATE: BY: 10/19/2020 total sheets 58