
+

+

| | AS-BUILT REPAIR QL | IANTITY | TABLE | |
|---|---|--------------|--------|--|
| | TOP OF DECK REPAIRS | | | |
| | | ESTIMATE | ACTUAL | |
| | SCARIFYING BRIDGE DECK | 728 SQ.YDS. | | |
| | CLASS II SURFACE PREPARATION | 2.3 SQ. YDS. | | |
| | CONCRETE DECK REPAIR FOR PC OVERLAY | 2.3 SQ. YDS. | | |
| | SHOTBLASTING BRIDGE DECK | 728 SQ.YDS. | | |
| | PC MATERIALS | 35.4 CU.YDS. | | |
| PLACING AND FINISHING PC OVERLAY | | 728 SQ.YDS. | | |
| | GROOVING BRIDGE FLOORS | | | |
| | | | | |
| TOP OF DECK REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR PC OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE.(MIN.2"CLEAR TO SAWCUT).SEE OVERLAY SURFACE PREPARATION FOR POLYMER CONCRETE SPECIAL PROVISION. | | | | |
| DRAWN BY :R.L.PUTEK/E CHECKED BY :H.A.LOCH | <u>.BAYISSA</u> DATE : <u>07/2021</u> <u>KLEAR</u> DATE : <u>07/2021</u> | | | |
| | | | | |

€ JOINT ----@ BENT 2 © JOINT ---⁄ @ BENT 1

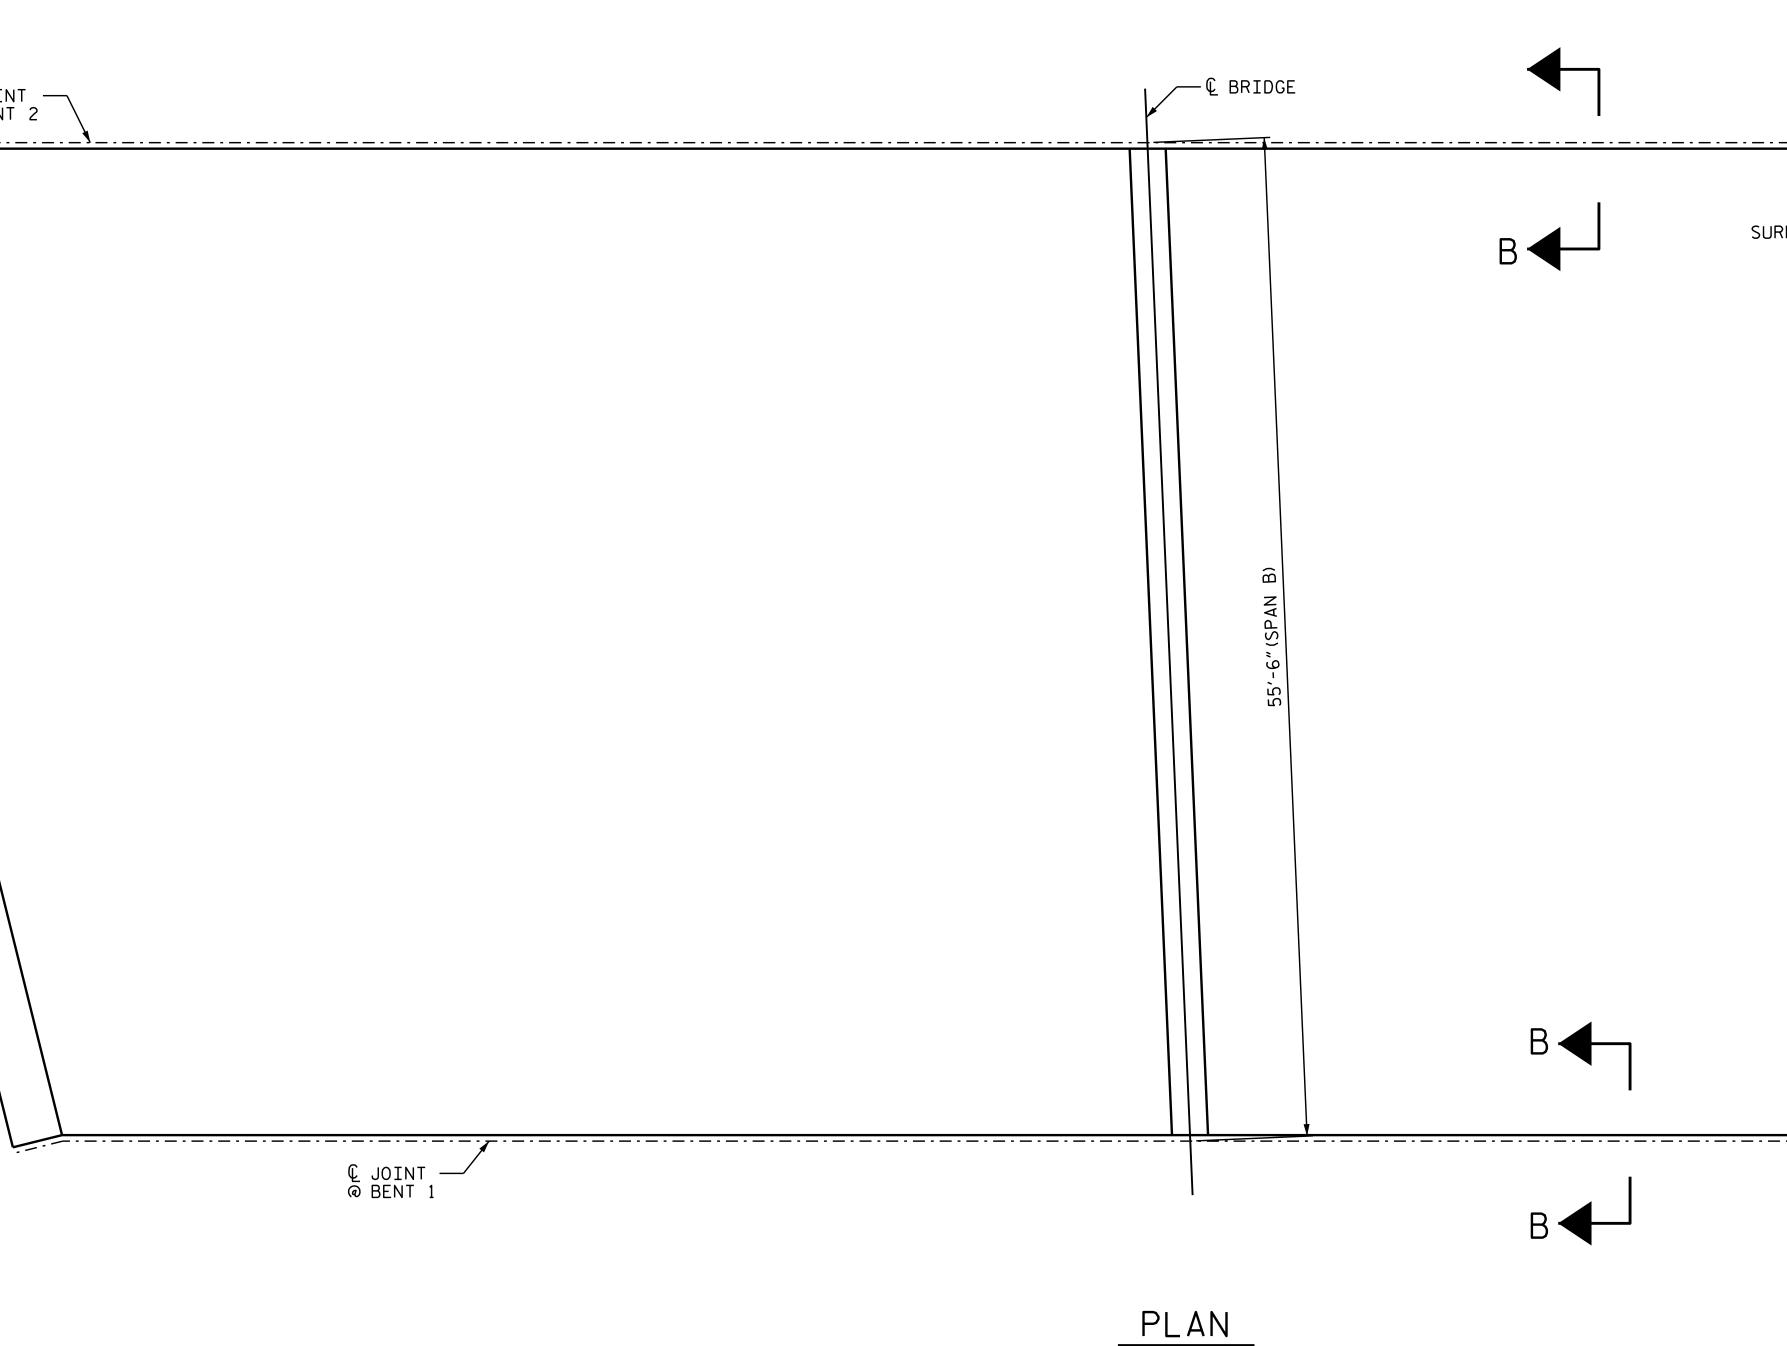

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE.IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER,THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR SECTION B-B, SEE "JOINT DETAILS" SHEET.

FOR CONCRETE DECK REPAIR FOR PC OVERLAY, SEE SPECIAL PROVISION.

FOR PC MATERIALS, SEE SPECIAL PROVISION.



APPROX.CLASS II SURFACE PREPARATION

----- EPOXY RESIN INJECTION (ERI)

| PROJECT NO. <u>I-5746C</u> <u>MECKLENBURG</u> COUNTY BRIDGE NO. <u>590320</u> SHEET 2 OF 3 STATE OF NORTH CAPALINA DEPARTMENT OF TRANSPORTATION RALEIGH DECK SURFACE REPAIR SPAN B | 2.0 SY CLASS II 0.3 SY CLASS II SURFACE PREP. | |
|--|---|--|
| FINAL UNLESS ALL 1 3 SHEETS | DOCUMENT NOT CONSIDERED | MECKLENBURG COUNTY BRIDGE NO. 590320 SHEET 2 OF 3 STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH DECK SURFACE REPAIR SPAN B |