NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS SHEETS. ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >= 1/16" AS DESCRIBED IN THE SPECIAL PROVISIONS.

AVERAGE CONCRETE COVER IS EXPECTED AS FOLLOWS; DECK & DIAPHRAGMS: 21/2" GIRDERS: 21/2" TO REBAR AND 11/2" TO P/S STRANDS FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS"

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO PRESTRESSED CONCRETE GIRDERS, SEE SPECIAL PROVISIONS FOR "PRESTRESSED CONCRETE GIRDERS WITH THERMAL SPRAY ANODE".

ADDITIONAL QUANTITIES OF CONCRETE REPAIR AREAS ARE ANTICIPATED. DUE TO LACK OF INFORMATION, ALL AREAS ARE NOT KNOWN. QUANTITY INCLUDES CONTINGENCIES AND ARE ANTICIPATED TO BE SUFFICIENT FOR ACTUAL QUANTITIES ENCOUNTERED.


CONTRACTOR IS RESPONSIBLE FOR REPAIRING ALL MISSING AND/OR DAMAGED RAIL COMPONENTS, AS WELL AS TIGHTENING ALL LOOSE RAIL CONNECTIONS.

FOR 2-BAR METAL RAIL REPAIRS, SEE SPECIAL PROVISIONS.

FOR BEARINGS, SEE BEARING REPLACEMENT SHEETS.

	LEGEND	AS-BUILT REPAIR	QUAN	ITITY	TABL	.E	
	P/S CONC.GIRDER REPAIR (PSGR)		QUANTITIES				
			ESTIMATE		ACT	ACTUAL	
	SHOTCRETE REPAIR (SCR)	SHOTCRETE REPAIRS	AREA SQ.FT.	VOLUME CU. FT.	AREA SQ.FT.	VOLUME CU. FT.	
	EPOXY RESIN INJECTION (ERI)	UNDERSIDE OF DECK & OVERHANG					
	ELASTOMERIC BEARING PAD REPLACEMENT (EBPR)	DIAPHRAGMS					
		RAILS					
		P/S CONC.GIRDER REPAIRS	AREA SQ. FT.	VOLUME CU. FT.	AREA SQ. FT.	VOLUME CU. FT.	
		GIRDERS	0.5	0.3			
		EPOXY RESIN INJECTION	TIN. FT. 77.0 4.0		LIN.FT.		
		DECK, DIAPHRAGMS, AND PARAPETS					
		GIRDERS					

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE. MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT. FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

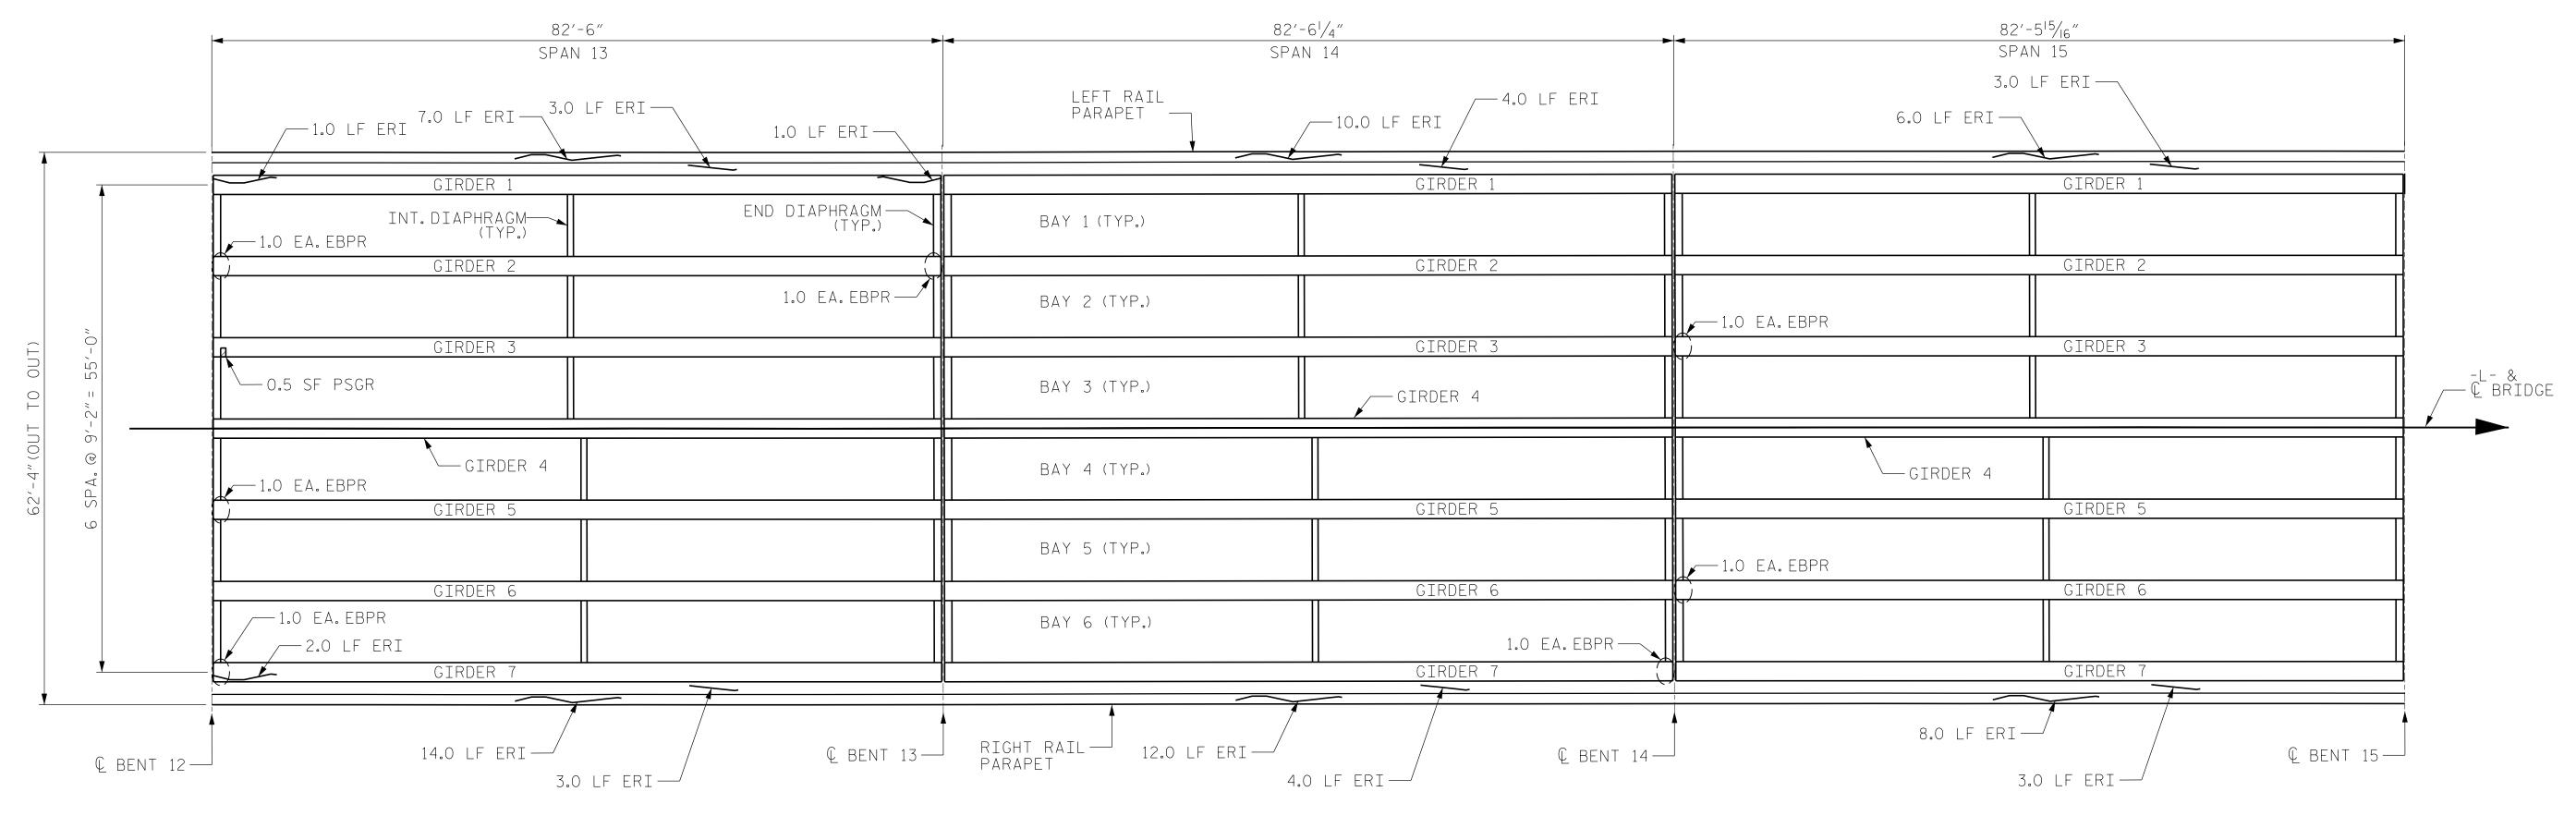

PLAN OF SPAN

15BPR.46 PROJECT NO._ DARE COUNTY 270012 BRIDGE NO. _



STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION

SUPERSTRUCTURE REPAIRS

SPANS 13 THRU 15

DATE: NO. BY: BY:

	KC+	
	KISINGER CAMPO	
DOCUMENT NOT CONSIDERED	& ASSOCIATES 301 FAYETTEVILLE ST., SUITE 1500	N
FINAL UNLESS ALL	RALEIGH, NC 27601 (919) 882-7839	
SIGNATURES COMPLETED	NC FIRM LICENSE: C-1506	

FINAL UNLESS ALL SIGNATURES COMPLETED

SHEET NO REVISIONS S-27

TOTAL SHEETS

137

ALLEN J.MCSWAIN _ DATE : 9/30/2020 DRAWN BY : ___ _ DATE : 10/1/2020 JACOB H.DUKE DESIGN ENGINEER OF RECORD: _____JACOB H. DUKE ___ DATE : 10/1/2020