
DocuSign Envelope ID: 4ACFF300-E9E4-4332-AF3D-03F3420F8C1C

+

+

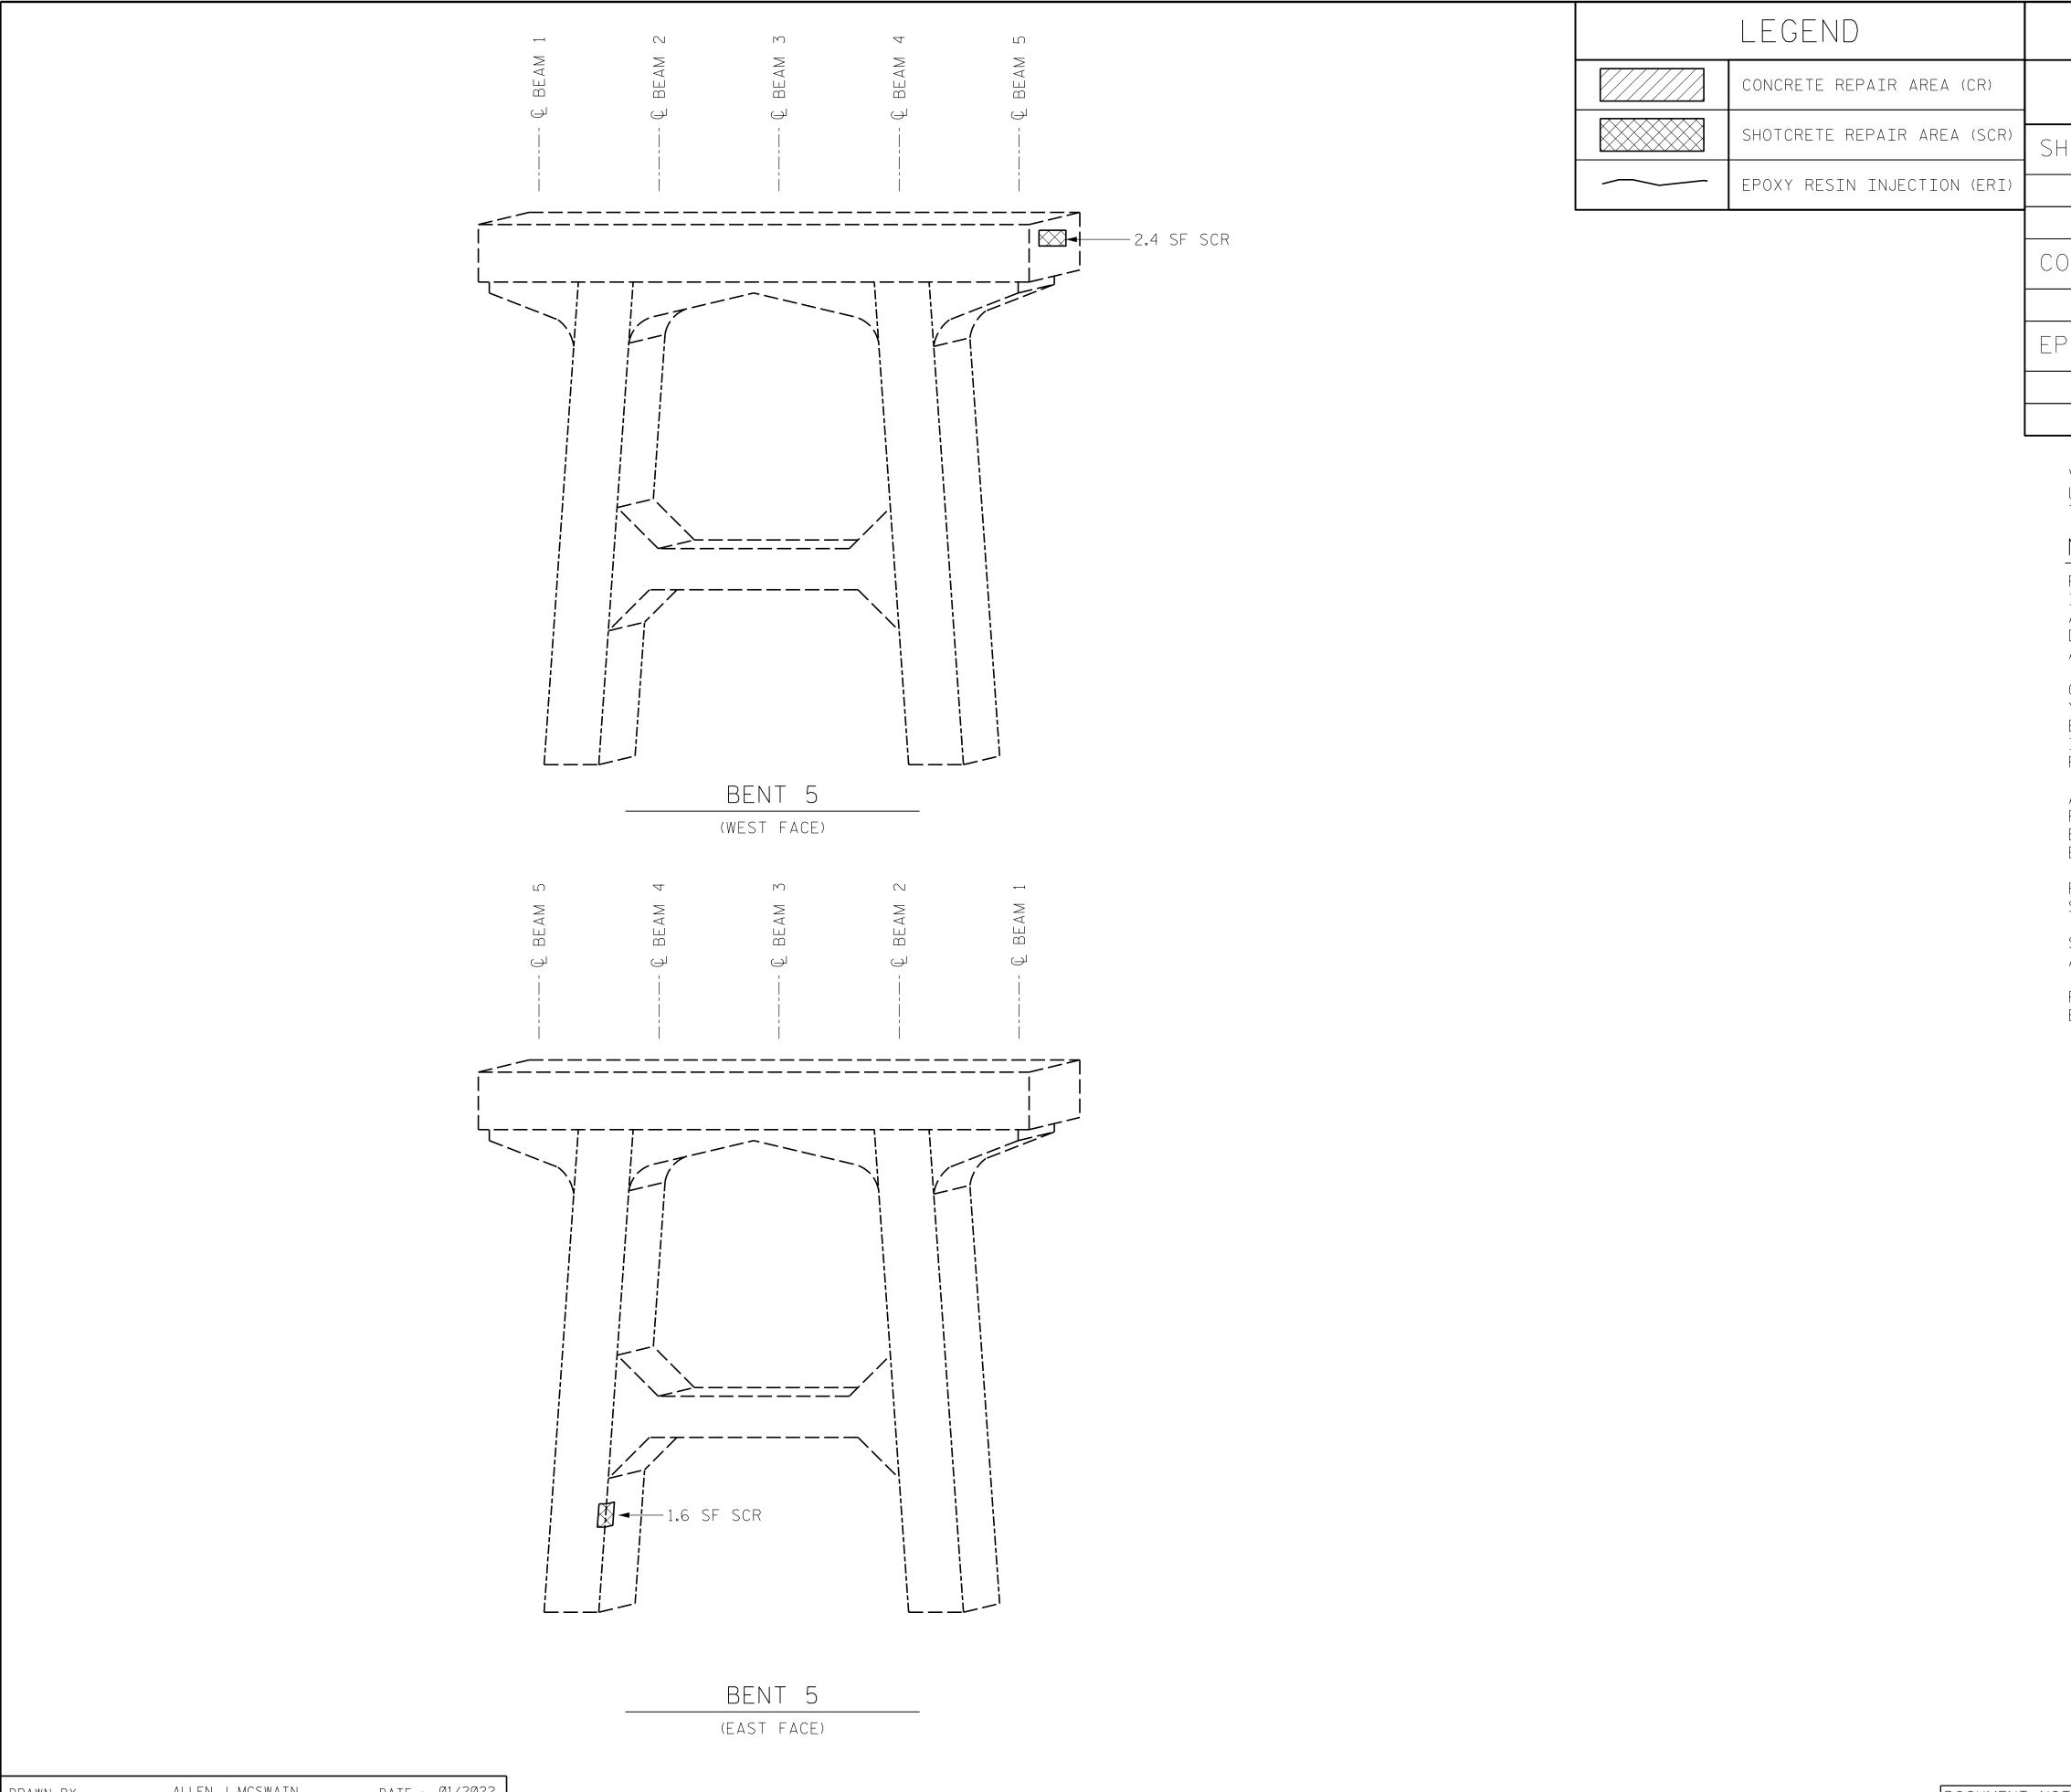

DRAWN BY :	ALLEN J.MCSWAIN	DATE : <u>01/2022</u>
CHECKED BY :	FIDEL L.FLORES	DATE : <u>01/2022</u>
DESIGN ENGINEER	OF RECORD:A.AGUIRRE	DATE : <u>01/2022</u>
		1 (01 (0000

4/21/2022 I5915B_SMU_SBR05_480006.dgn daguirre

DOCUMENT	NOT	СО
FINAL	UNL	ESS
SIGNATU	res	CON

AS-BUILT REPAIR QUANTITY TABLE					
	QUANTITIES				
	ESTI	MATE	ACT	UAL	
HOTCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.	
CAP/BACKWALL	2.4	0.8			
COLUMN/PILE	1.6	0.6			
ONCRETE REPAIRS	AREA SQ.FT.	VOLUME CU.FT.	AREA SQ.FT.	VOLUME CU.FT.	
САР	_	_			
OXY RESIN INJECTION LIN.FT		FT.	LIN.FT.		
CAP/BACKWALL	_				
COLUMN/PILE					

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE.MINIMUM OF 1″BEHIND REBAR AND MINIMUM 2″CLEARANCE TO SAWCUT.FOR REPAIR DETAILS, SEE ″CONCRETE RESTORATION DETAILS″ SHEETS.

NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE.IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >=1/16" AS DESCRIBED IN THE SPECIAL PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3"ON THE CAP AND FROM $1^{1}/_{2}$ "TO 2"ON THE PILES.ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING.FOR BRIDGE JACKING,SEE SPECIAL PROVISIONS.

	PROJECT NO. <u>I-5915B</u> <u>IREDELL</u> COUNTY BRIDGE NO. <u>480006</u> Sheet 6 of 11	
Docusigned by SEAL Diago & Mainter 4729/2002/3044 Diago & Agentitic A AGENTIC DEPARTMENT OF TRANSPORTATION RALEIGH SUBSTRUCTURE REPAIRS		
KCA	BENT 5	
KISINGER CAMPO	REVISIONS SHEET NO. NO. BY: DATE: S5-19	
ONSIDERED S ALL301 FAYETTEVILLE ST., SUITE 1500 RALEIGH, NC 27601 (919) 882-7839 NC FIRM LICENSE: C-1506	NO. BY: DATE: NO. BY: DATE: S5-19 1 3	