
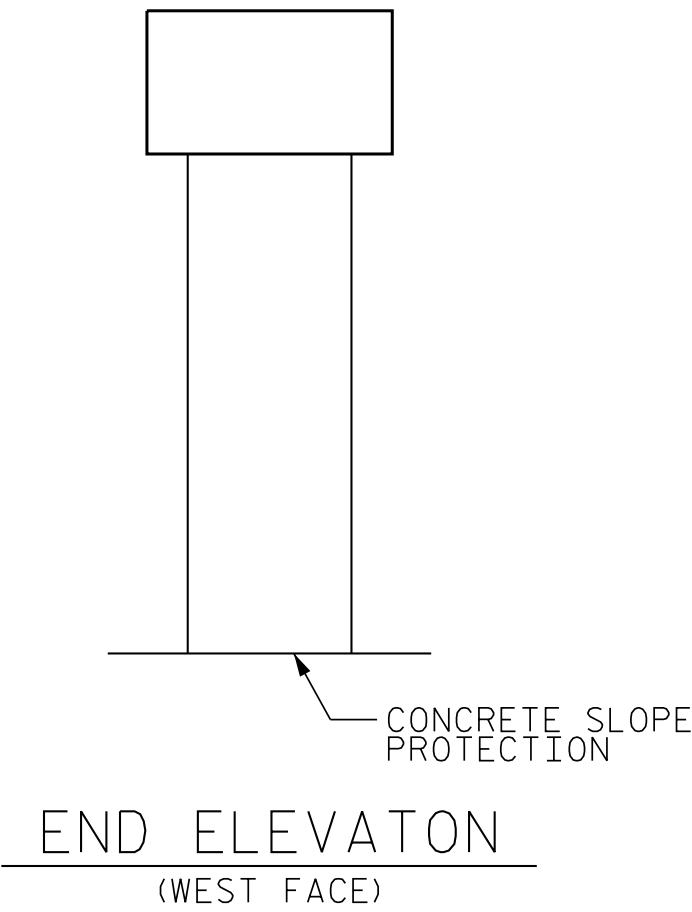
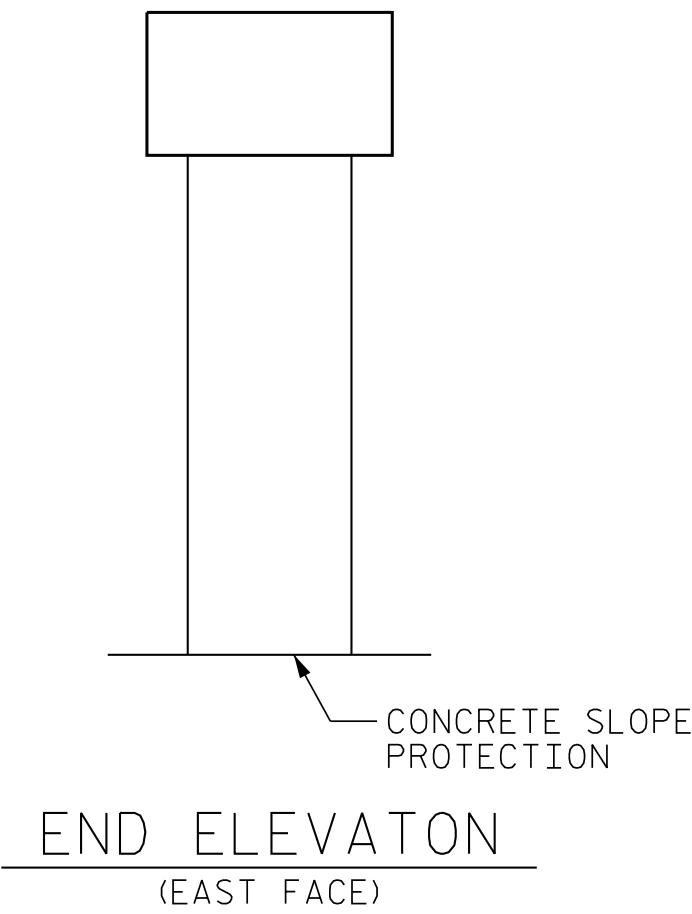
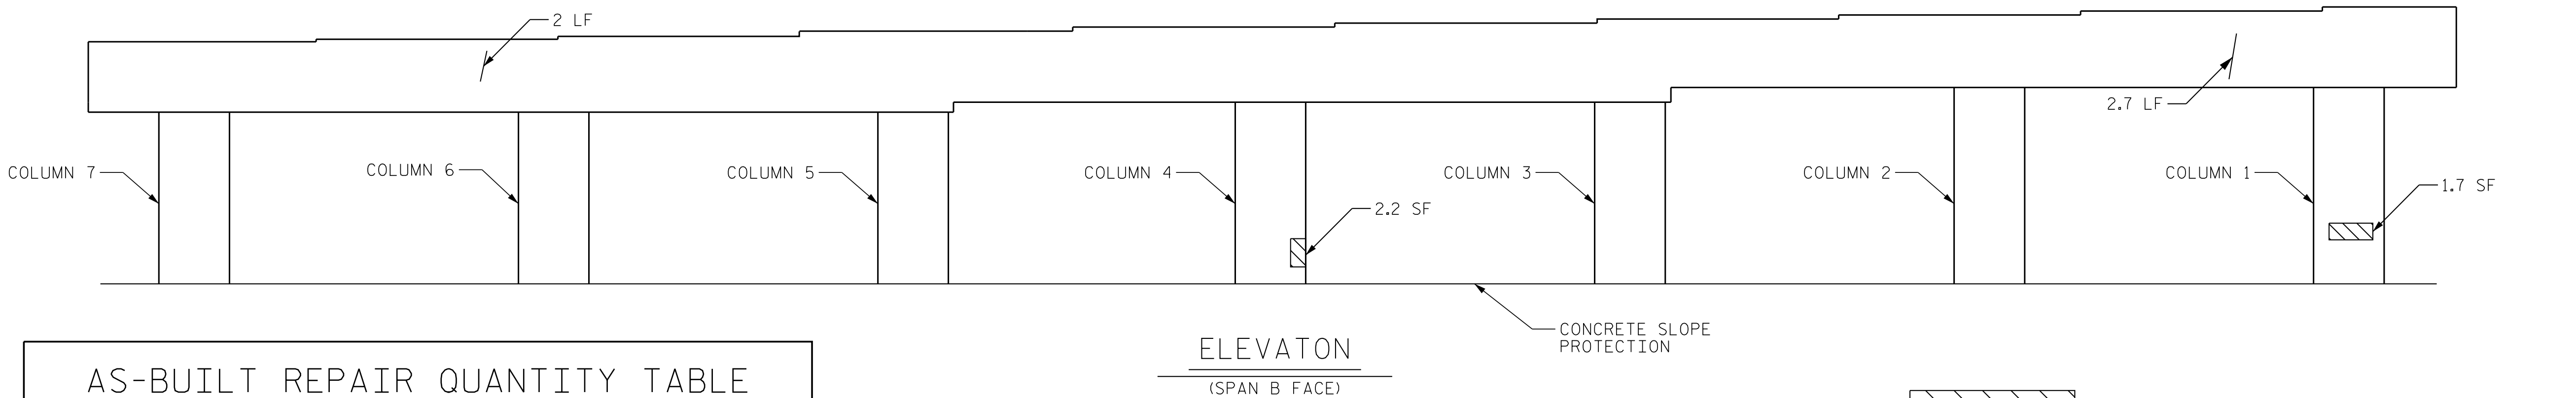
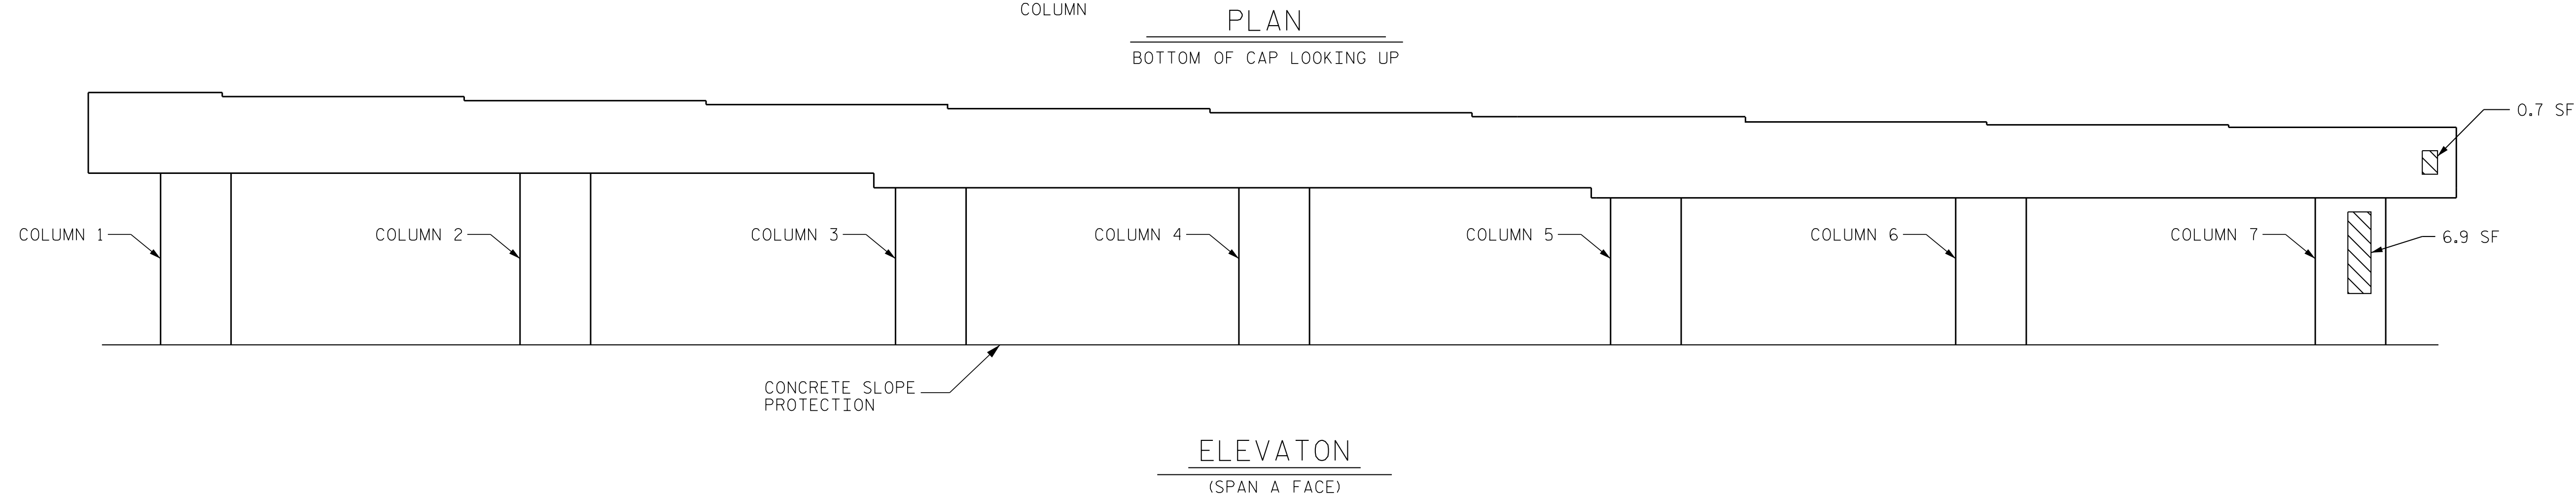


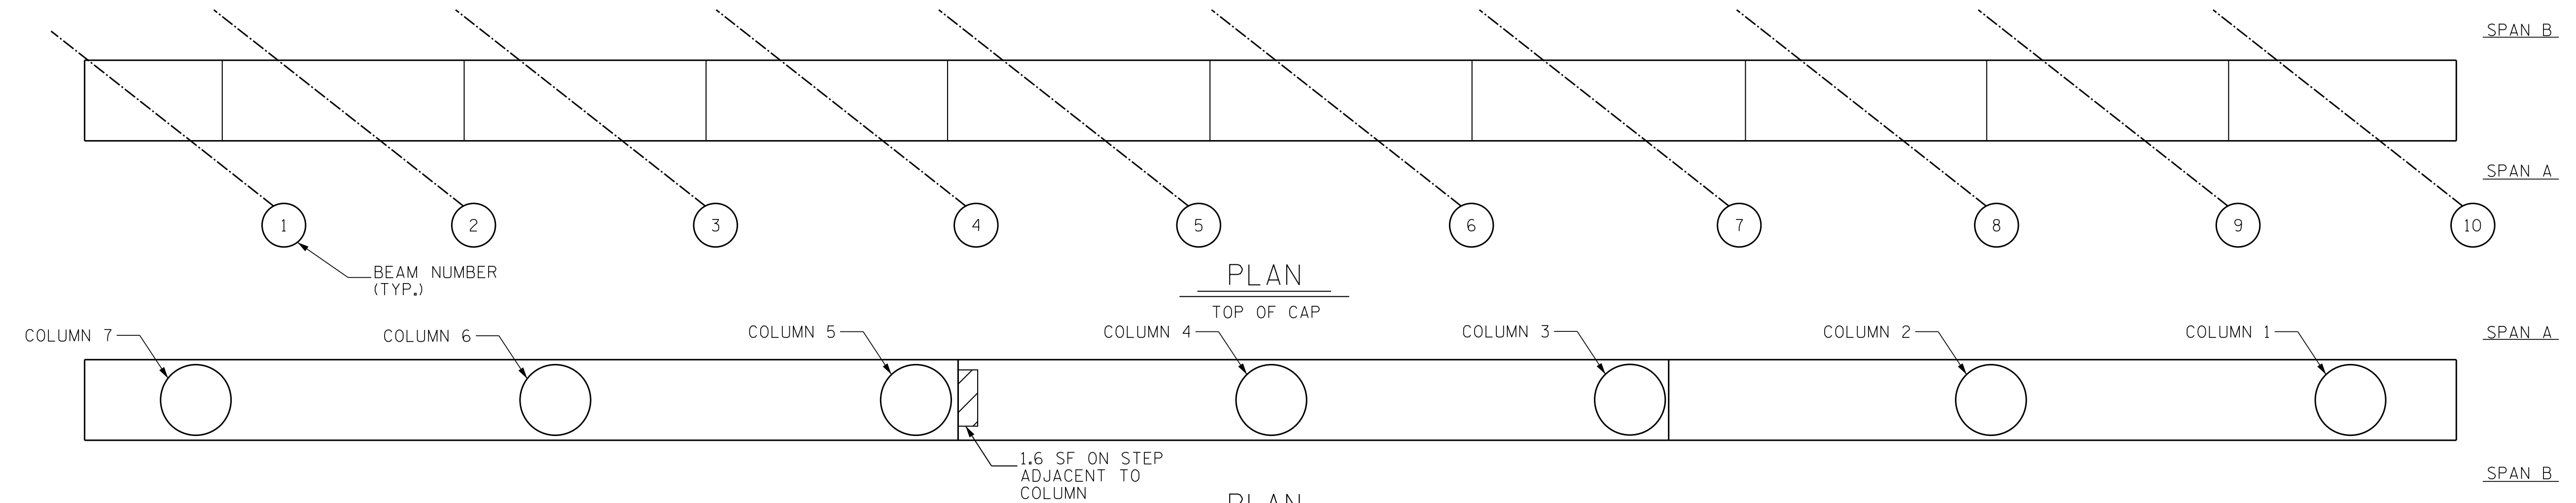

AS-BUILT REPAIR QUANTITY TABLE				
REPAIRS	QUANTITIES			
	ESTIMATE		ACTUAL	
CONCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	0.0	0.0		
COLUMNS	0.0	0.0		
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	2.3	0.5		
COLUMNS	10.8	2.4		
EPOXY RESIN INJECTION		LIN. FT.	LIN. FT.	
CAP		4.7		
COLUMNS		0.0		
EPOXY COATING		SQ. FT.	LIN. FT.	
CAP		450.3		

NOTES

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN OF 1"BEHIND REBAR AND MIN.2" CLEAR TO SAWCUT.

CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING.EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP.THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE BEARINGS.

FOR SHOTCRETE REPAIRS,SEE SPECIAL PROVISIONS.



FOR CONCRETE REPAIRS,SEE SPECIAL PROVISIONS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

FOR EPOXY RESIN INJECTION,SEE SPECIAL PROVISIONS.

FOR EPOXY COATING,SEE SPECIAL PROVISIONS.

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER,THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

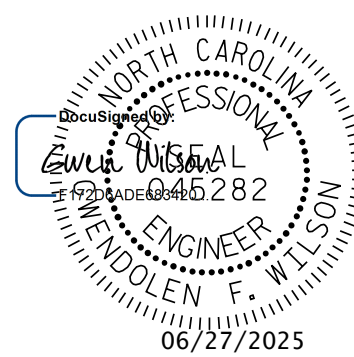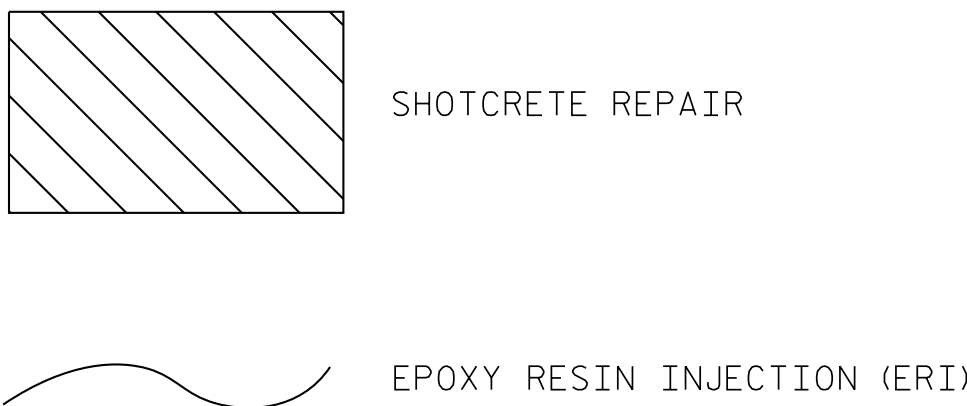

**DOCUMENT NOT CONSIDERED FINAL
UNLESS ALL SIGNATURES COMPLETED**

Johnson, Mirmiran, & Thompson Inc.
4700 Falls of Neuse Rd, Suite 100,
Raleigh, NC. 27609
License No: C-3097

PROJECT NO. I-5880
FORSYTH COUNTY
BRIDGE: 330029

REVISIONS						SHEET NO. S1-16
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			TOTAL SHEETS 21
2			4			

BC: 10/2024
DWN: 10/2024
CHKD: 11/2024
TIME: 5/5/2025

DWN. BY: BC
CHKD. BY: GFW

DATE: 10/2024
DATE: 11/2024