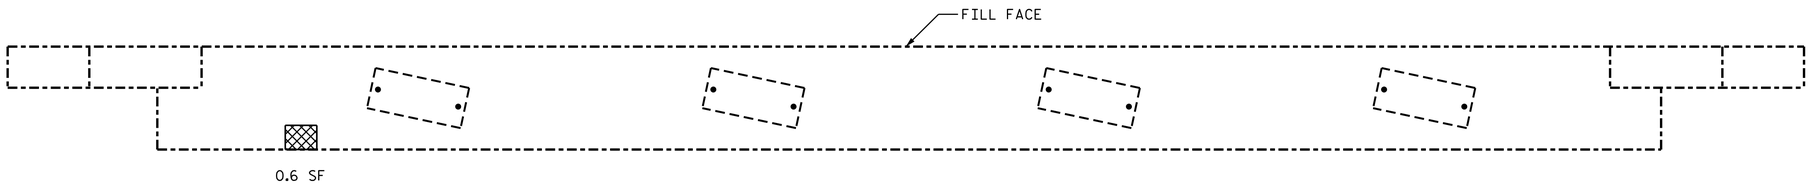

PLAN

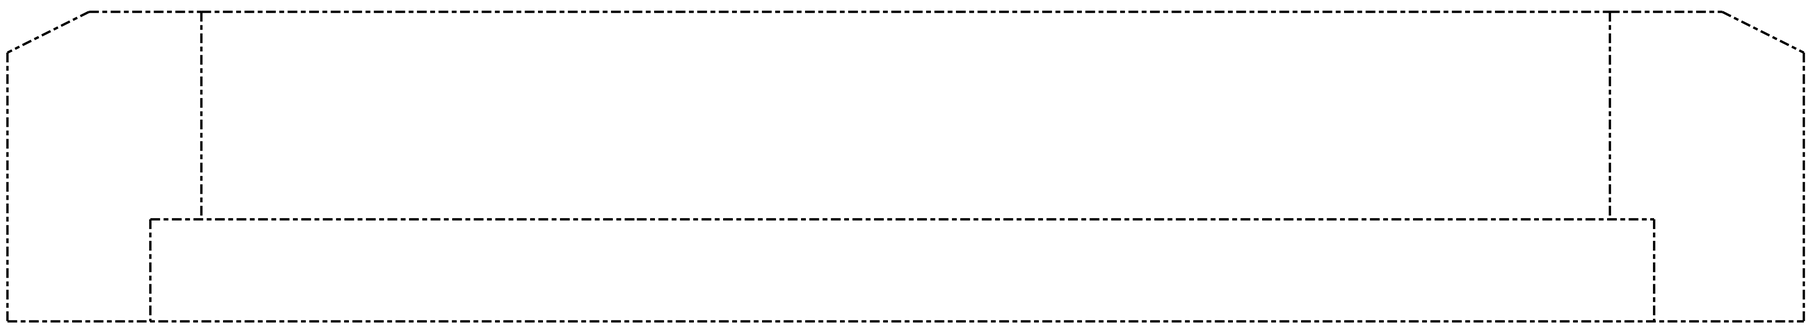

ELEVATION

REPAIR QUANTITY TABLE				
REPAIRS END BENT 1	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SF.	VOLUME CF.	AREA SF.	VOLUME CF.
CAP (VERTICAL FACE)	0	0		
CAP (HORIZONTAL FACE)	0	0		
CURTAIN WALL (VERTICAL FACE)	0	0		
CONCRETE REPAIRS	0.6	0.2		
EPOXY RESIN INJECTION		LN. FT.		LN. FT.
CAP		0		
CURTAIN WALL		0		
EPOXY COATING		SQ. FT.		SQ. FT.
TOP OF CAP		92		

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 1" CL TO SAWCUT. SEE REPAIR DETAILS.

CONCRETE REPAIR

SHOTCRETE REPAIR

ERI - EPOXY RESIN INJECTION

NOTE

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

EPOXY COATING SHALL BE APPLIED TO THE TOP FACE OF THE END BENT CAP.

FOR STRUCTURE REPAIRS, SEE "TYPICAL REPAIR DETAILS" SHEET.

NORTH CAROLINA PROFESSIONAL SEAL 14855 ENGINEER DOUGLAS R. CALHOUN

DocuSigned by: Douglas R. Calhoun
43D1B6F8D6E5406
12/19/2014

PROJECT NO. I-0914BA
WARREN COUNTY
BRIDGE NO. 10

SHEET 1 OF 2

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

SUBSTRUCTURE REPAIR
END BENT 1

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	SP-54
1			3			TOTAL SHEETS
2			4			58

DRAWN BY : A. K. PATEL DATE : 10/2013
CHECKED BY : T. KIRSCHBAUM DATE : 10/2013

19-DEC-2014 11:45
O:\Structures\Plans\Final Plans\I0914BA_SD_10.dgn
kalford