DocuSign Envelope ID: 763C152F-F6CB-4895-8952-7EE400CE2BA7

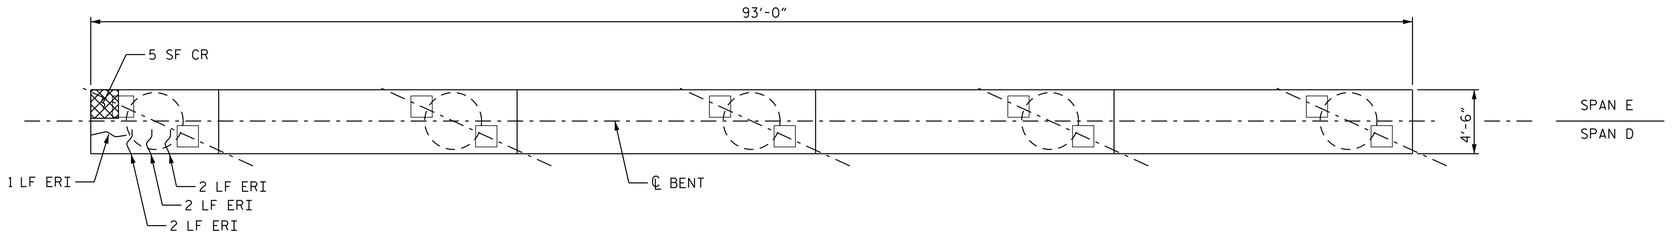

TOP OF CAP

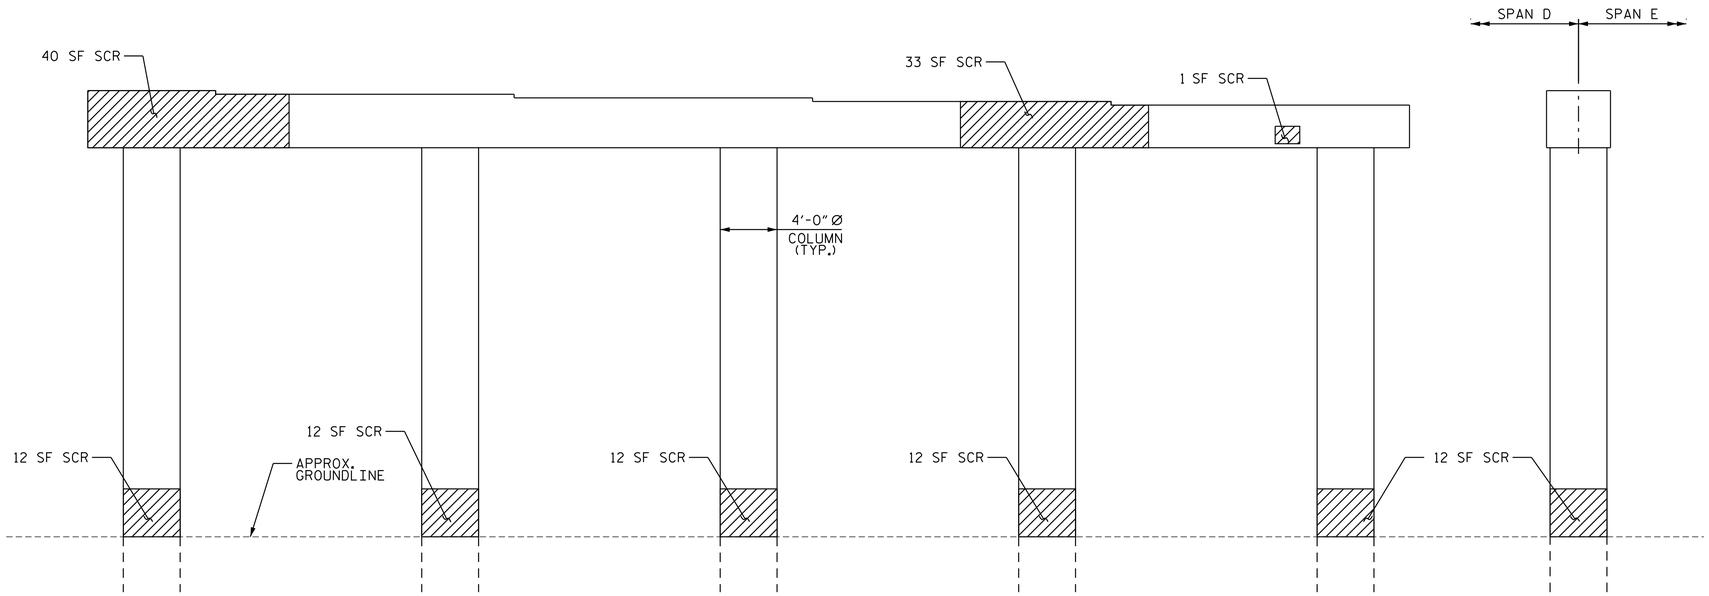

ELEVATION

END VIEW

BENT NO. 4
SPAN D FACE

AS-BUILT REPAIR QUANTITY TABLE

BENT 4 SPAN D FACE	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	74.0	19.0		
COLUMN	72.0	18.0		
CONCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP	5.0	1.3		
EPOXY RESIN INJECTION		LN. FT.		LN. FT.
CAP		7.0		
COLUMN		0.0		
EPOXY COATING		SQ. FT.	SQ. FT.	
TOP OF BENT CAP		409.0		

NOTES:

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING. EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP. THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE MASONARY PLATES. FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

FOR CAP AND COLUMN REPAIRS, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS", SHEET.

FOR SHOTCRETE REPAIR, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIR, SEE SPECIAL PROVISIONS.

FOR EPOXY RESIN INJECTION, SEE SPECIAL PROVISIONS.

SHOTCRETE REPAIR (SCR)

CONCRETE REPAIR (CR)

EPOXY RESIN INJECTION (ERI)

PROJECT NO. I-5941
DURHAM COUNTY
BRIDGE NO. 310429

SHEET 8 OF 10

DRAWN BY : M. HOGAN DATE : 3/2023
CHECKED BY : JIA XU DATE : 7/2023
DESIGN ENGINEER OF RECORD: F. ASEFNIA DATE : 11/2023

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

DocuSigned by: Farzin Asefnia 19141A6AF2F04...

NORTH CAROLINA PROFESSIONAL SEAL 20103 ENGINEER FARZIN ASEFNIA

11/13/2023

E.L. ROBINSON ENGINEERING
3962 Six Forks Rd.
Raleigh, N.C. 27609
Tel: 984.960.2810
elrobinsonengineering.com
License: C-22 9

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

SUBSTRUCTURE REPAIR

BENT 4 SPAN D FACE

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S5-15
1			3			TOTAL SHEETS
2			4			17