Docusign Envelope ID: CEA204B1-8994-4503-B71A-292DC63130FF

18 CHANNEL IP CONFLICT MONITOR PROGRAMMING DETAIL

(remove jumpers and set switches as shown)

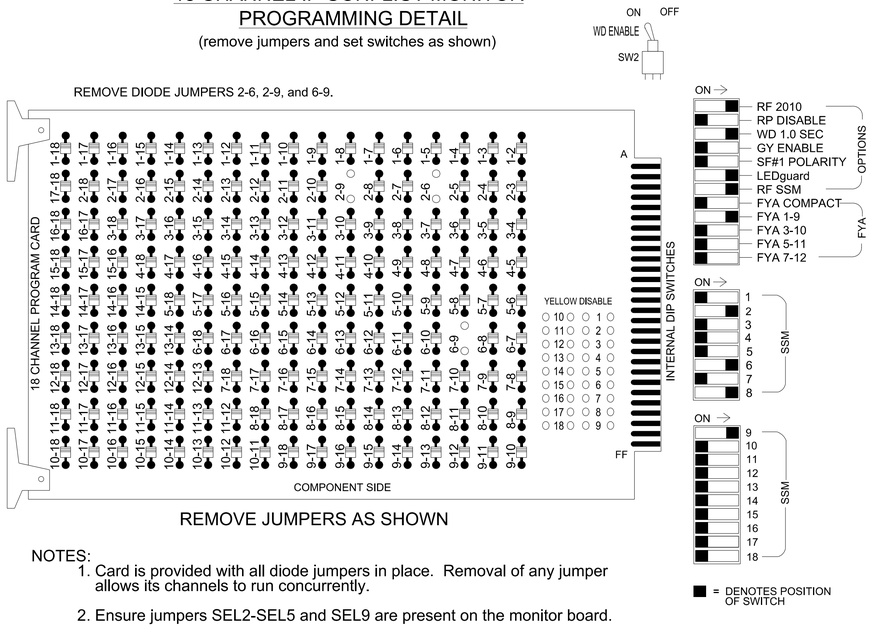

REMOVE JUMPERS AS SHOWN

NOTES:

1. Card is provided with all diode jumpers in place. Removal of any jumper allows its channels to run concurrently.
2. Ensure jumpers SEL2-SEL5 and SEL9 are present on the monitor board.
3. Ensure that the Red Enable is active at all times during normal operation.
4. Integrate monitor with Ethernet network in cabinet.

NOTES

1. To prevent "flash-conflict" problems, insert red flash program blocks for all vehicle load switches in the output file. The installer shall verify that signal heads flash in accordance with the signal plan.
2. Program controller to start up in phase 2 Green No Walk and 6 Green No Walk.
3. If this signal will be managed by an ATMS software, enable controller and detector logging for all detectors used at this location.
4. The cabinet and controller are part of the Goldsboro Signal System.

SIGNAL HEAD HOOK-UP CHART

LOAD SWITCH NO.	S1	S2	S3	S4	S5	S6	S7	S8	S9	S10	S11	S12	AUX S1	AUX S2	AUX S3	AUX S4	AUX S5	AUX S6
CMU CHANNEL NO.	1	2	13	3	4	14	5	6	15	7	8	16	9	10	17	11	12	18
PHASE	1	2	2 PED	3	4	4 PED	5	6	6 PED	7	8	8 PED	OL1	OL2	SPARE	OL3	OL4	SPARE
SIGNAL HEAD NO.	NU	21,22	NU	NU	NU	NU	NU	62,63	NU	NU	81,82	NU	61★	NU	NU	NU	NU	NU
RED		128						134			107							
YELLOW		129						135										
GREEN		130						136										
RED ARROW													A121					
YELLOW ARROW											108		A122					
FLASHING YELLOW ARROW													A123					
GREEN ARROW											109							

NU = Not Used

★See pictorial of head wiring in detail this sheet.

EQUIPMENT INFORMATION

Controller.....2070LX
Cabinet.....332 w/ Aux
Software.....Q-Free MAXTIME
Cabinet Mount.....Base
Output File Positions.....18 With Aux. Output File
Load Switches Used.....S2,S8,S11,AUX S1
Phases Used.....2,6,8
Overlap "1".....*
Overlap "2".....N/A
Overlap "3".....N/A
Overlap "4".....N/A

*See overlap programming detail on this sheet

FYA SIGNAL WIRING DETAIL

(wire signal heads as shown)

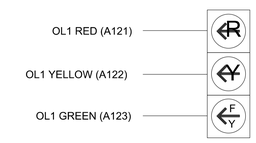

61

INPUT FILE POSITION LAYOUT

(front view)

		1	2	3	4	5	6	7	8	9	1O	11	12	13	14
FILE "I"	U	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	FS DC ISOLATOR
	L														ST DC ISOLATOR
FILE "J"	U	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY	SLOT EMPTY
	L														

EX. : 1A, 2A, ETC. = LOOP NO.'S

FS = FLASH SENSE
ST = STOP TIME

MAXTIME STARTUP AND SOFTWARE FLASH PROGRAMMING DETAIL

Front Panel
Main Menu >Controller >Unit

Web Interface
Home >Controller >Unit

Modify parameters as shown below and save changes.

Start Up Parameters

StartUp Clearance Hold
6

Unit Flash Parameters

All Red Flash Exit Time
6

OVERLAP PROGRAMMING

Front Panel
Main Menu >Controller >Overlap >Overlap Parameters/Overlap Timings

Web Interface
Home >Controller >Overlap Configuration >Overlaps

Overlap Plan 1

Overlap	1
Type	FYA 4 - Section
Included Phases	2
Modifier Phases	-
Modifier Overlaps	-
Trail Green	0
Trail Yellow	0.0
Trail Red	0.0

SPECIAL DETECTOR NOTE

Install a multi-zone microwave detection system for vehicle detection. Perform installation according to manufacturer's directions and NCDOT engineer -approved mounting locations to accomplish the detection schemes shown on the Signal Design Plans.

TMP Phase I; Steps 1 & 2
TMP Phase II
Temporary 1 Electrical Detail

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

THIS ELECTRICAL DETAIL IS FOR
THE SIGNAL DESIGN: 04-0991T1
DESIGNED: March 2025
SEALED: 8/18/2025
REVISED:

Stantec

Stantec Consulting Services Inc.
801 Jones Franklin Road-Suite 300
Raleigh, NC 27606
Tel. (919) 851-6866
Fax. (919) 851-7024
www.stantec.com
License No. F-0672

Electrical and Programming Details For:

Prepared for the Offices of:

Transportation Mobility and Safety Division
ITS & Signals Management Section
STATE OF NORTH CAROLINA
DEPT. OF TRANSPORTATION

750 N. Greenfield Pkwy, Garner, NC 27529

US 13 (Berkeley Boulevard)
at
SR 1705 (Hood Swamp Road)

Division 4 Wayne County Goldsboro

PLAN DATE: March 2025	REVIEWED BY: D A Waller
PREPARED BY: J Galloway	REVIEWED BY: R M Muncey

REVISIONS	INIT.	DATE

NORTH CAROLINA PROFESSIONAL SEAL 029904 ENGINEER JASON P. GALLOWAY

Signed by: Jason Galloway 10D1E2B40B4846E...
8/18/2025
SIGNATURE DATE

SIG. INVENTORY NO. 04-0991T1

1:16:20 PM
U:\projects\Designs\Design\Electrical Details\Temporary Designs\04099111_ele_dsn.dgn
User:jgalloway