REPAIR QUANTITY TABLE

REPAIRS BENT 2	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF
CAP (VERTICAL FACE)	80.2	40.1		
CAP (HORIZONTAL, CORNER)	0	0		
EPOXY RESIN INJECTION		LN. FT		LN. FT
CAP		0		

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL
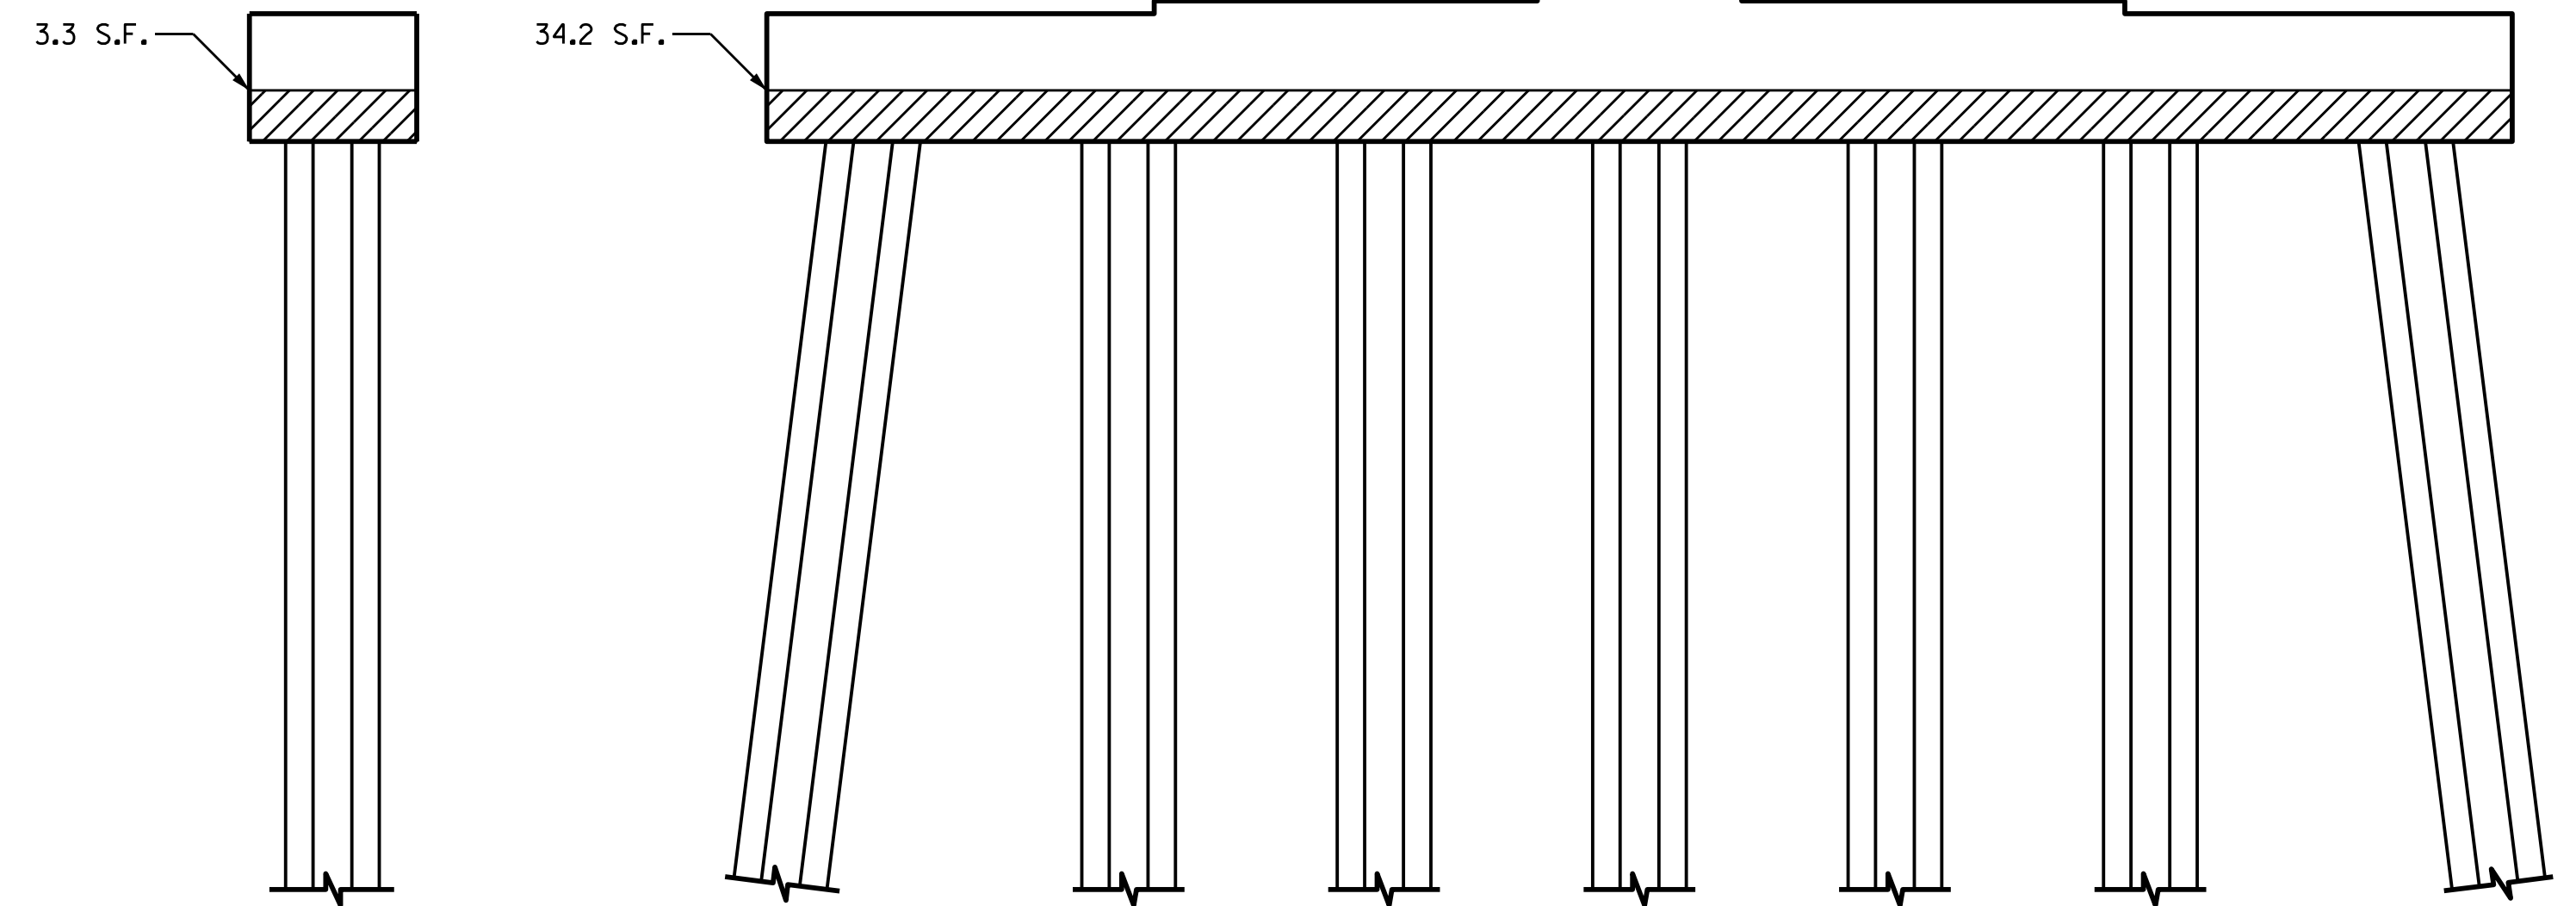OF UNSOUND CONCRETE, MIN. OF 1"BEHIND REBAR AND MIN. 2"CL TO SAWCUT.
SEE REPAIR DETAILS.

▨ - SHOTCRETE REPAIR
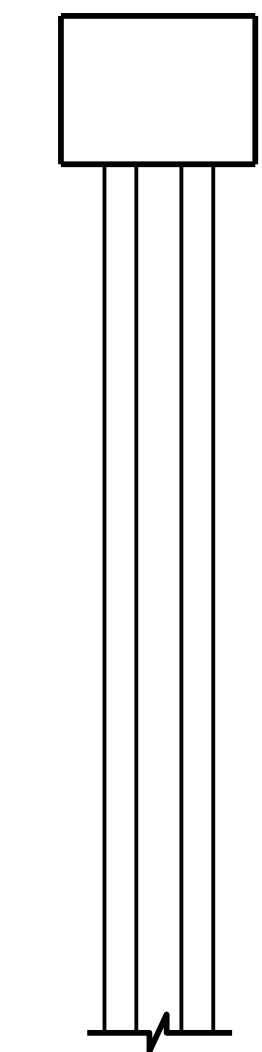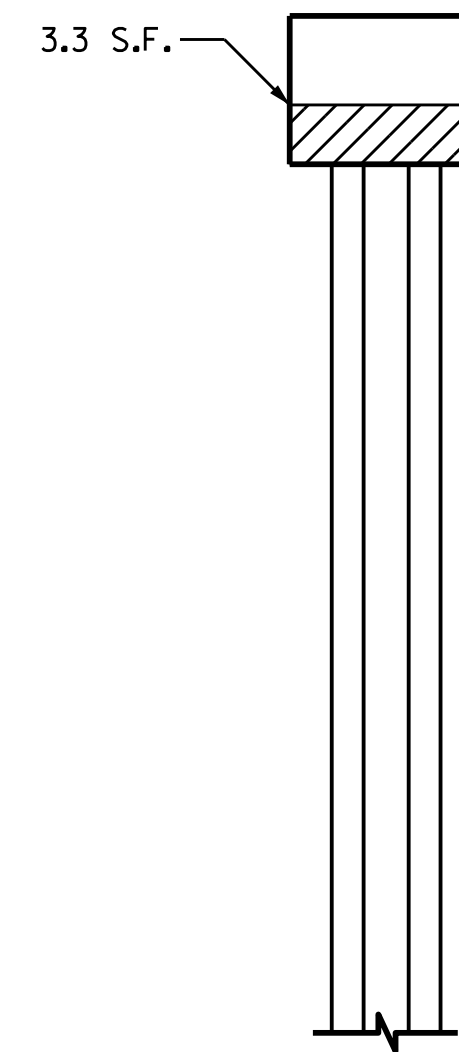
ERI - EPOXY RESIN INJECTION

PLAN
TOP OF CAP

42.7 S.F.
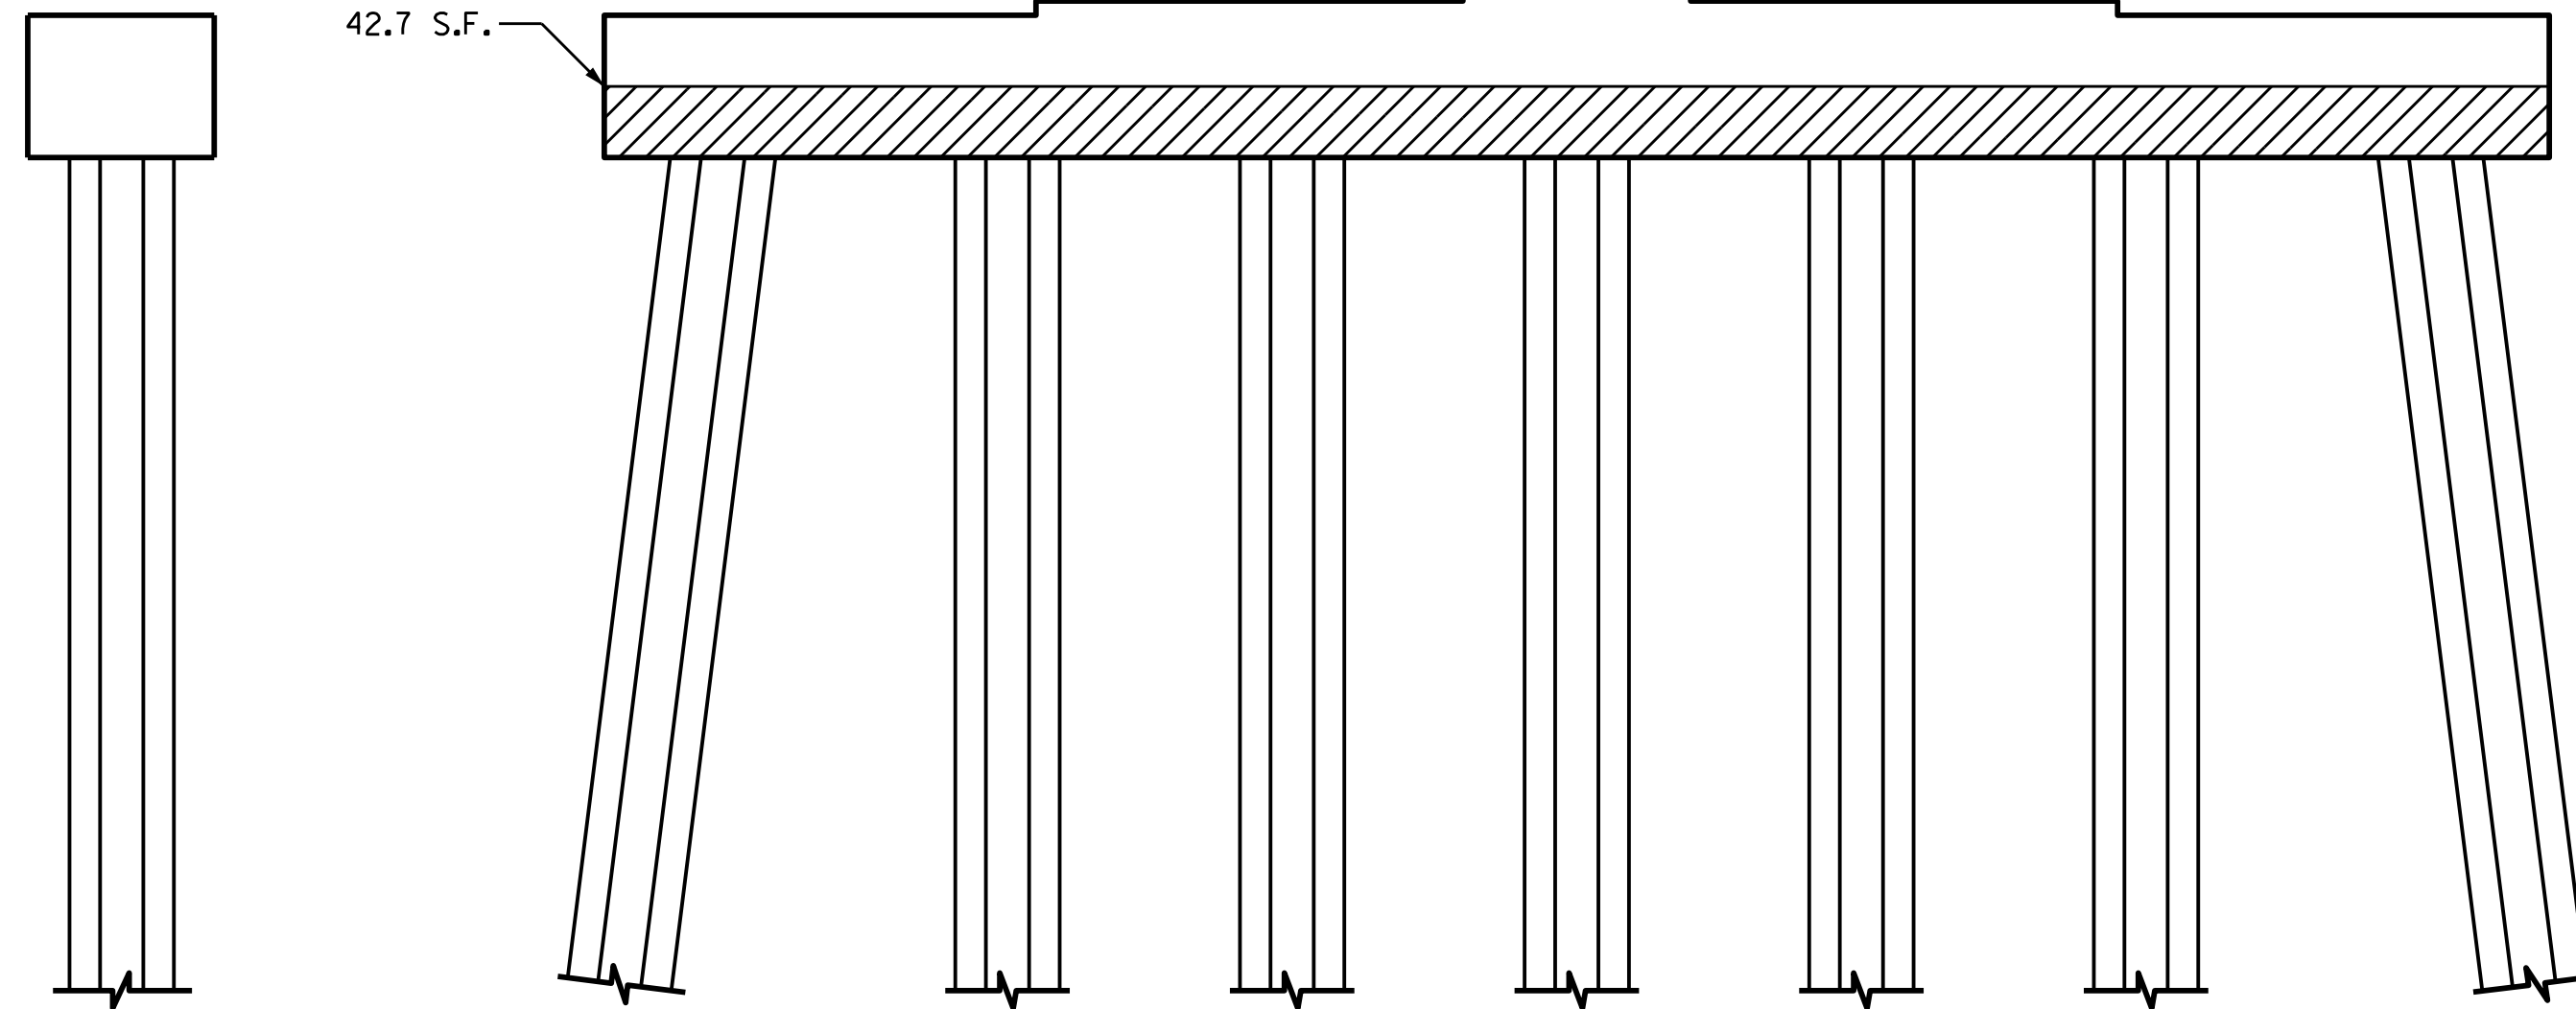
END VIEW
WEST SIDE

ELEVATION
SOUTH SIDE

3.3 S.F.

34.2 S.F.

END VIEW
EAST SIDE

ELEVATION
NORTH SIDE
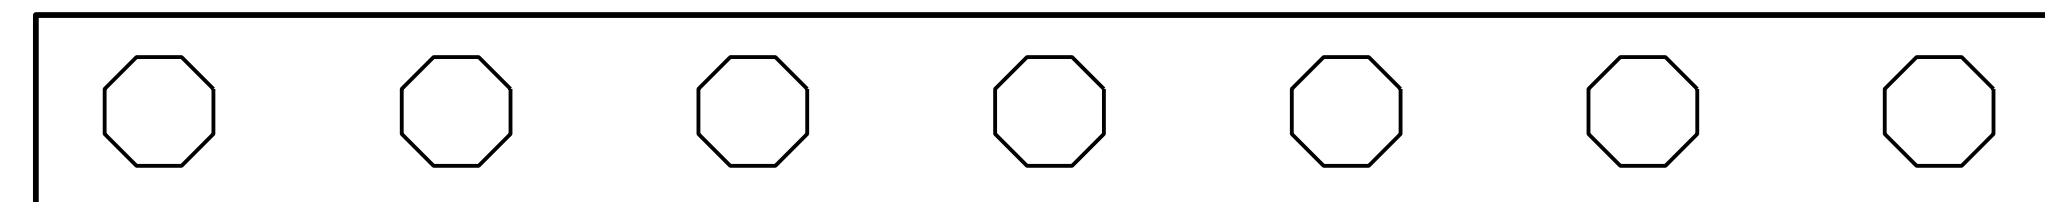
PLAN
BOTTOM OF CAP

PROJECT NO. B-5939

CARTERET COUNTY

BRIDGE NO. 6

SHEET 3 OF 60

SUBSTRUCUTRES
BENT 2

NORTH CAROLINA
PROFESSIONAL
SEAL
21271
ENGINEER
GREGORY W. DICKEY

DocuSigned by:
Greg Dickey
884E46B8CE6B4B8...

DRAWN BY :	M.A.LEE	DATE : 8/2016
CHECKED BY :	P.BRYANT	DATE : 8/2016

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S2-73
1			3			TOTAL SHEETS
2			4			