



**Strain Pole Attachments**

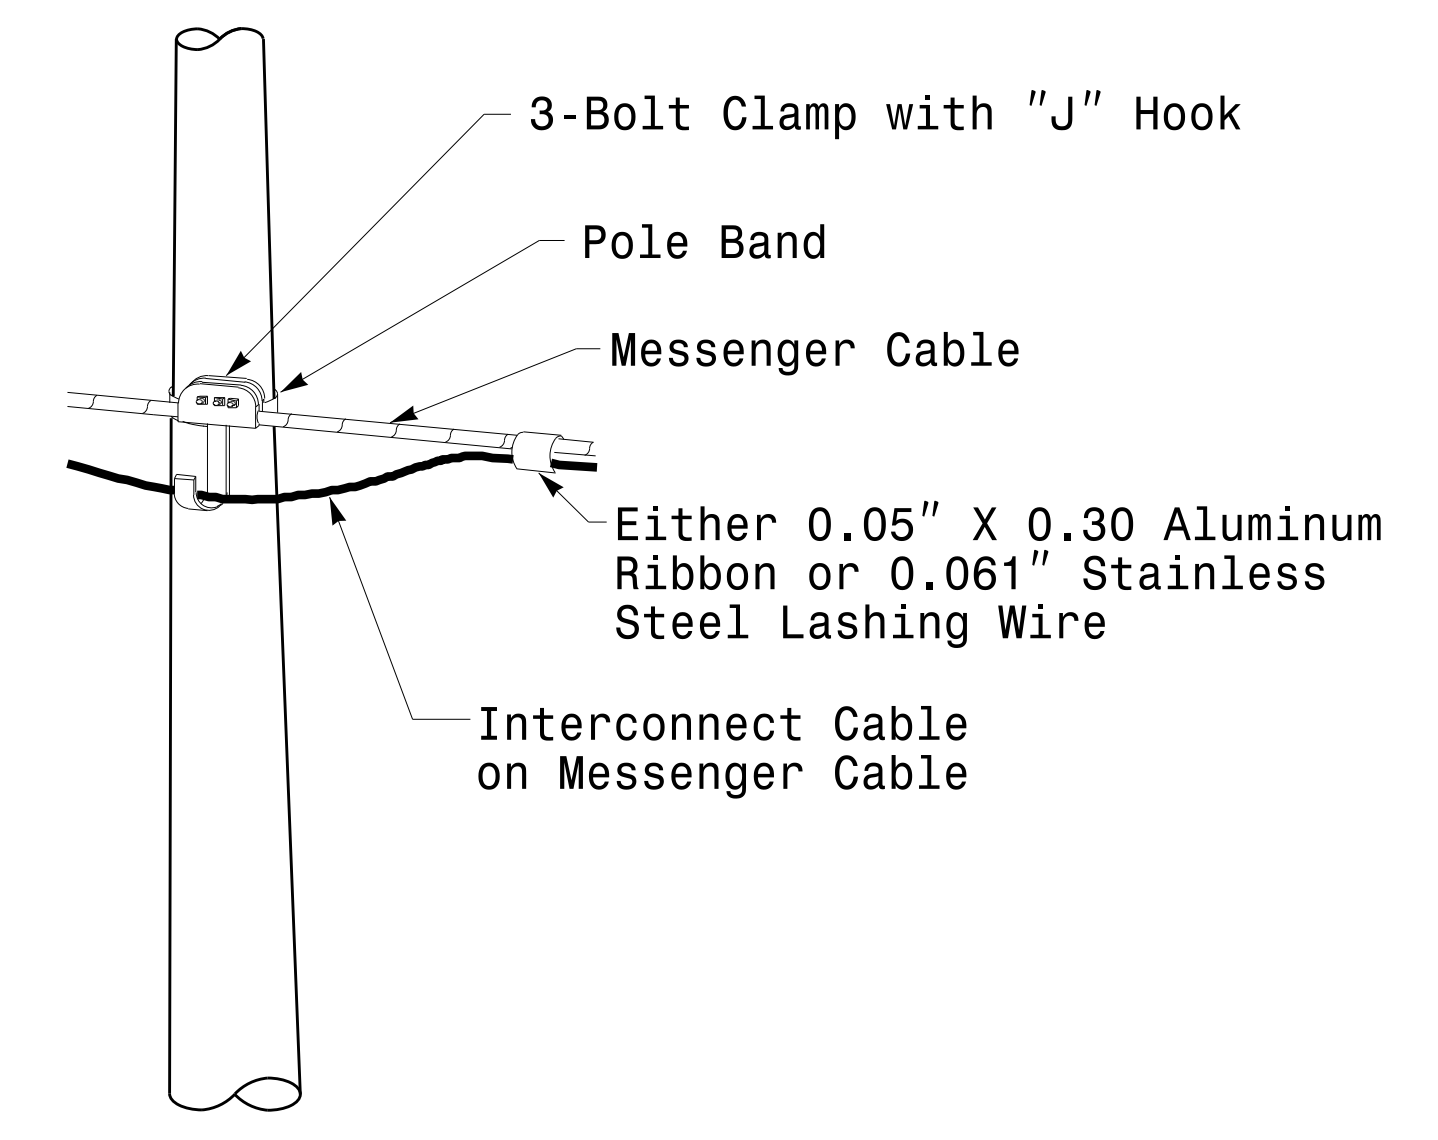

**Attachment of Cable to Intermediate Metal Pole**

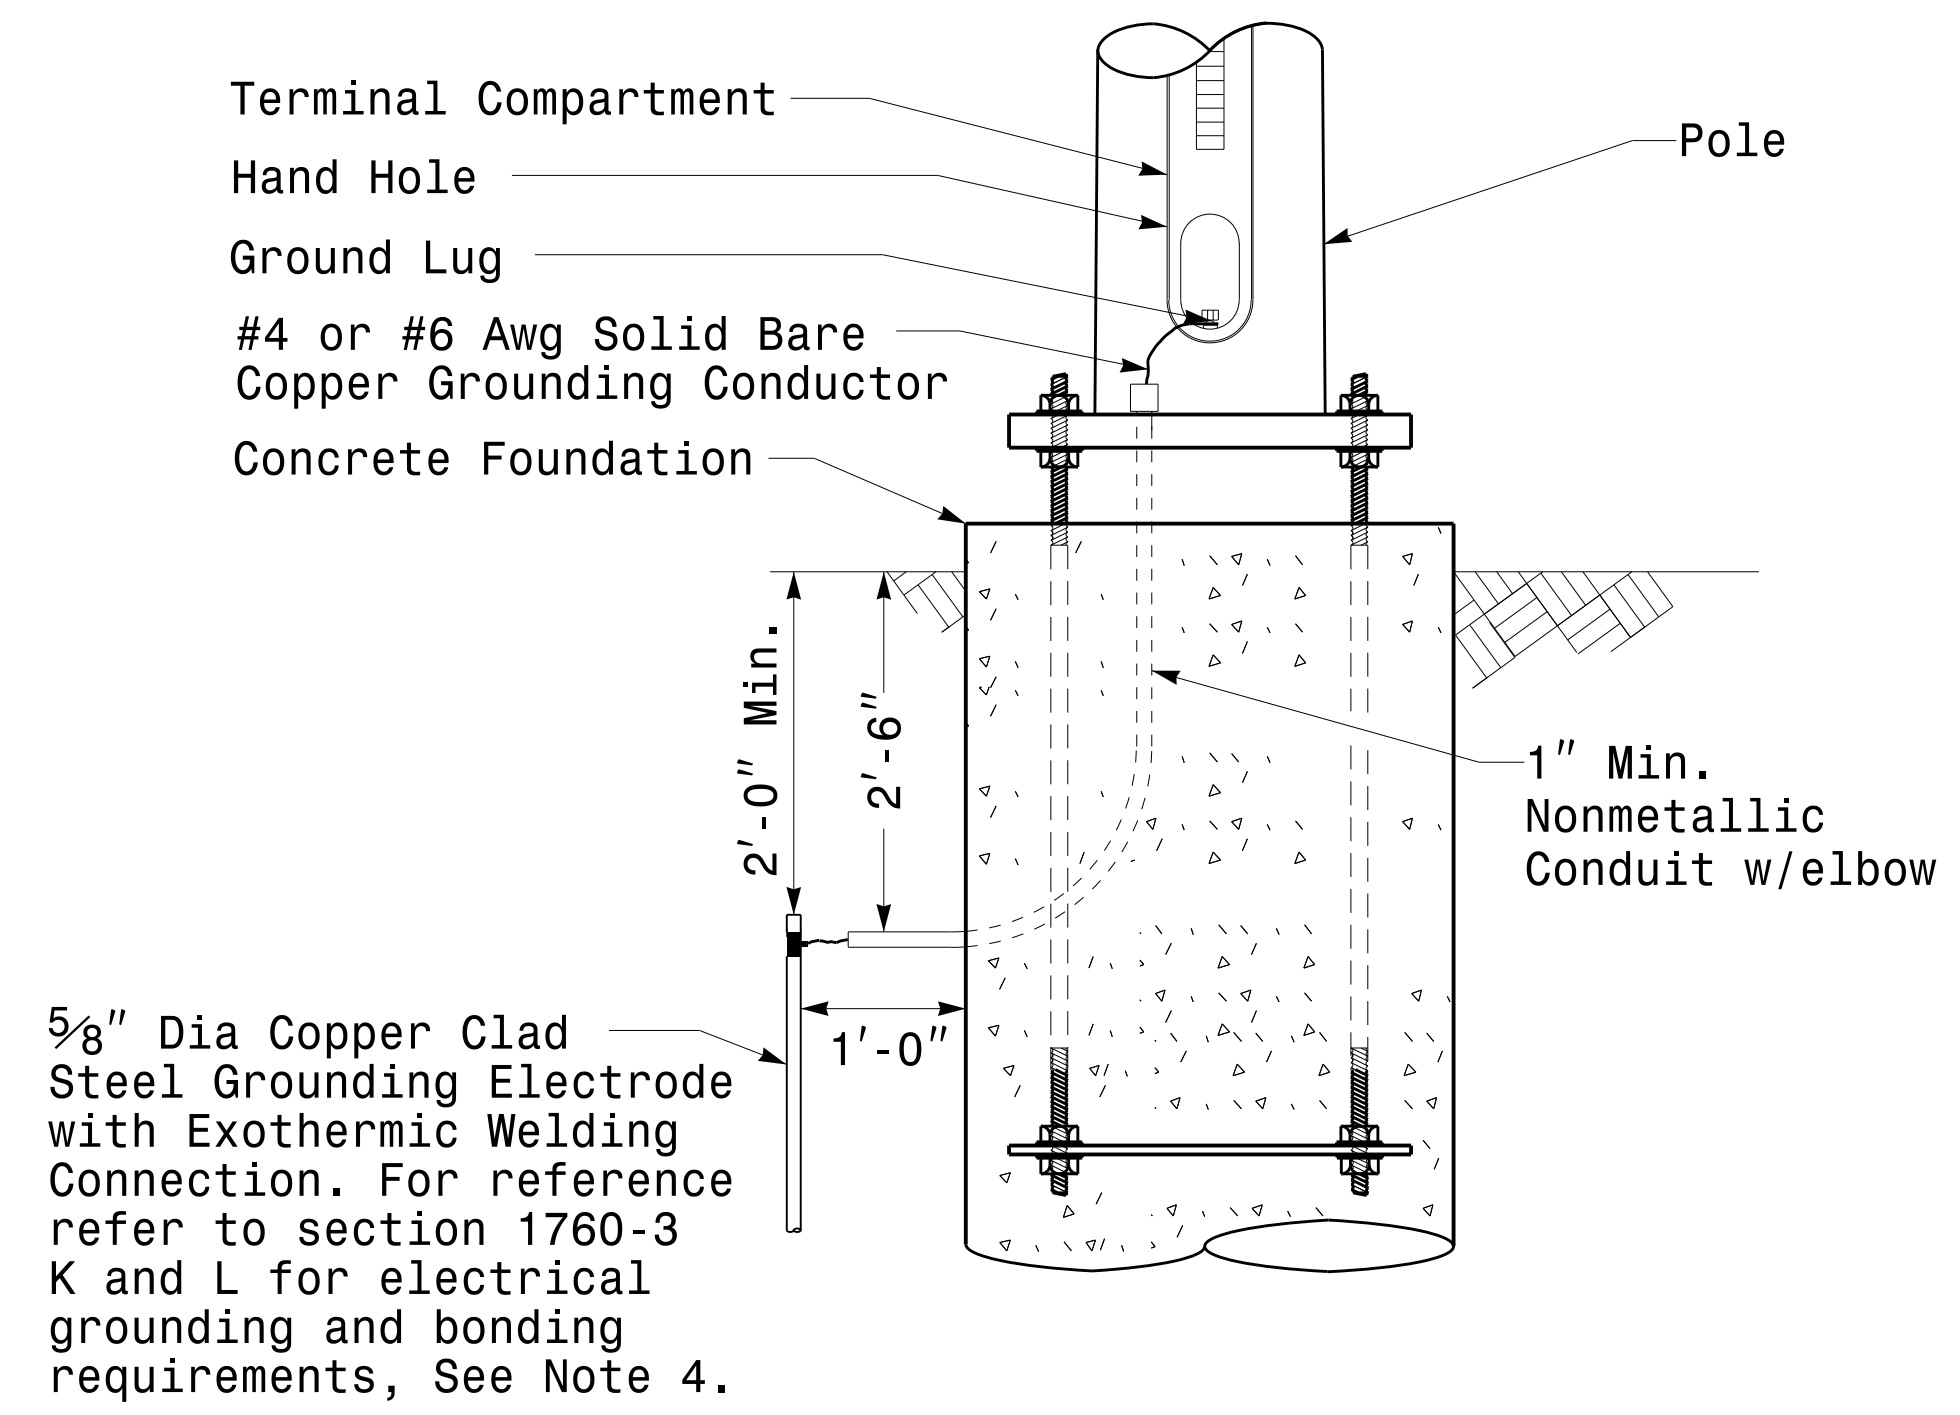

**Metal Pole Grounding Detail For Strain Pole and Mast Arm**

**NOTE:**

1. Strap all signal cables to the side of the pole with 3/4" stainless steel straps when the distance between the spanwire attachment clamp and the weatherheads exceeds 3'-0".
2. Provide minimum two spanwire pole clamps per pole.
3. It is prohibited to attach two span wires at one pole clamp.
4. For general requirements refer to NCDOT Standard Specifications for Roadway and Structures, January 2012.

17-FEB-2016 16:09  
 I:\SCD\115 StrainPoles.dgn Design Section\Eastern Region\115 StrainPoles.dgn  
 17-FEB-2016 16:09  
 I:\SCD\115 StrainPoles.dgn Design Section\Eastern Region\115 StrainPoles.dgn

 750 N. Greenfield Pkwy, Garner, NC 27529	<b>Typical Fabrication Details For Strain Pole Attachments</b>		SEAL  DocuSigned By  44E8E32E147E4C4...
	PLAN DATE: FEBRUARY 2016 DESIGNED BY: C.F. ANDREWS PREPARED BY: N. BITTING REVIEWED BY: D.C. SARKAR	REVISIONS INIT. DATE	