

PLAN

AS-BUILT REPAIR QUANTITY TABLE		
TOP OF DECK REPAIRS		
	ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	236 SQ. YDS.	
CLASS II SURFACE PREPARATION	* 0.5 SQ. YDS.	
CONCRETE DECK REPAIR FOR PPC OVERLAY	* 0.5 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	236 SQ. YDS.	
PPC MATERIALS	8.2 CU. YDS.	
PLACING AND FINISHING PPC OVERLAY	236 SQ. YDS.	
GROOVING BRIDGE FLOORS	1837 SQ. FT.	

TOP OF DECK REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR FOR PPC OVERLAY AFTER REMOVAL OF UNSOUND CONCRETE (MIN. 2" CLEAR TO SAWCUT). SEE OVERLAY SURFACE PREPARATION FOR POLYESTER POLYMER CONCRETE SPECIAL PROVISION.

NOTES:


REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR SECTION A-A, SEE "JOINT DETAILS" SHEET.

* CLASS II SURFACE PREPARATION AND CONCRETE REPAIR FOR PPC OVERLAY ARE NOT ANTICIPATED. A TOKEN PAY ITEM IS INDICATED FOR PRICING PURPOSES IN THE EVENT UNANTICIPATED CLASS II AREAS ARE ENCOUNTERED.

PROJECT NO. I-5825
MECKLENBURG COUNTY
 BRIDGE NO. 215

SHEET 2 OF 4

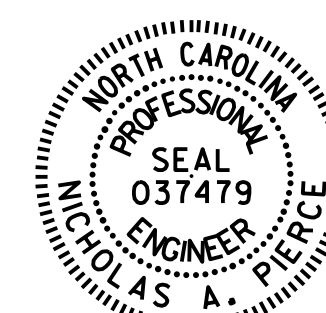

DocuSigned by:
 Nicholas Pierce 3/2/2018
 151108434020485...

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

PLAN OF SPAN
 SPAN B

DRAWN BY : E. K. POPE DATE : 1/18
 CHECKED BY : N. A. PIERCE DATE : 1/18

DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	S-20
1			3			TOTAL SHEETS
2			4			31