DocuSign Envelope ID: 86D54535-9650-4DA6-8C64-07D62DB39918

PROJECT REFERENCE NO. SHEET NO. SIG-4.2

ECONOLITE ASC/3-2070 OVERLAP PROGRAMMING DETAIL

(program controller as shown)

- 1. From Main Menu select 2. CONTROLLER
- 2. From CONTROLLER Submenu select 2. VEHICLE OVERLAPS
- 3. Toggle Once

OVERLAP B

Select TMG VEH OVLP [B] and 'OTHER/ECONOLITE'

OVERLAP D

Select TMG VEH OVLP [D] and 'PPLT FYA'

TMG VEH OVLP...[D] TYPE:PPLT FYA

PROTECTED LEFT TURN.... PHASE 7

OPPOSING THROUGH..... PHASE 8

FLASHING ARROW OUTPUT....CH12 ISOLATE

DELAY START OF: FYA..O.O CLEARANCE..O.O

END PROGRAMMING


ACTION PLAN SF BIT DISABLE..... 0

THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: Ø6-Ø767T1 DESIGNED: March 2018 SEALED: 03-29-2018 REVISED: N/A

Temporary Design 1 - TMP Phase II Electrical Detail - Sheet 2 of 2



Stantec Consulting Services Inc. 801 Jones Franklin Road-Suite 300 Raleigh, NC 27606 Tel. (919) 851-6866 Fax. (919) 851-7024 www.stantec.com License No. F-0672

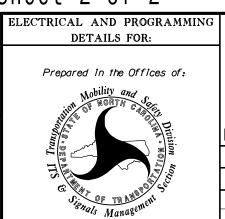

750 N.Greenfield Pkwy, Garner, NC 27529

US 401 (Raeford Rd.) at Chilton Dr / Rayconda Rd

Division 6 Cumberland County Fayetteville
PLAN DATE: March 2018 REVIEWED BY: L Overn
PREPARED BY: R M Muncey REVIEWED BY:
REVISIONS INIT. DATE

SEAL

OUNTER

:*Irattic*Signals*Design*Electrical Details*lemporary Signals*Fhase Z*U-44U5_sig_ele_U6-U; ser:rmuncey