U - 4405	SIG-17.2
ROJECT REFERENCE NO.	SHEET NO.

ECONOLITE ASC/3-2070 OVERLAP PROGRAMMING DETAIL

(program controller as shown)

- 1. From Main Menu select 2. CONTROLLER
- 2. From CONTROLLER Submenu select 2. VEHICLE OVERLAPS

Toggle Until Positioned on Overlap G

OVERLAP G

Select TMG VEH OVLP [G] and 'NORMAL'

Toggle Until Positioned on Overlap A

OVERLAP A

Select TMG VEH OVLP [A] and 'PPLT FYA'

TMG VEH OVLP...[A] TYPE:PPLT FYA

PROTECTED LEFT TURN... PHASE 1
OPPOSING THROUGH.... OVERLAP G

FLASHING ARROW OUTPUT....CH9 ISOLATE

DELAY START OF: FYA..O.O CLEARANCE..O.O
ACTION PLAN SF BIT DISABLE......

END PROGRAMMING

FLASHER CIRCUIT MODIFICATION DETAIL

IN ORDER TO INSURE THAT SIGNALS FLASH CONCURRENTLY ON THE SAME APPROACH, MAKE THE FOLLOWING FLASHER CIRCUIT CHANGES:

- 1. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-4 AND TERMINATE ON T2-2.
- 2. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-5 AND TERMINATE ON T2-3.
- 3. REMOVE FLASHER UNIT 2.

THE CHANGES LISTED ABOVE TIES ALL PHASES AND OVERLAPS TO FLASHER UNIT 1.


THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: Ø6-Ø274T3 DESIGNED: March 2018 SEALED: 03-29-2018 REVISED: N/A

Temporary Design 3 - TMP Phase III Electrical Detail - Sheet 2 of 2



Stantec Consulting Services Inc. 801 Jones Franklin Road-Suite 300 Raleigh, NC 27606 Tel. (919) 851-6866 Fax. (919) 851-7024 www.stantec.com

License No. F-0672

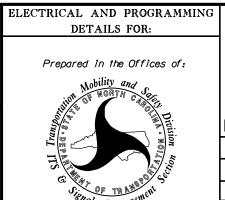

750 N.Greenfield Pkwy, Garner, NC 27529

US 401 (Raeford Road) at NC 162 (Bunce Road)/ SR 1411 (Bunce Road)

SR 1411 (Bunce Road)

Division 6 Cumberland County Fayetteville

PLAN DATE: March 2018 REVIEWED BY: L Overn

PLAN DATE: March 2018 REVIEWED BY: L Overn

PREPARED BY: G B Spell REVIEWED BY:

REVISIONS INIT. DATE

SEAL

SEAL

O45933

DATE

DATE

DOCUMENT NOT CONSIDERED FINAL

SEAL

O45933

A729/201

DATE

SIG. INVENTORY NO. 06-0274T3

U:*Traffic*Signals*Design*Electrical Details*Temporary Signals*Phase 3*U-4405_sig_ele User:rmuncey