
\bigcirc

		03–0369 US 17 (MARKET ST) AT SR 2717 (TORCHWOOD BL SR 1363 (BAYSHORE DR
		NEW FROM SPLICE ENCLOSURE FOR INTERSECTION 03–0635 US 17 (MARKET ST) AT FIRESTATION 36 FIBERS
N	OTES:	
1.	UNUSED FIBERS LEFT COILED AND STO	ORED IN SPLICE TRAY.
2.	UNUSED BUFFER TUBES LEFT COILED A SPLICE ENCLOSURE.	and stored in
3.	TRANSCEIVER TERMINATION CONFIGUE CONTRACTOR IS RESPONSIBLE FOR DE PROPER TERMINATION.	
4.	INCLUDE ON THE COVER OF EACH S REFERENCE SECTION 1731 "FIBER OPTIC	
	(1) SPLICE (2) DATE (3) COMPANY NAME (4) NAME OF INDIVIDUAL PERFORMING	THE SPLICING
	PRIOR TO INSTALLING THE COVER ON PHOTOGRAPH SHOWING THE SPLICE ABOVE (1–4) AND SUBMIT PHOTOGRAP TO THE ENGINEER.	TRAY AND INFORMATION SHO

 \bigcirc

	LEGEND	PROJECT REFERENCE NO. U-4902D	SHEET NO. SCP. 27
TIA/EIA 598–C (1) BLUE (7) RED (2) ORANGE (8) BLACH (3) GREEN (9) YELLCH (4) BROWN (10) VIOLEH (5) SLATE (11) ROSEH (6) WHITE (12) AQUA	C = CAP AND SEAL EXPRESS = EXPRESS ENTIRE BUFFER TUBE THROUGH WITHOUT CUTTING BUFFER SPLICE = SPLICE ALL FIBERS IN BUFFER		
CAT 5e (PoE) CABLE CAMERA CCTV-32			
ORANGE BUFFER TUBE GREEN BUFFER TUBE U-TU	NEW ICE ENCLOSURE ECTION 03–1130 (MARKET ST) AT JRN BULB 36 FIBERS		
TMP - FINAL		MENT NOT CONSIDERED	
Plans Prepared for:	US 17 (MARKET ST) SPLICE DETAILS Division 03 New Hanover Co. Wilm	SEAL ORTH CAR SEAL O3146 Z	
750 N. Greenfield Pkwy., Garner, NC 2 SCALE NONE	PLAN DATE: February 2018 REVIEWED BY: A.D. Klin 27529 PREPARED BY: T.R. Terrell REVIEWED BY: N.R. Sim REVISIONS INIT.		8/1/2018

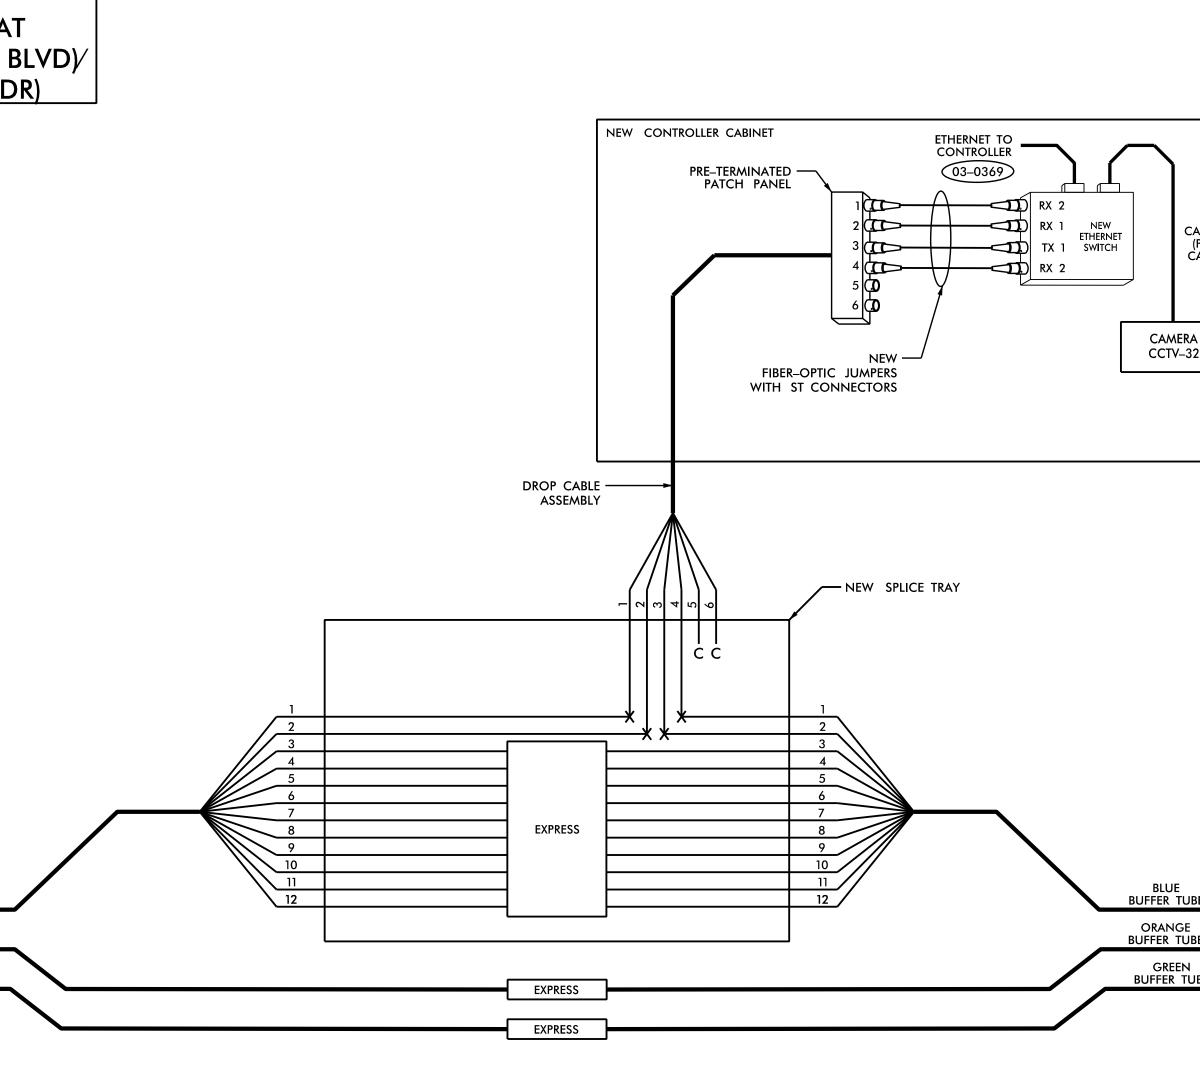

DIGITAL IOWN RESULTS

