



## JOINT INSTALLATION SEQUENCE AT END BENTS SECTION A-A

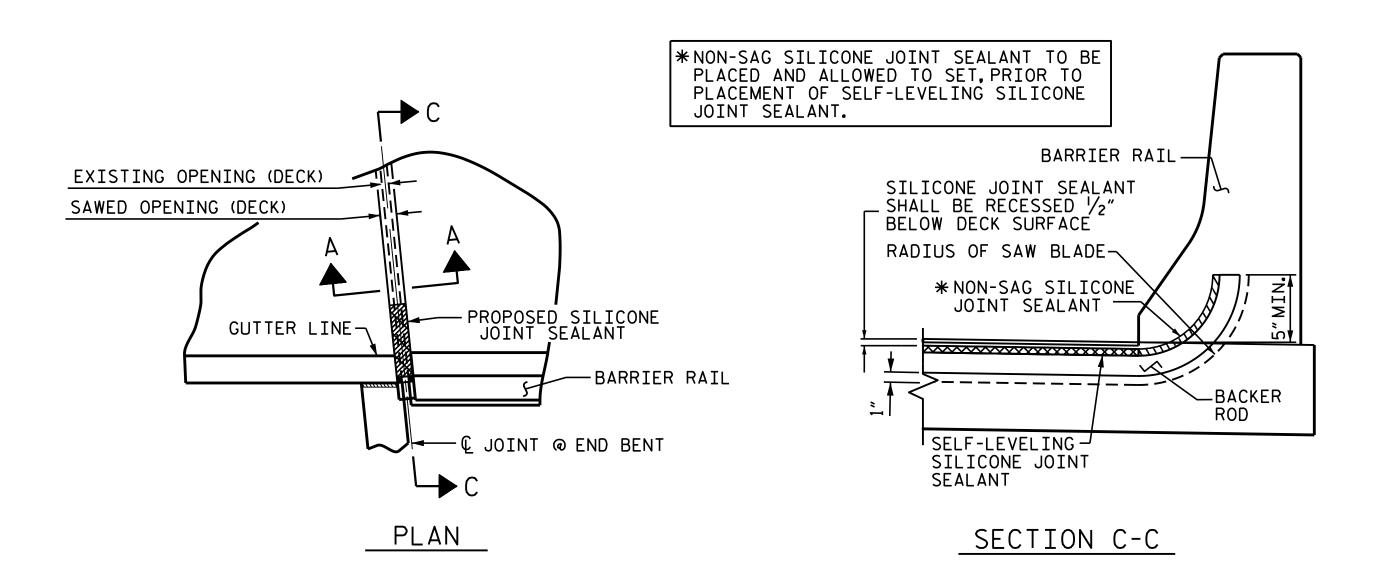

JOINT DETAIL AT BARRIER RAIL

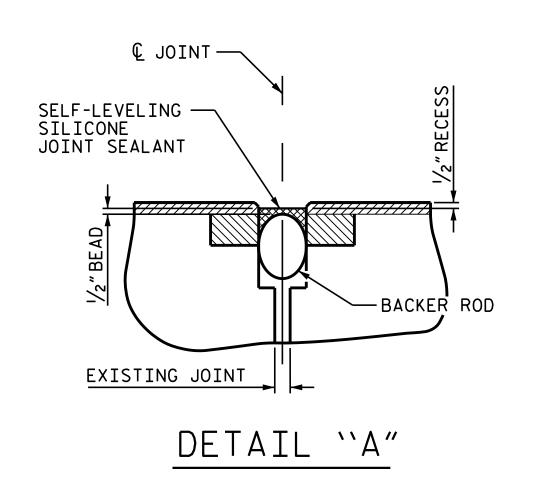

△ SAW CUT SHALL BE ¾"BELOW

THE BOTTOM OF THE JOINT SEAL.

SEE MANUFACTURER RECOMMENDATIONS

## NOTE:

THE CONTRACTOR SHALL FIELD VERIFY THE EXISTING JOINT OPENING PRIOR TO ORDERING JOINT SEAL MATERIAL. IF ACTUAL JOINT OPENING VARIES FROM THE OPENING INDICATED IN DETAIL BY MORE THAN 1/4", NOTIFY ENGINEER. REVISION TO THE JOINT SEAL SIZE MIGHT BE NECESSARY.

FINAL JOINT SEALS SHALL NOT BE INSTALLED UNTIL THE OVERLAY IS COMPLETE.

THE CONTRACTOR SHALL TAKE CARE DURING JOINT REHAB OPERATIONS NOT TO DROP ANY MATERIAL BELOW THE BRIDGE WITHOUT PROTECTIVE DEVICES BELOW TO CATCH THE MATERIAL. ANY MATERIAL THAT FALLS BELOW THE BRIDGE SHALL BE CONTAINED, REMOVED AND DISPOSED OF BY THE CONTRACTOR AT NO EXTRA COST TO THE DEPARTMENT. IF THE ENGINEER DETERMINES THAT THE PROTECTIVE DEVICES ARE NOT ADEQUATE OR NOT BEING EMPLOYED, THE WORK SHALL BE SUSPENDED UNTIL ADEQUATE PROTECTION IS PROVIDED.

THE CONTRACTOR WILL NOT BE PERMITTED TO FORM THE JOINTS IN LIEU OF SAWING THE JOINT.

DURING THE JOINT INSTALLATION PROCEDURE, THE JOINT AND SURROUNDING AREA SHALL BE KEPT CLEAN AND FREE OF DEBRIS.

FOR POURABLE SILICONE JOINT SEALANT, SEE SPECIAL PROVISIONS.

THE MANUFACTURER IS TO PROVIDE THE NOMINAL UNCOMPRESSED SEAL WIDTH OF THE BACKER ROD FOR THE EXISTING JOINT SIZE AND ACCOMMODATE THE MINIMUM EXPANSION SHOWN ON THE PLANS.

A MANUFACTURER'S CERTIFIED TRAINED REPRESENTATIVE SHALL BE PRESENT DURING THE INSTALLATION OF THE FIRST JOINT OF THE PROJECT, OR UNTIL THE ENGINEER IS SATISFIED WITH THE INSTALLATION PROCESS.

THE INSTALLATION OF THE JOINT SEAL SHALL BE WATERTIGHT.

FINAL SURFACE OF THE JOINT DEMOLITION AREA PRIOR TO PLACEMENT OF CONCRETE REPAIR MATERIAL SHOULD BE REASONABLY FLAT AND LEVEL. ENGINEER SHALL DETERMINE THE ACCEPTABILITY OF THE SURFACE PRIOR TO PLACEMENT OF REPAIR CONCRETE.

JOINT F	REPAIR QUANT	ITY TABLE
	CLASS II SURFACE PREPARATION	CONCRETE DECK REPAIR FOR PPC OVERLAY
END BENT 1	5.7 SY	5.7 SY
END BENT 2	5.7 SY	5.7 SY
TOTAL	11.4 SY	11 <b>.</b> 4 SY

JOINT REPAIR QUANTITY TABLE		
ESTIMATE	ACTUAL	
51 <b>.</b> 2 LF		
51 <b>.</b> 2 LF		
102 <b>.</b> 4 LF		
	ESTIMATE 51.2 LF 51.2 LF	

PROJECT NO. I-5795

FORSYTH

BRIDGE NO. 330458



DEPARTMENT OF TRANSPORTATION
RALEIGH

JOINT DETAILS

REVISIONS

OCCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED 2

REVISIONS

NO. BY: DATE: NO. BY: DATE: S6-04

S100 3

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S100 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S100 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S100 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S100 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S100 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S10 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

S10 5

SHEET NO. BY: DATE: NO. BY: DATE: S6-04

DRAWN BY: C. RUIZ DATE: 08/2019
CHECKED BY: E. BAYISSA DATE: 04/2020