


SPAN B



+

+

GIRDER REPAIR




SHOTCRETE REPAIR AREA

EPOXY RESIN INJECTION

_ DATE : 6/2022 S. AGUILAR HERNANDEZ DRAWN BY _ DATE : 6/2022 A. SORSENGINH CHECKED BY : __ DESIGN ENGINEER OF RECORD: DATE : _

12/8/2022 R:\15BPR61\Structures\FinalPlans\402_027_15BPR61_SMU_DUR_S14_190010.dgn ksedai

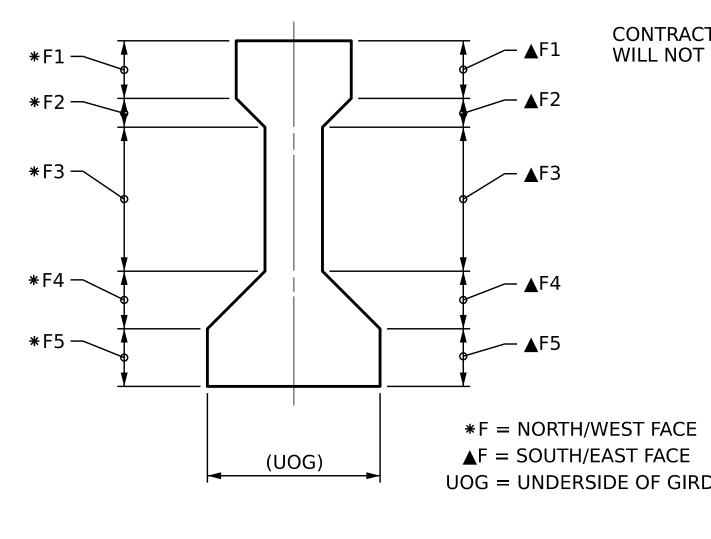

GIRDER SECTION

GIRDER DAMAGE LOCATIONS

AS-BUILT REPAIR QUANTITY TABLE					
DECK UNDERSIDE REPAIRS SPAN B	QUANTITIES				
	ESTIMATE		ACTUAL		
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF	
UNDERSIDE OF DECK	0	0			
CONCRETE DIAPHRAGM	11.5	5.8			
OVERHANG	0	0			
CONCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF	
UNDERSIDE OF DECK	0	0			
CONCRETE DIAPHRAGM	0	0			
OVERHANG	0	0			
GIRDER REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF	
GIRDER	1.4	0.7			
EPOXY COATING	AREA SF		AREA SF		
GIRDER END	268.4				

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 2" CLEAR TO SAWCUT. SEE REPAIR DETAILS.

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE REPAIR QUANTITY TABLE.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR EPOXY COATING CONCRETE GIRDER ENDS, SEE SPECIAL PROVISIONS.

FOR PRESTRESSED CONCRETE GIRDER REPAIR DETAILS AND LIMITS OF EPOXY COATING CONCRETE GIRDER ENDS, SEE PRESTRESSED CONCRETE GIRDER REPAIRS DETAIL SHEET.

FOR UNDERSIDE OF DECK AND OVERHANG REPAIRS, SEE "OVERHANG AND DIAPHRAGM REPAIR DETAILS" SHEET.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

CONTRACTOR SHALL SAWCUT TO A NOMINAL DEPTH OF 1/2" BUT REINFORCING STEEL SHALL NOT BE DAMAGED.

CONTRACTOR SHALL REMOVE SURFACE CONCRETE TO VERIFY THAT SAWCUT DEPTH WILL NOT DAMAGE EXISTING REINFORCING STEEL.

	PROJECT NO	15BPR.61
	CHEROKEE	COUNTY
	BRIDGE NO	190010
	SHEET 2 OF 5	
12/12/2022 12/12/2022 12/12/2022 SEAL 031583 DOER Doctorer Krishna P. Sedai EA6F794150BF4B7	STATE OF NOR DEPARTMENT OF RALE	IDE REPAIRS
	REVISIONS	SHEET NO. S2-14
DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED	NO. BY: DATE: NO. E 1 3 3 4 2 4 4 3	BY: DATE: 52-14 TOTAL SHEETS 28