


8/26/21

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE REPAIR QUANTITY TABLE.

CONCRETE REPAIRS MAYBE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.


ALL GIRDERS SHALL BE PAINTED IN ACCORDANCE WITH THE LIMITS OF ZONE PAINTING DETAIL.

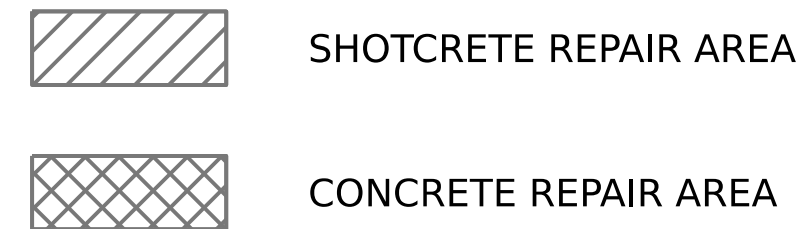



DECK UNDERSIDE REPAIR QUANTITY TABLE

Table with columns: SPAN B, QUANTITIES (ESTIMATE, ACTUAL), AREA SF, VOLUME CF. Rows include SHOTCRETE REPAIRS and CONCRETE REPAIRS for UNDERSIDE OF DECK, CONCRETE DIAPHRAGM, and OVERHANG.

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 2" CLEAR TO SAWCUT. SEE REPAIR DETAILS.

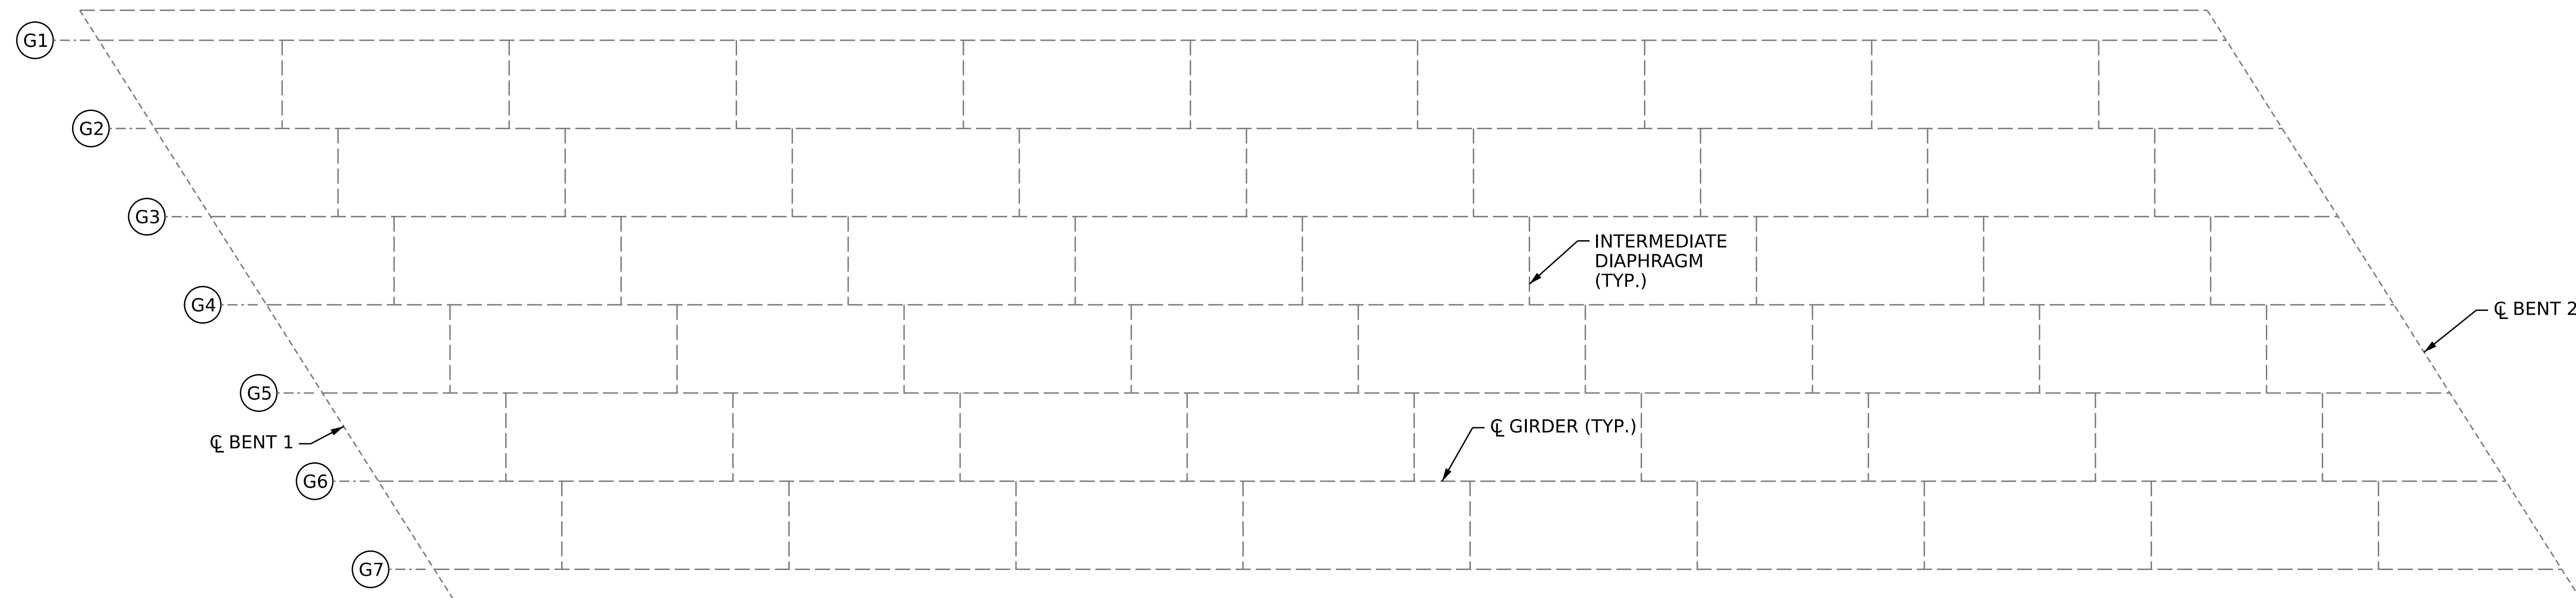

SPAN B (UNDERSIDE)

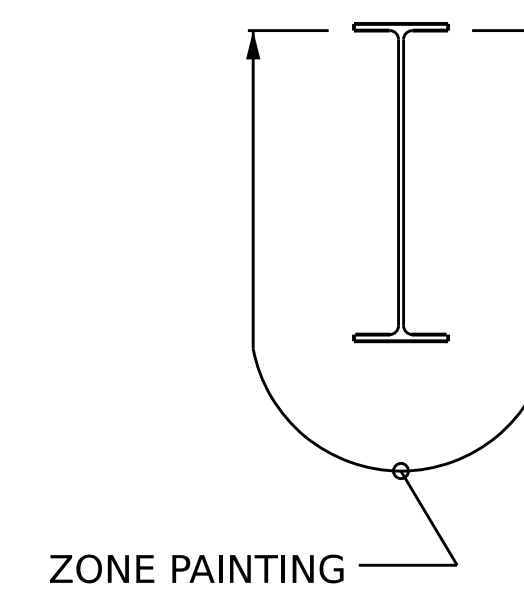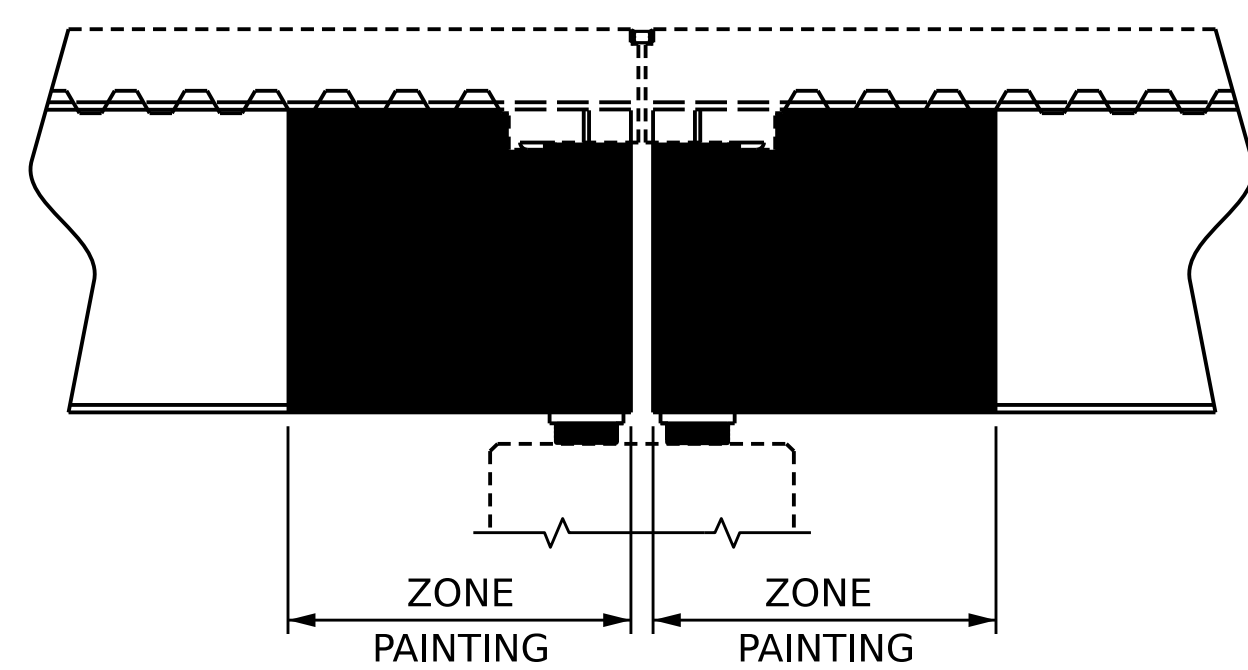

LIMITS OF ZONE PAINTING

PROJECT NO. 15BPR.124.3

WAKE COUNTY


BRIDGE NO. 911039

SHEET 2 OF 3

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH

DECK UNDERSIDE REPAIR

SPAN B

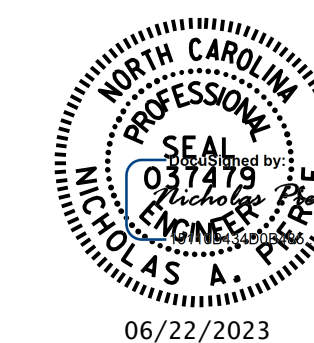

DRAWN BY: D.A. CANTRELL/A.Y. GODFREY DATE: 09/2022
CHECKED BY: N.A. PIERCE DATE: 10/2022
DESIGN ENGINEER OF RECORD: N.A. PIERCE DATE: 12/2022

6/22/2023 R:\Structures\Plans\15BPR124\402.025.15BPR124.SMU_DUR02.S2-13.911039.dgn aygodfrey

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

Table with columns: NO., BY, DATE, REVISIONS, SHEET NO. Includes revision history and total sheet count (18).