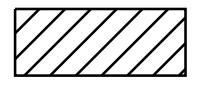
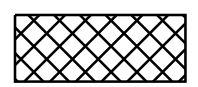



AS-BUILT REPAIR QUANTITY TABLE

TOP OF DECK REPAIRS - SPAN B

	ESTIMATE	ACTUAL		
CLASS II SURFACE PREPARATION	0.0 SY			
CONCRETE DECK REPAIR	0.0 SY			
SHOTBLASTING BRIDGE DECK	957.0 SY			
SILANE DECK TREATMENT	957.0 SY			
SURFACE PREP. FOR CONCRETE BARRIER	1,172.0 SF			
SILANE BARRIER RAIL TREATMENT	1,172.0 SF			
CONCRETE REPAIRS	ESTIMATE		ACTUAL	
	AREA SF.	VOLUME CF	AREA SF.	VOLUME CF
CONCRETE CURB AND RAIL	0.0	0.0		

-  CLASS II SURFACE PREPARATION
-  CONCRETE REPAIR (CR)

NOTES:
 REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.
 DECK SURFACE REPAIR QUANTITIES REPRESENT ESTIMATED VALUES OF CLASS II SURFACE PREPARATION AND CONCRETE DECK REPAIR AFTER REMOVAL OF UNSOUND CONCRETE. SEE CONCRETE FOR DECK REPAIR SPECIAL PROVISIONS.
 FOR CONCRETE REPAIR, SEE SPECIAL PROVISIONS.

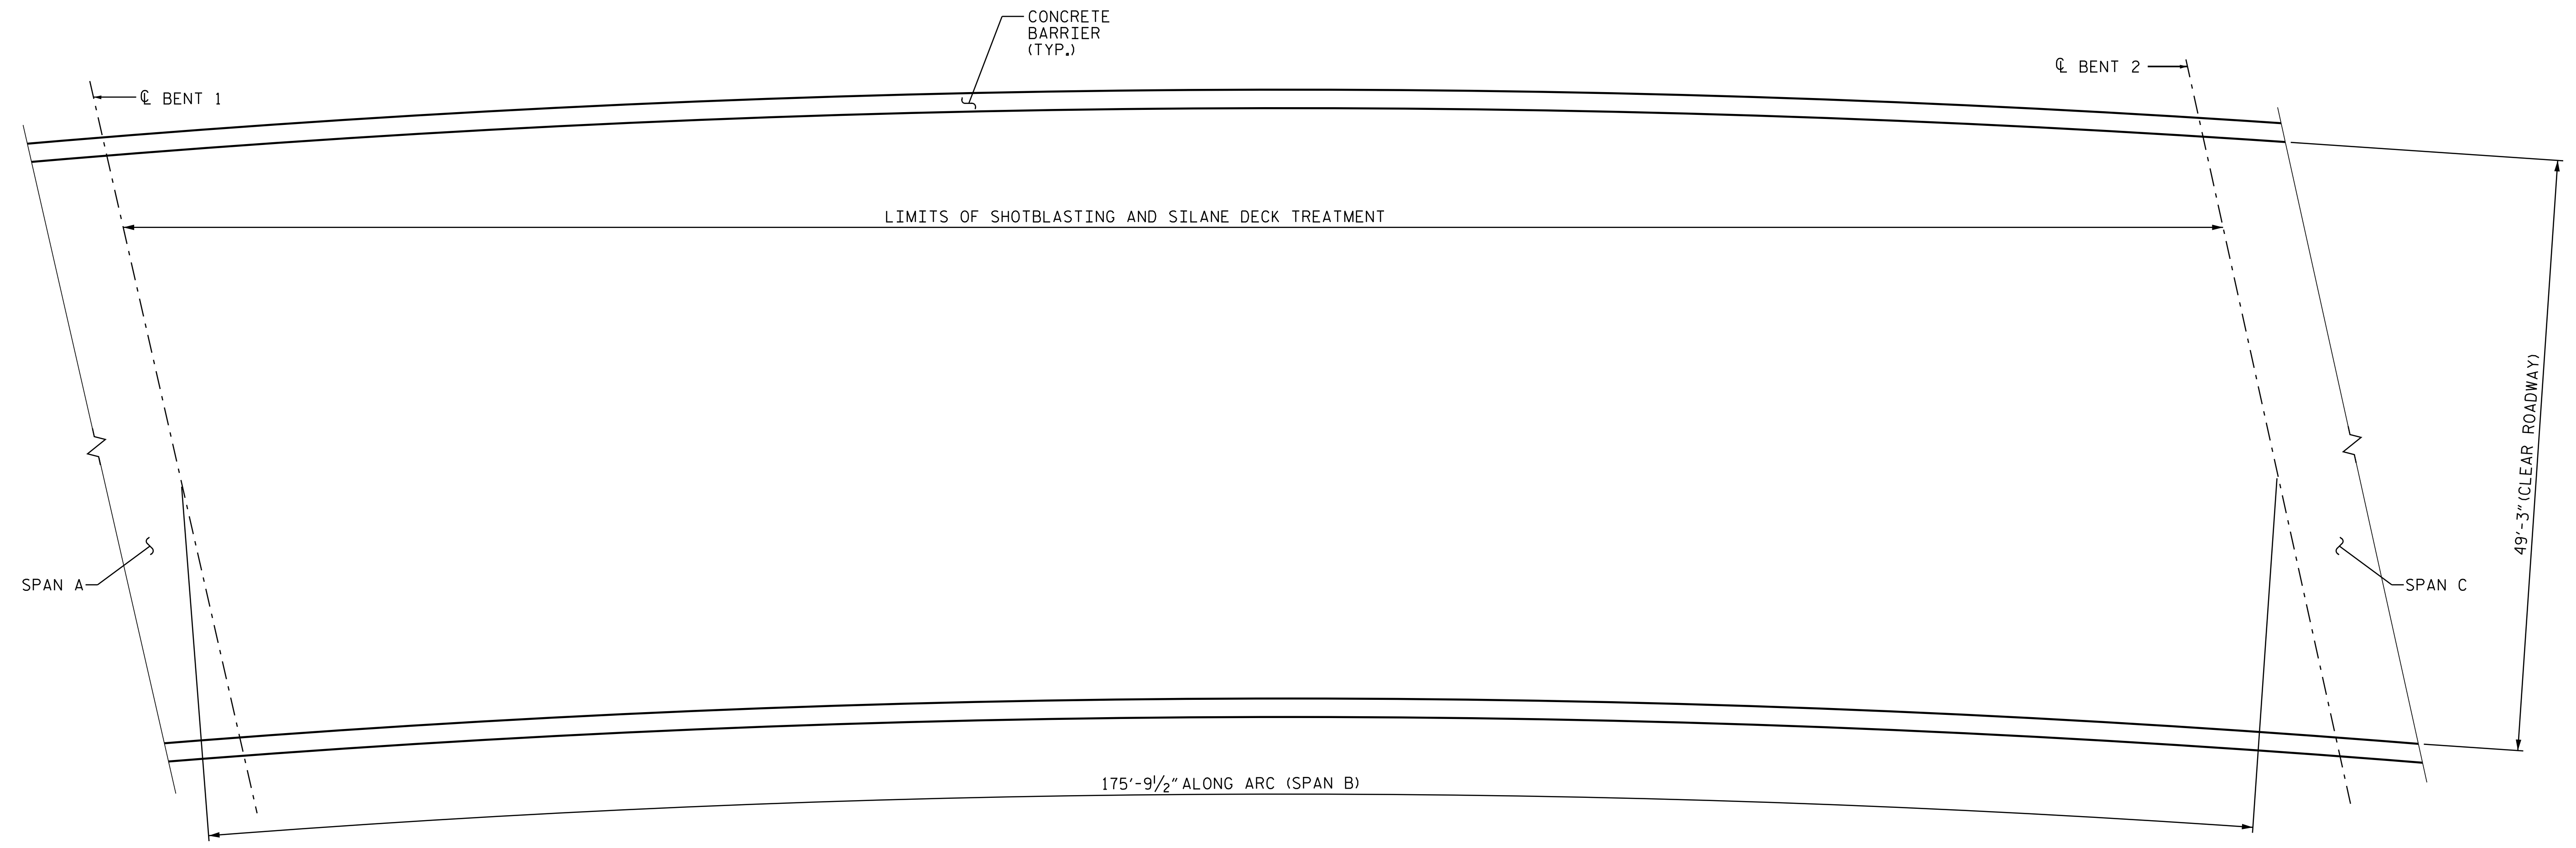


PLAN OF SPAN B

PROJECT NO. I-5941
DURHAM COUNTY
 BRIDGE NO. 310135
 SHEET 3 OF 6

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

Designed by: *Farzin Asefnia*



11/13/2023

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

DECK SURFACE REPAIR
 SPAN B

DRAWN BY : M. HOGAN DATE : 3/2023
 CHECKED BY : JIA XU DATE : 7/2023
 DESIGN ENGINEER OF RECORD: F. ASEFNIA DATE : 11/2023

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			S3-6
2			4			TOTAL SHEETS 18

E.L. ROBINSON

3362 Old Forks Rd.
 Raleigh, N.C. 27609
 Tel: 984.980.2810
 efarz@elrob.com
 License: C-22 9