ROJECT	REFERENCE NO.	SHEET NO.
	I-5898	Sig 16.2

FLASHER CIRCUIT MODIFICATION DETAIL

IN ORDER TO INSURE THAT SIGNALS FLASH CONCURRENTLY ON THE SAME APPROACH, MAKE THE FOLLOWING FLASHER CIRCUIT CHANGES:

- 1. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-4 AND TERMINATE ON T2-2.
- 2. ON REAR OF PDA REMOVE WIRE FROM TERM. T2-5 AND TERMINATE ON T2-3.
- 3. REMOVE FLASHER UNIT 2.

THE CHANGES LISTED ABOVE TIES ALL PHASES AND OVERLAPS TO FLASHER UNIT 1.

OUTPUT CHANNEL CONFIGURATION

Front Panel

Main Menu >Controller >More>Channels>Channels Config

Web Interface


Home >Controller >Advanced IO>Channels>Channel Configuration

Channel Configuration

Sharmor Sormgaration						
Channel	Control Type	Control Source	Flash Yellow	Flash Red	Flash Alt	MMU Channel
1	Phase Vehicle	1		Х	Х	1
2	Phase Vehicle	2		Х		2
3	Phase Vehicle	3		Х	Х	3
4	Phase Vehicle	4		Х		4
5	Phase Vehicle	5		Х		5
6	Phase Vehicle	6		Х	Х	6
7	Phase Vehicle	7		Х		7
8	Phase Vehicle	8		Χ	Х	8
9	Overlap	1		X	Χ	9
10	Overlap	2		Χ	Χ	10
11	Overlap	3		Χ		11
12	Overlap	4		X		12
13	Phase Ped	2				13
14	Phase Ped	4				14
15	Phase Ped	6				15
16	Phase Ped	8				16
17	Overlap	5		Х	Х	17
18	Overlap	6		Χ		18

THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: 07-2075 T2 DESIGNED: June 2025 SEALED: 6/27/2025 REVISED: N/A

Signal_Upgrade - Temporary_Design_1_(TMP_Phase_II_)_ Electrical_Detail_-_Sheet_2_of_2_____

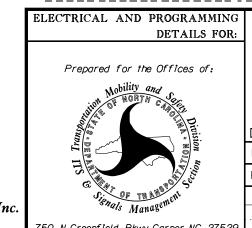

US 311/NC 135 at SR 2271(Shakey Road) and SR 2283 (Commerce Drive)

SR 2283 (Commerce Drive)

Division 7 Rockingham County Mayor

PLAN DATE: June 2025 REVIEWED BY:

PREPARED BY: Golam Moinuddin REVIEWED BY:

REVISIONS INIT. DATE

SEAL

OFESS/ON

SEAL

O34454

O34454

ONE FROM

MOINTING

Signed by:

Golam Mointaldin

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

Prepared in the Offices of:

Johnson, Mirmiran, & Thompson Inc.
4700 Falls of Neuse Rd, Suite 100,
Raleigh, NC, 27606
License No: C-3097