


DATE: 8/28/2018
TIME: 2:44:35 PM

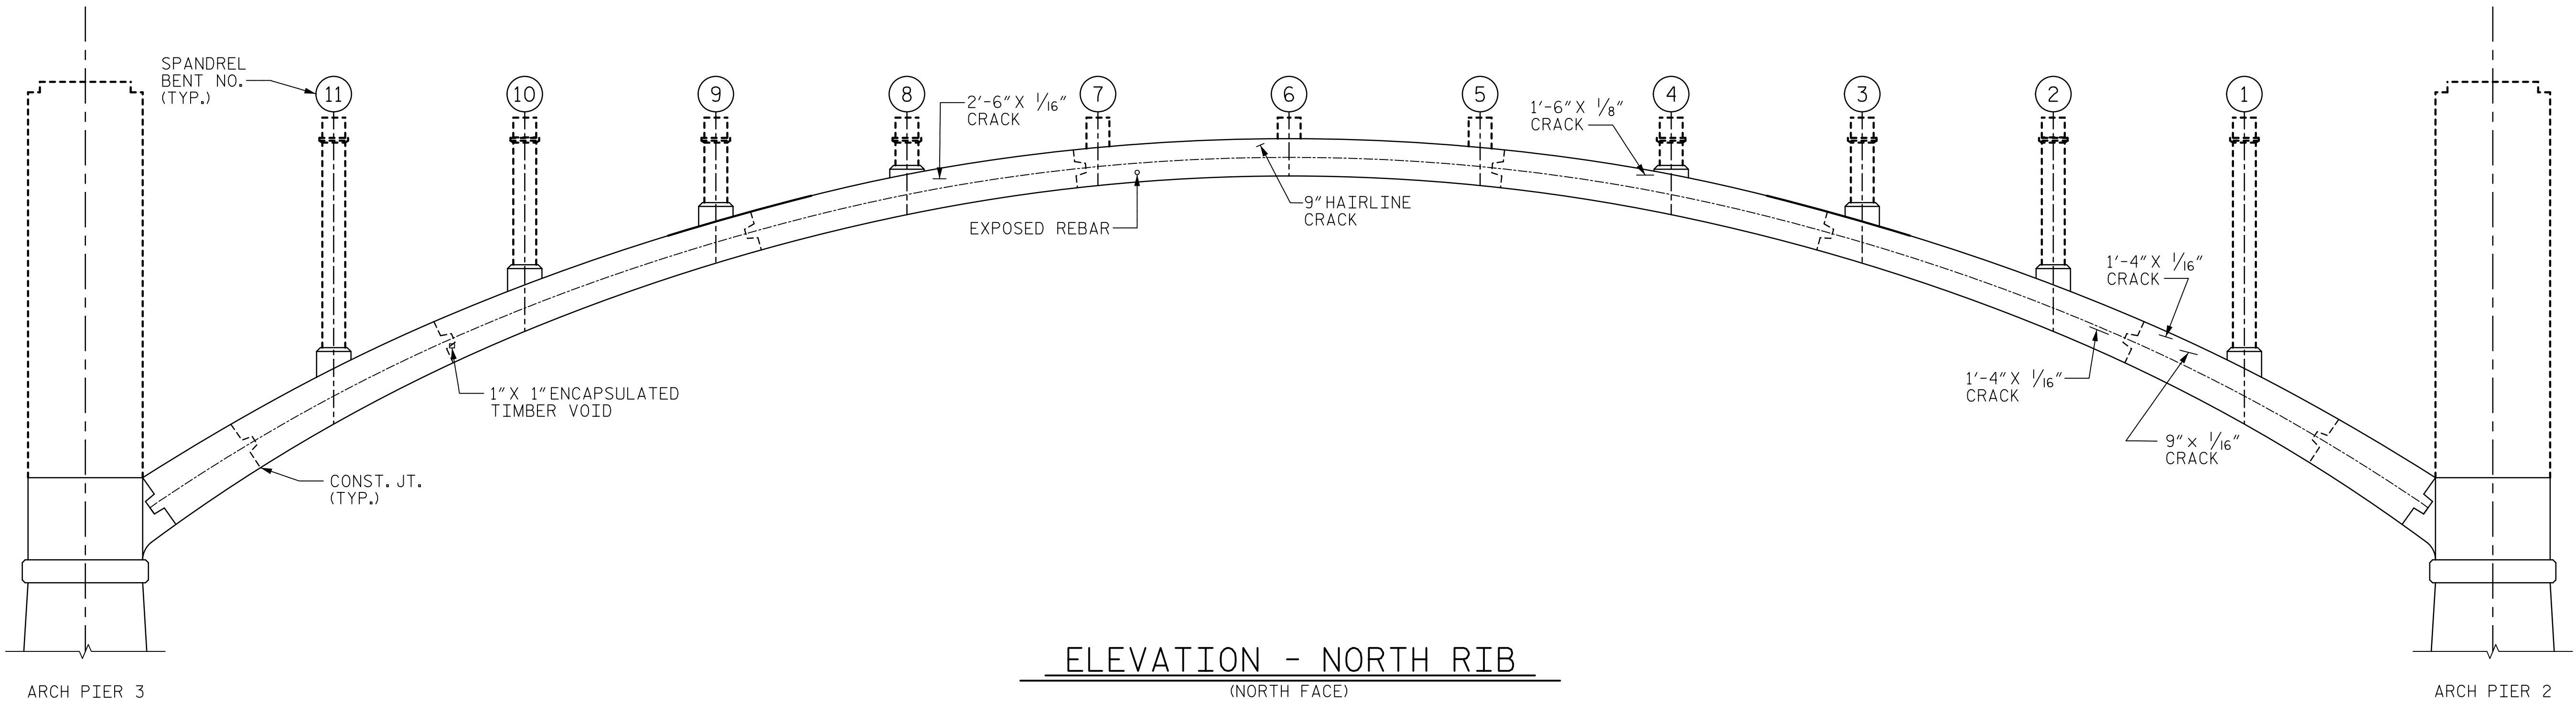


ARCH SPAN C NORTH ARCH RIB DEFECT CATALOG							
LOCATION	FACE	DEFECT TYPE	NO. OF DEFECTS	LENGTH	WIDTH	DEPTH	PROPOSED REPAIR
SPANDREL SPAN 2	SOFFIT	SPALL	-	18"	21"	1"	CONCRETE REPAIR
SPANDREL SPAN 5	NORTH FACE	CRACK	-	18"	1/8"	-	CONCRETE REPAIR
SPANDREL SPAN 5	SOFFIT	SPALL	-	4"	1"	1/2"	EPOXY MORTAR REPAIRS
SPANDREL SPAN 8	SOFFIT	HONEYCOMB	-	18"	12"	-	EPOXY MORTAR REPAIRS
SPANDREL SPAN 11	NORTH FACE	TIMBER VOID	-	1"	1"	-	EPOXY MORTAR REPAIRS
SPANDREL SPAN 12	TOP	SPALL	-	18"	6"	1/2"	EPOXY MORTAR REPAIRS
SPANDREL SPAN 1	TOP	SCALING	-	-	-	1/2"	NONE
SPANDREL SPAN 1	TOP	VEGETATION/DEBRIS	-	36"	1'	-	NONE
SPANDREL SPAN 2	TOP	SCALING	-	-	-	1/4"	NONE
SPANDREL SPAN 2	NORTH FACE	CRACK	-	16"	1/16"	-	NONE
SPANDREL SPAN 2	NORTH FACE	CRACK	-	9"	1/16"	-	NONE
SPANDREL SPAN 2	NORTH FACE	CRACK	-	16"	1/16"	-	NONE
SPANDREL SPAN 4	TOP	CRACK	-	18"	1/8"	-	NONE
SPANDREL SPAN 5	SOUTH FACE	CRACK	-	36"	HAIRLINE	-	NONE
SPANDREL SPAN 6	SOUTH FACE	CRACK	-	36"	1/16"	-	NONE
SPANDREL SPAN 7	NORTH FACE	CRACK	-	9"	HAIRLINE	-	NONE
SPANDREL SPAN 8	NORTH FACE	CRACK	-	30"	1/16"	-	NONE
SPANDREL SPAN 8	SOUTH FACE	CRACK	-	24"	HAIRLINE	-	NONE
SPANDREL SPAN 12	SOUTH FACE	CRACK	-	12"	1/8"	-	NONE
SPANDREL SPAN 12	TOP	VEGETATION/DEBRIS	-	-	-	-	NONE
SPANDREL SPAN 7	NORTH FACE	EXPOSED REBAR	-	6"	6"	-	SEE FOOT NOTE *
* CUT PROJECTING BAR AT FACE OF ARCH RIB							

LEGEND

- EXISTING TO REMAIN
- EXISTING TO BE REMOVED
- ARCH RIB STRUTS

PROJECT NO. B-4974
STANLY/MONTGOMERY COUNTY
STATION: 339+86.39 -L-

SHEET 2 OF 6

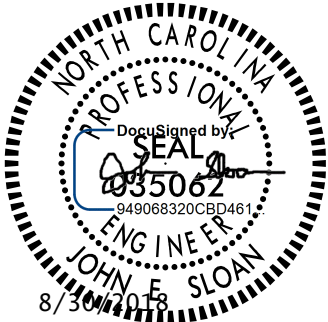

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

REHABILITATION

ARCH SPAN C DEFECTS
NORTH RIB (2)

REVISIONS

NO.	BY:	DATE:	NO.	BY:	DATE:
1			3		
2			4		

SHEET NO.
S-107
TOTAL SHEETS
148

DOCUMENT NOT CONSIDERED
FINAL UNLESS ALL
SIGNATURES COMPLETED

DRAWN BY : T. STUMP	DATE : 2/2018
CHECKED BY : J. SLOAN	DATE : 3/2018
DESIGNED BY : T. STUMP	DATE : 2/2018
DESIGN CHECKED BY : J. SLOAN	DATE : 3/2018