



DATE: 8/28/2018
TIME: 2:46:35 PM

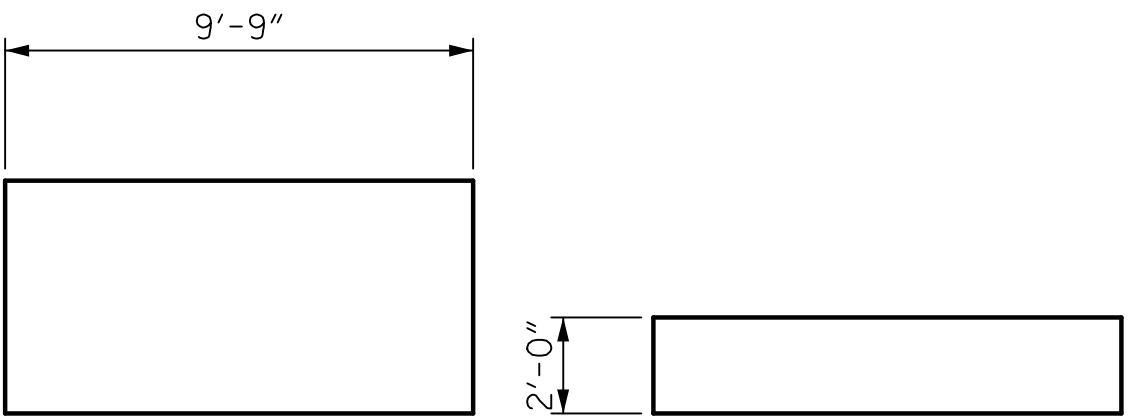

WEST FACE


TOP



SOFFIT


EAST FACE

BENT 7 STRUT

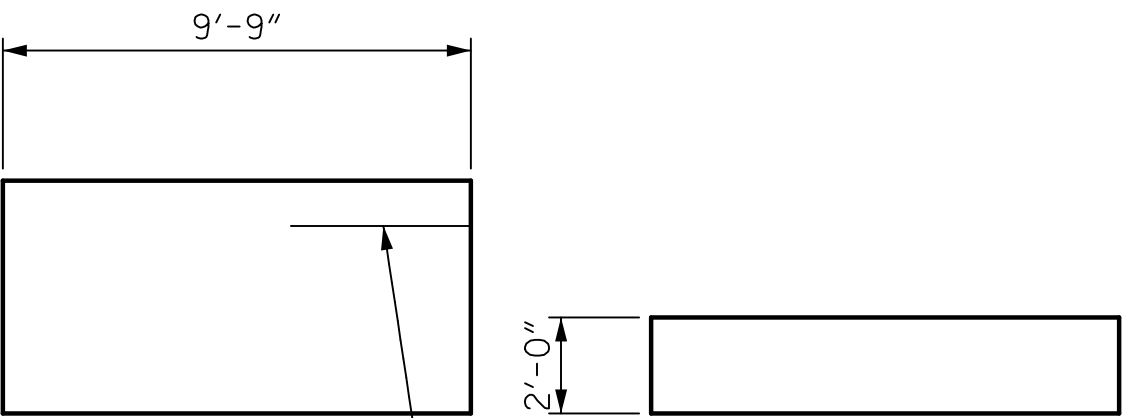

WEST FACE


TOP



SOFFIT


EAST FACE

BENT 8 STRUT

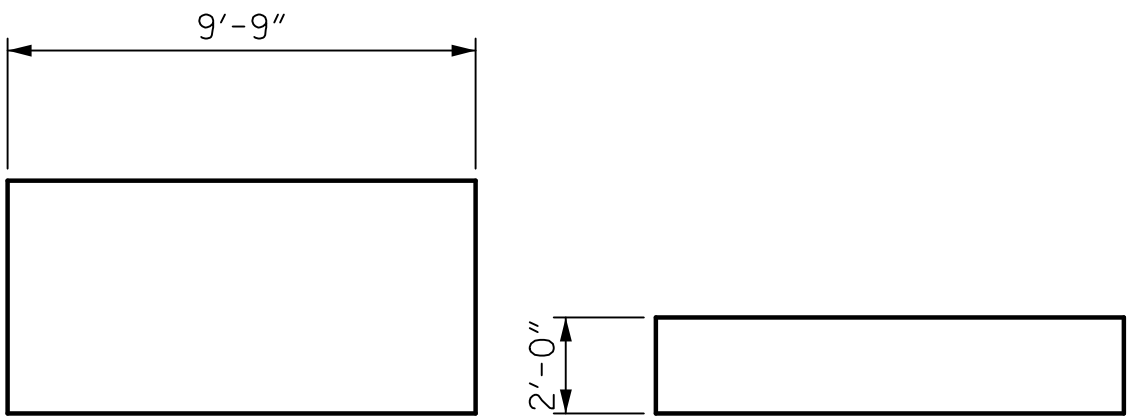

WEST FACE


TOP



SOFFIT


EAST FACE

BENT 9 STRUT

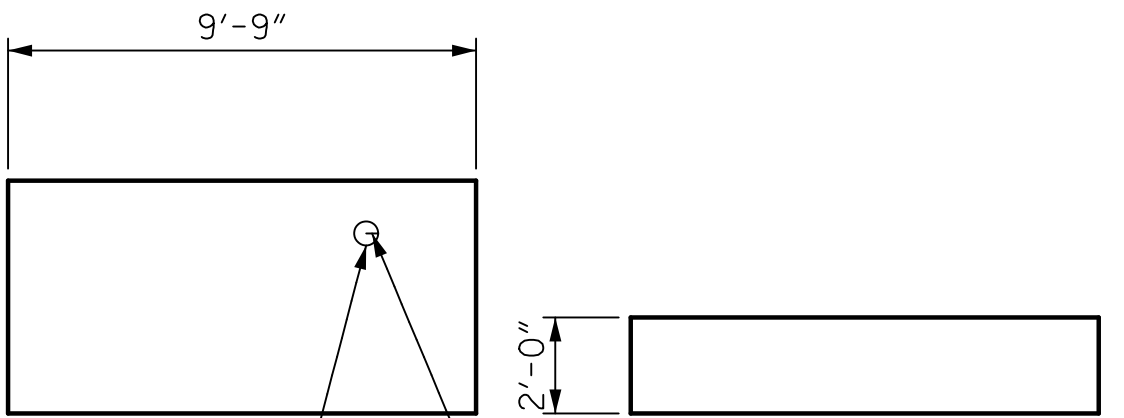

WEST FACE


TOP



SOFFIT


EAST FACE

BENT 10 STRUT

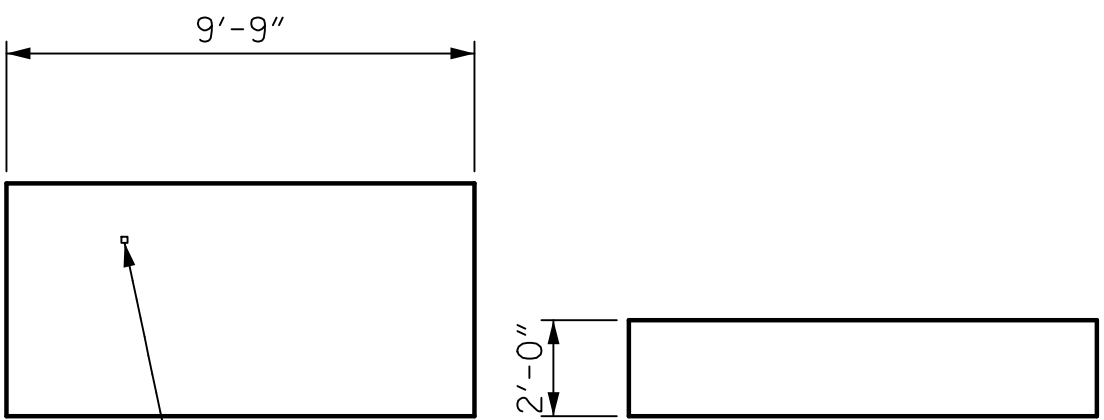

WEST FACE

TOP



SOFFIT

EAST FACE

BENT 11 STRUT


ARCH SPAN E ARCH RIB STRUT DEFECT CATALOG							
LOCATION	FACE	DEFECT TYPE	NO. OF DEFECTS	LENGTH	WIDTH	DEPTH	PROPOSED REPAIR
SPANDREL BENT 10	WEST FACE	PATCH	-	4"	3"	-	EPOXY MORTAR REPAIRS
SPANDREL BENT 11	WEST FACE	VOID	-	1 1/2"	1 1/2"	-	EPOXY MORTAR REPAIRS
SPANDREL BENT 8	WEST FACE	CRACK	-	39"	1/8"	-	NONE
SPANDREL BENT 8	EAST FACE	CRACK	-	36"	1/16"	-	NONE
SPANDREL BENT 10	WEST FACE	CRACK	-	3"	1/16"	-	NONE
SPANDREL BENT 11	EAST FACE	CRACK	-	34"	1/8"	-	NONE
SPANDREL BENT 11	EAST FACE	CRACK	-	39"	1/16"	-	NONE

PROJECT NO. B-4974

STANLY/MONTGOMERY COUNTY

STATION: 339+86.39 -L-

SHEET 6 OF 6

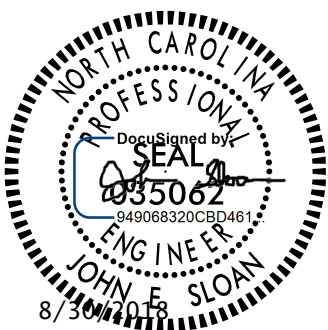

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

REHABILITATION

ARCH SPAN E DEFECTS
ARCH RIB STRUTS (2)

DRAWN BY : T. STUMP
CHECKED BY : J. SLOAN
DESIGNED BY : T. STUMP
DESIGN CHECKED BY : J. SLOAN

DATE : 2/2018
DATE : 3/2018
DATE : 2/2018
DATE : 3/2018

DOCUMENT NOT CONSIDERED
FINAL UNLESS ALL
SIGNATURES COMPLETED

REVISIONS					
NO.	BY:	DATE:	NO.	BY:	DATE:
1			3		
2			4		

SHEET NO.
S-123
TOTAL
SHEETS
148