


REPAIR QUANTITY TABLE


UNDERSIDE OF DECK REPAIRS

SHOTCRETE REPAIRS	ESTIMATE		ACTUAL	
	AREA SF	VOLUME CF	AREA SF	VOLUME CF
BENT DIAPHRAGMS	5.8	1.5		
	ESTIMATE		ACTUAL	
EPOXY RESIN INJECTION	3.0 LF			

VALUES IN CHARTS REPRESENT ESTIMATED UNDERSIDE OF DECK REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 1" CLEAR TO SAWCUT. SEE REPAIR DETAILS.

FOR NOTES AND SHOTCRETE REPAIRS ON BENT DIAPHRAGM DETAILS, SEE SHEET S-54.

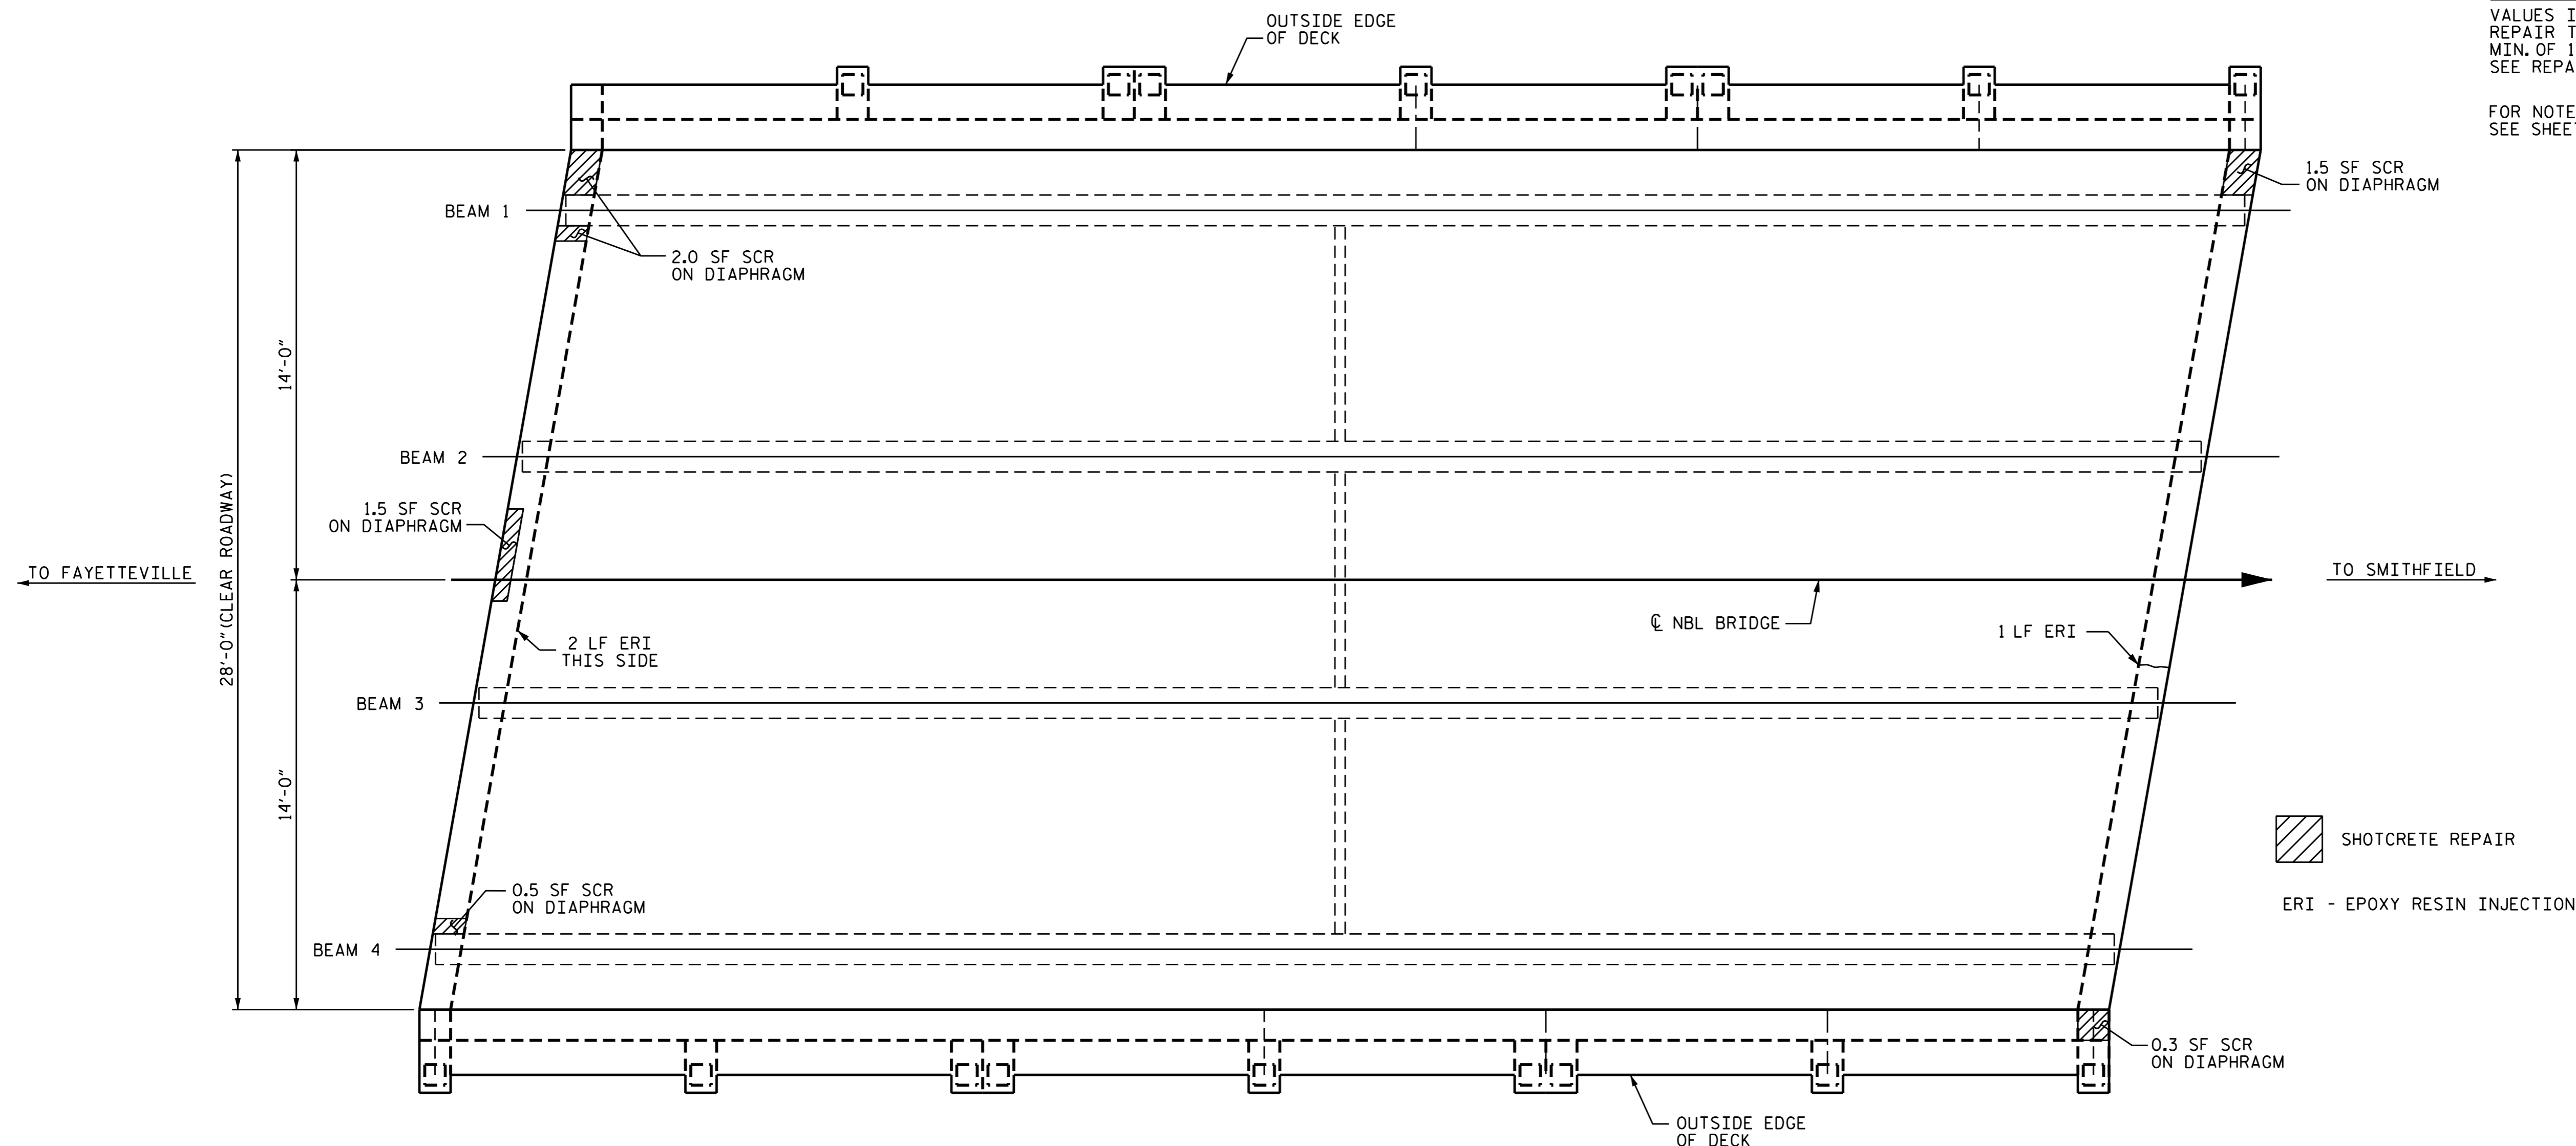

 SHOTCRETE REPAIR
 ERI - EPOXY RESIN INJECTION

PLAN OF SPAN B
UNDERSIDE

PROJECT NO. I-5788
HARNETT COUNTY
 BRIDGE NO.: 73

SHEET 2 OF 4



DocuSigned by:
Ting Hsiung Fang
E72086400977435

1/28/2016

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

SUPERSTRUCTURE
REPAIR
NBL
SPAN B

REVISIONS						SHEET NO. S-55 TOTAL SHEETS 72
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			
2			4			

DRAWN BY : A. SORSENGINH DATE : 11/2/15
 CHECKED BY : S. B. WILLIAMS DATE : 11/4/15