



Bridge tenders house, pivot span, and fender system

Tyrrell BR. # **880007** DATE **11/5/15** BY: **B.P.**

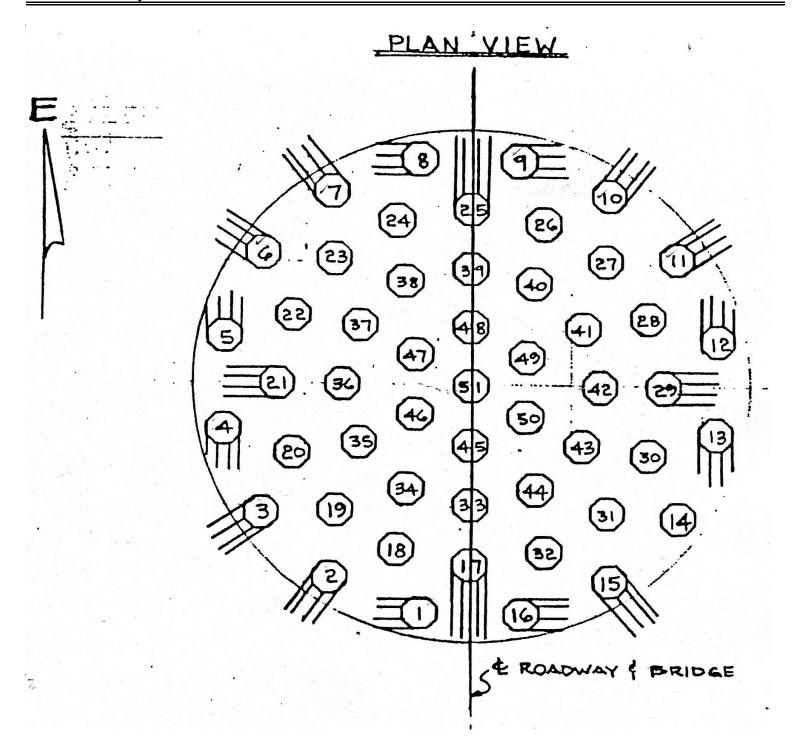

Pivot bent pile diagram

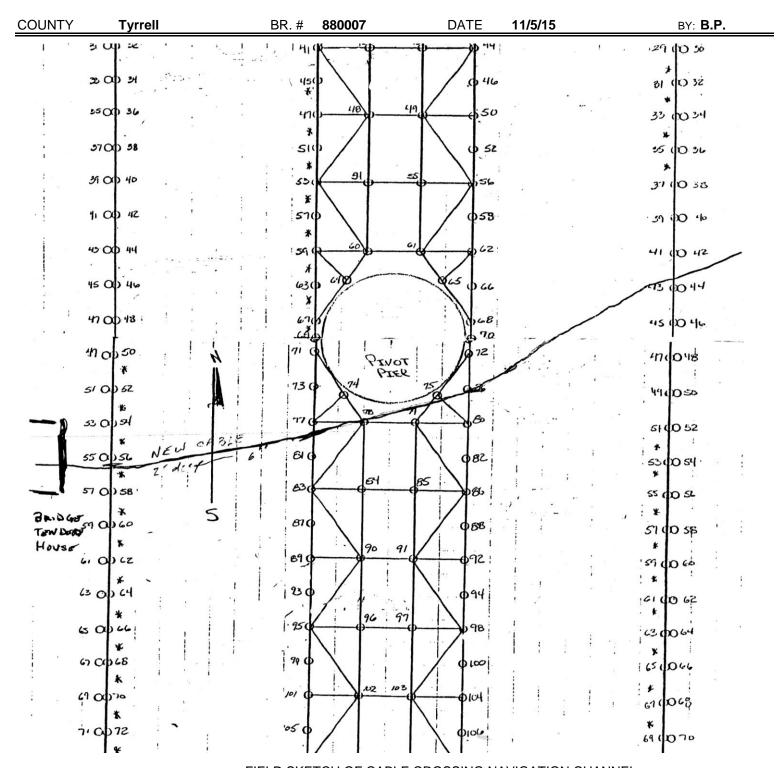

FIELD SKETCH OF CABLE CROSSING NAVIGATION CHANNEL STATION MARKS CORRESPOND WITH PAINT MARKS ON FENDER SYSTEM





P-5, F-5,6,7, DELAMINATED 2" - 3" DEEP






P-12, F-5,6,7, DELAM. 3" DEEP, FAILED REPAIR

P-13, F-6,7, DELAM. 2"-3" DEEP MULTIPLE 1/16"-1/8" CRACKS



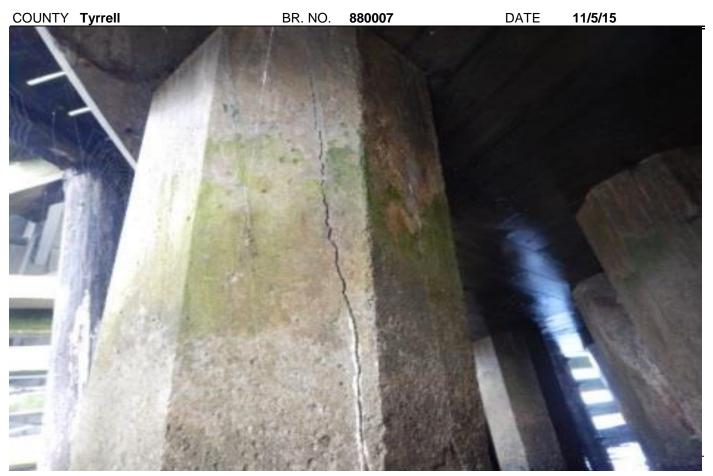

P-14, F-3,4,5, DELAM. 3" DEEP





P-17, F-6,7,8, DELAM. 1" TO 2" DEEP





P-19, F-2,3, DELAM. 2" DEEP






P-21, F-3,4,5, DELAM. 2" DEEP






P-25, F-4,5, DELAM. 2" DEEP



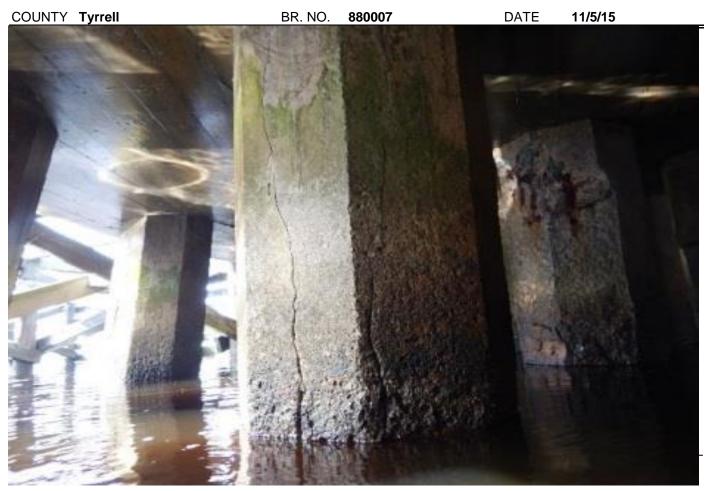

P-27, F-3,4, DELAM. 1" DEEP

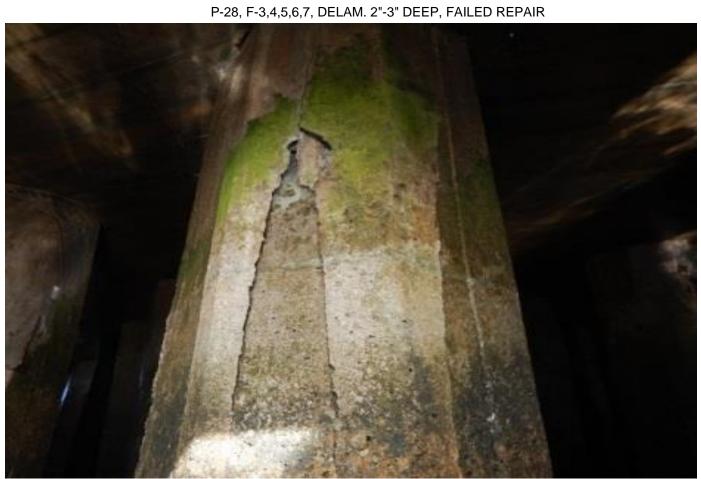



P-29, F-3,4,5,6,7, DELAM. 2"-3" DEEP, FAILED REPAIR




COUNTY Tyrrell BR. NO. 880007 DATE 11/5/15

P-32, F-3,4,5,6,7,8, DELAM. 2"-3" DEEP, FAILED REPAIR





P-34, F-4,5,6,7, DELAM. 2"-3" DEEP

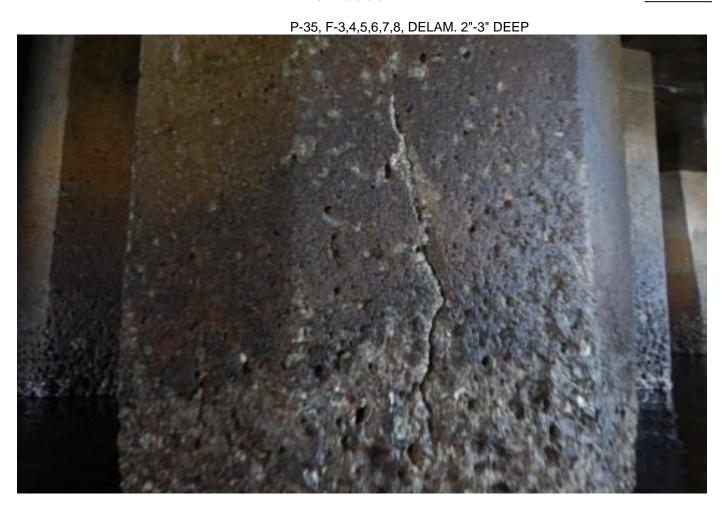



P-37, F-3,4,5,6,7,8, DELAM. 2"-3" DEEP





P-39, F-2,3,4,5,6,7, DELAM. 2"-3" DEEP, FAILED REPAIR







P-42, F-2,3,4,5,6, DELAM. 2"-3" DEEP





P-45, F-2,3,4,5,6,7, DELAM. 2"-3" DEEP





P-47, F-2,3,4, DELAM. 2" DEEP




COUNTY Tyrrell BR. NO. 880007 DATE 11/5/15

P-49, F-3,4,5,6,7, DELAM. 3" DEEP, FAILED REPAIR






P-51, F-6,7, DELAM. 1"- 2" DEEP

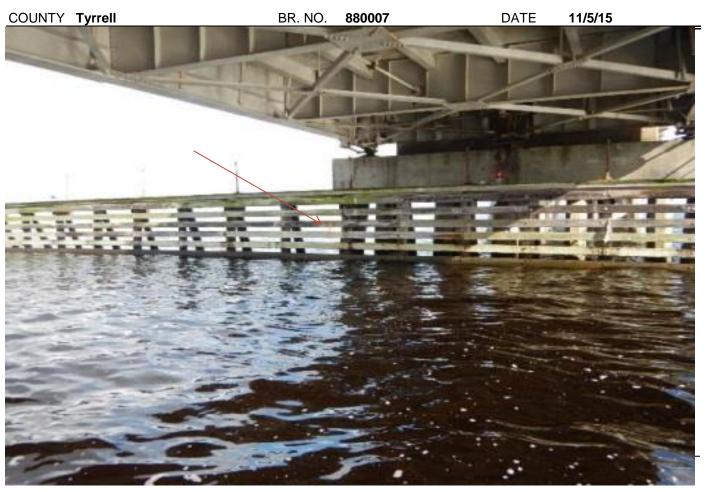

CABLE CROSSING AT EAST FENDER STATION 43, MARKED WITH FLAGGING TAPE



COUNTY **Tyrrell** BR. NO. **880007** DATE **11/5/15**

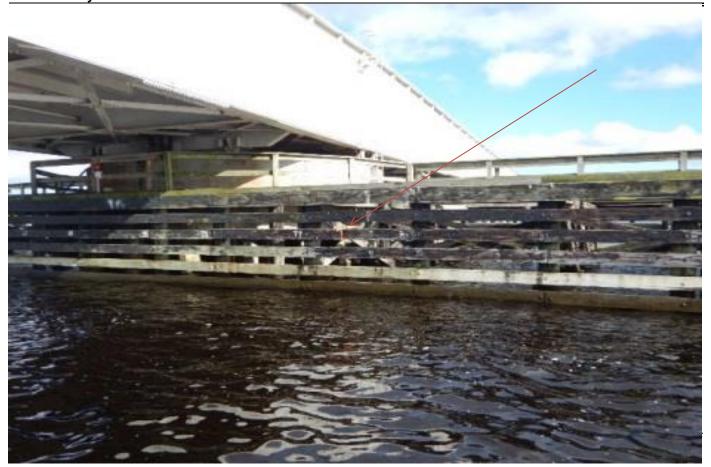

CABLE CROSSING WEST CHANNEL EAST SIDE STATION 79, MARKED WITH FLAGGING TAPE

