


SPAN 3 - UNDERSIDE

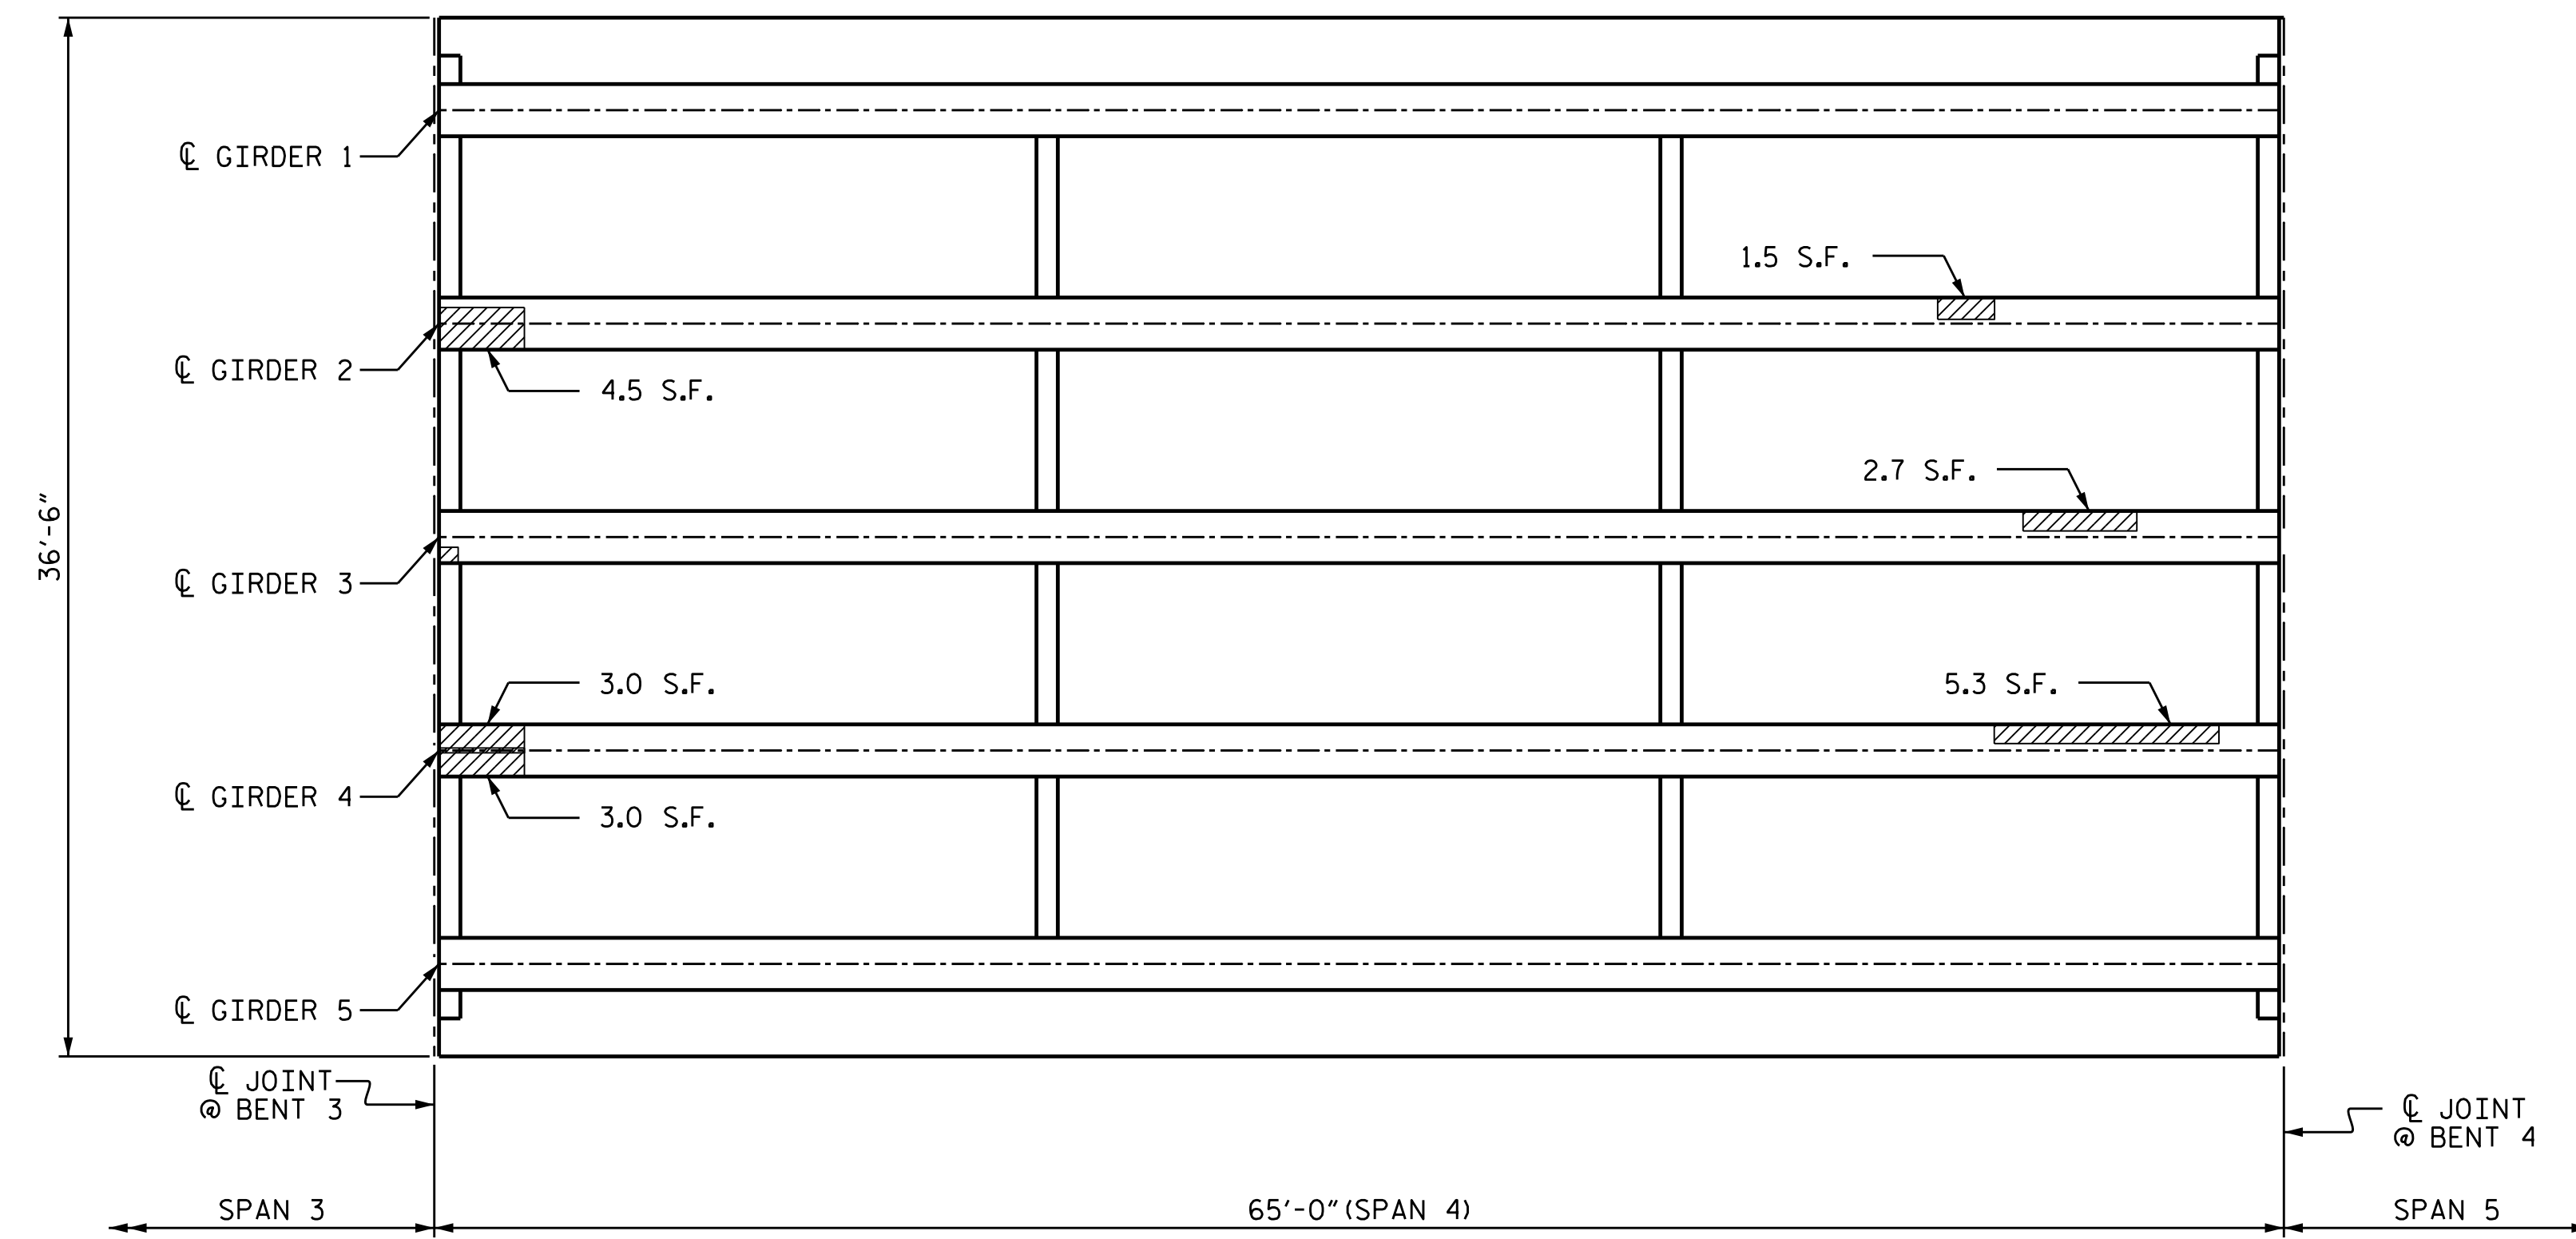

SPAN 4 - UNDERSIDE

REPAIR QUANTITY TABLE

REPAIRS SPAN 3	QUANTITIES			
	ESTIMATE		ACTUAL	
	AREA SF	VOLUME CF	AREA SF	VOLUME CF
SHOTCRETE REPAIRS	4.5	2.3		
PRESTRESSED CONCRETE GIRDER REPAIRS	14.8	4.3		

REPAIRS SPAN 4	QUANTITIES			
	ESTIMATE		ACTUAL	
	AREA SF	VOLUME CF	AREA SF	VOLUME CF
SHOTCRETE REPAIRS	0.0	0.0		
PRESTRESSED CONCRETE GIRDER REPAIRS	20.0	5.8		

NOTES:

SPANS WILL RECEIVE TSA COATING FOR THE FIRST 5' OF THE GIRDERS AT THE BENTS AND THEN THE TSA COATING IN PRESTRESSED CONCRETE GIRDER REPAIR LOCATIONS. SEE "PRESTRESSED CONCRETE GIRDERS WITH THERMAL SPRAY ANODE" SPECIAL PROVISION AND SHEETS S2-62 THRU S2-65.

FOR GIRDER & DIAPHRAGM AND UNDERDECK REPAIRS SEE "TYPICAL GIRDER, UNDERDECK AND DIAPHRAGM REPAIR DETAILS" SHEET.

FOR PRESTRESSED CONCRETE GIRDER REPAIR, SEE "PRESTRESSED CONCRETE GIRDERS WITH THERMAL SPRAY ANODE" SPECIAL PROVISION.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE TO REPAIR DEPTH AND MIN. 1" CL. TO SAW CUT. SEE REPAIR DETAILS.

- SHOTCRETE REPAIRS

- PRESTRESSED CONCRETE GIRDER REPAIR

PROJECT NO. B-5939  
CARTERET COUNTY  
 BRIDGE NO. 6

SHEET 2 OF 30



DocuSigned by:  
 Greg Dickey  
 884E488CE58486...

STATE OF NORTH CAROLINA  
 DEPARTMENT OF TRANSPORTATION  
 RALEIGH

FRAMING PLAN  
 SPAN 3 & 4

DRAWN BY : S. T. SANDOR DATE : 8/2016  
 CHECKED BY : M. A. LEE DATE : 9/2016

DOCUMENT NOT CONSIDERED  
 FINAL UNLESS ALL  
 SIGNATURES COMPLETED

NO.	REVISIONS			NO.	REVISIONS			SHEET NO.
	BY:	DATE:			BY:	DATE:		
1				3			S2-17	
2				4			TOTAL SHEETS	