


EDI MODEL 2018ECLIP-NC CONFLICT MONITOR PROGRAMMING DETAIL

(remove jumpers and set switches as shown)

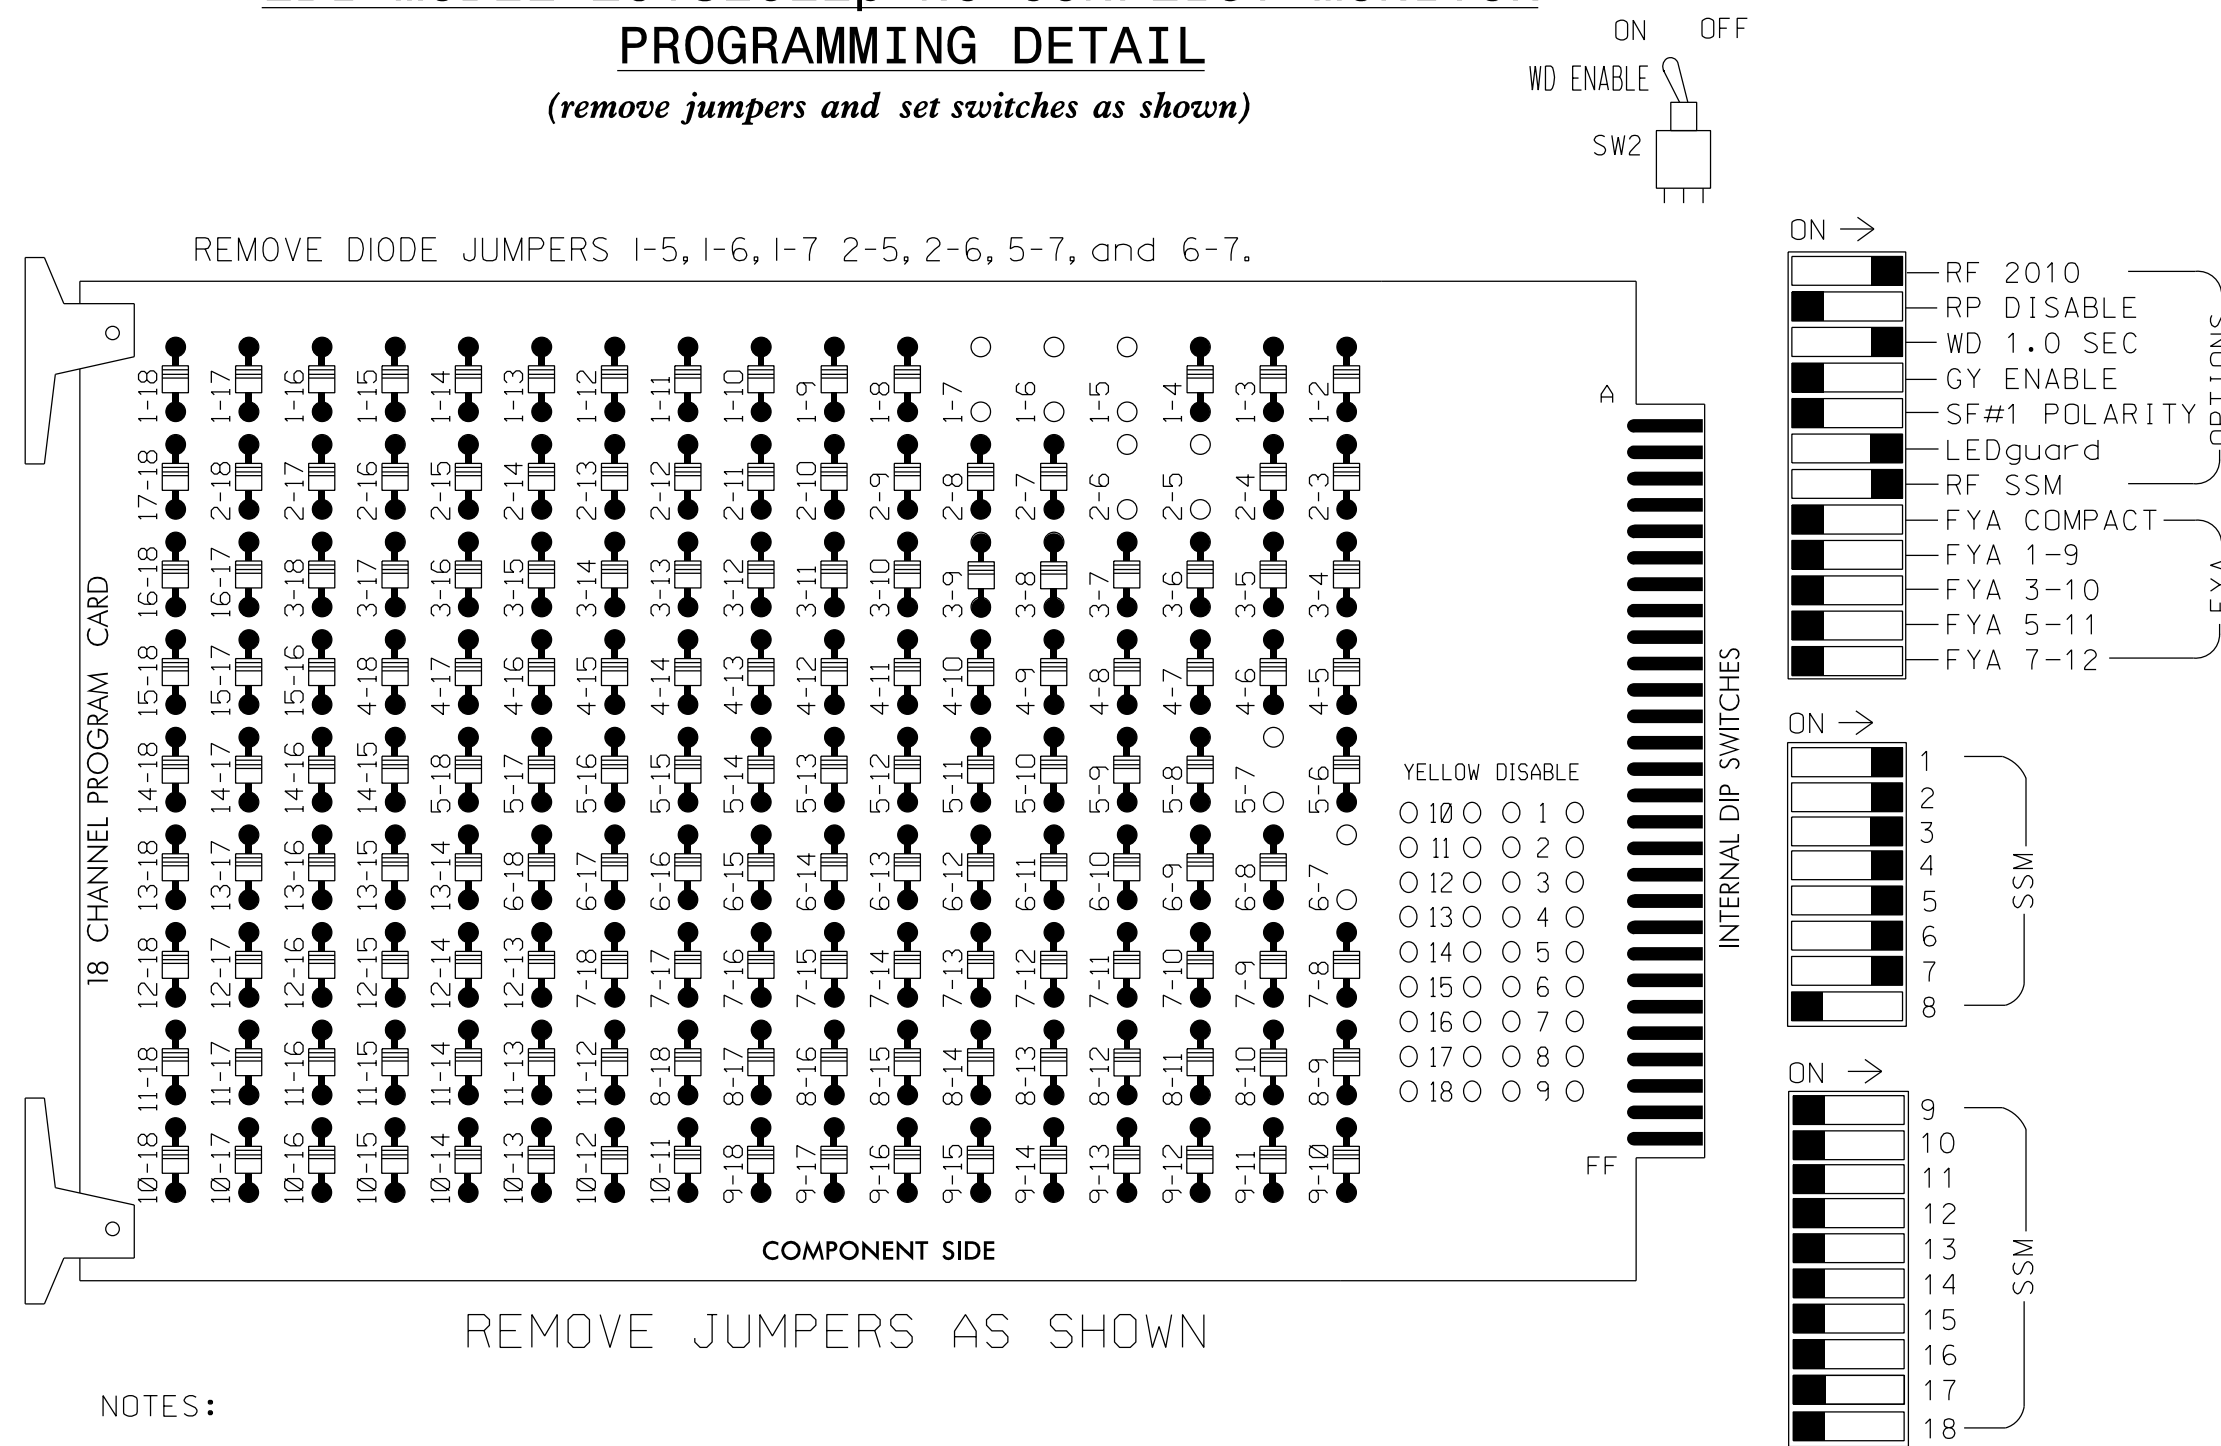

NOTES:

1. Card is provided with all diode jumpers in place. Removal of any jumper allows its channels to run concurrently.
2. Ensure jumpers SEL2-SEL5 and SEL9 are present on the monitor board.
3. Ensure that Red Enable is active at all times during normal operation.
4. Integrate monitor with Ethernet network in cabinet.

NOTES

1. To prevent "flash-conflict" problems, insert red flash program blocks for all unused vehicle load switches in the output file. The installer shall verify that signal heads flash in accordance with the Signal Plans.
2. Enable Simultaneous Gap-Out for all phases.
3. Program phases 2 and 6 for Gap Reduction.
4. Program phases 2 and 6 for Start Up In Green.
5. Program phases 2 and 6 for Yellow Flash.
6. The cabinet and controller are part of the Rocky Mount Signal System.

EQUIPMENT INFORMATION

CONTROLLER.....2070E
 CABINET.....336
 SOFTWARE.....ECONOLITE OASIS
 CABINET MOUNT.....POLE
 OUTPUT FILE POSITIONS...12
 LOAD SWITCHES USED.....S1,S2,S4,S5,S7,S8,S10
 PHASES USED.....1,2,3,4,5,6
 OVERLAP "A".....1
 OVERLAP "B".....NOT USED
 OVERLAP "C".....NOT USED
 OVERLAP "D".....NOT USED

PROJECT REFERENCE NO.	SHEET NO.
U-3330	Sig. 7.7

SIGNAL HEAD HOOK-UP CHART

LOAD SWITCH NO.	S1	S2	S3	S4	S5	S6	S7	S8	S9	S10	S11	S12			
CMU CHANNEL NO.	1	2	13	3	4	14	5	6	15	7	8	16			
PHASE	1	2	2 PED	3	4	4 PED	5	6	6 PED	OVLA 7	8	8 PED			
SIGNAL HEAD NO.	11	21,22	NU	31	32	41	42	62	NU	51	61,62	NU	32	NU	NU
RED		128		116	116	101	101				134		*		
YELLOW		129		117	117	102	102				135				
GREEN		130		118	118	103	103				136				
RED ARROW	125										131				
YELLOW ARROW	126							102		132			123		
GREEN ARROW	127			118		103		103		133			124		


NU = Not Used
 * Denotes install load resistor. See load resistor installation detail this sheet.

SPECIAL DETECTOR NOTE

Install a video detection system for vehicle detection. Perform installation according to manufacturer's directions and NCDOT engineer-approved mounting locations to accomplish the detection schemes shown on the Signal Design Plans.


INPUT FILE POSITION LAYOUT

(front view)

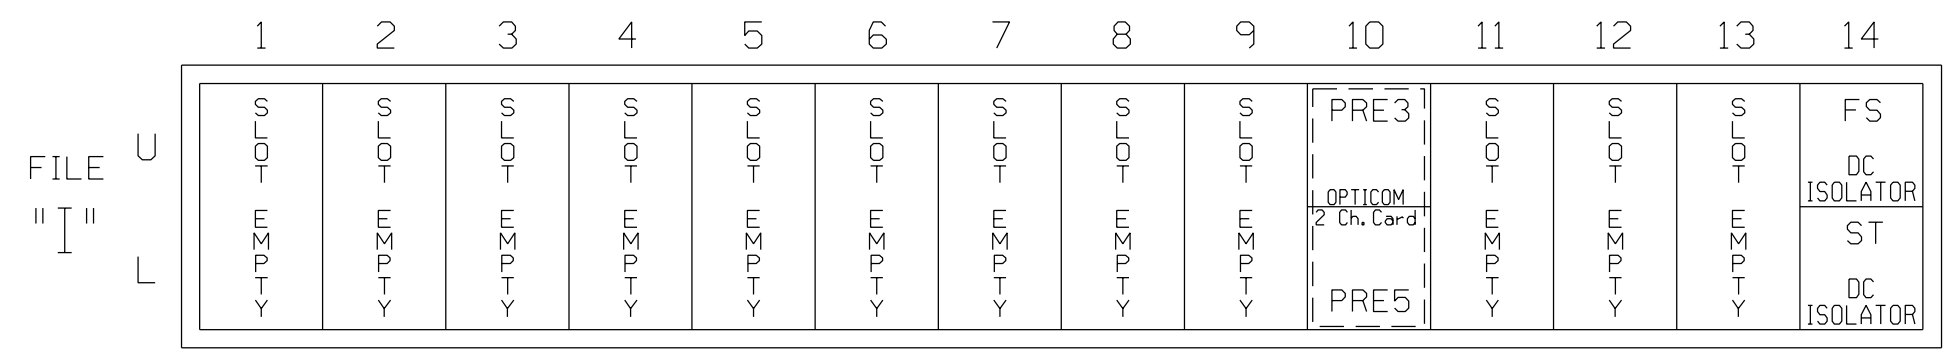

EX.: 1A, 2A, ETC. = LOOP NO.'S

INPUT FILE POSITION LEGEND: J2L

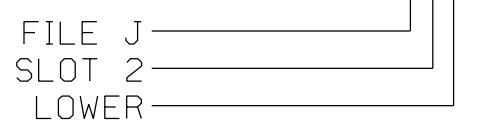

OVERLAP PROGRAMMING DETAIL

(program controller as shown below)

FROM MAIN MENU PRESS '8' (OVERLAPS), THEN '1' (VEHICLE OVERLAP SETTINGS).


```

PAGE 1: VEHICLE OVERLAP 'A' SETTINGS
PHASE:          |12345678910111213141516
VEH OVL PARENTS:|X
VEH OVL NOT VEH:|
VEH OVL NOT PED:|
VEH OVL GRN EXT:|
STARTUP COLOR:  | _ RED _ YELLOW _ GREEN
FLASH COLORS:   | _ RED _ YELLOW _ GREEN
SELECT VEHICLE OVERLAP OPTIONS: (Y/N)
FLASH YELLOW IN CONTROLLER FLASH?...N
GREEN EXTENSION (0-255 SEC)...0
YELLOW CLEAR (0=PARENT,3-25.5 SEC)...0.0
RED CLEAR (0=PARENT,0.1-25.5 SEC)...0.0
OUTPUT AS PHASE # (0=NONE, 1-16)...7
    
```

OVERLAP PROGRAMMING COMPLETE


LOAD RESISTOR INSTALLATION DETAIL

(install resistors as shown below)

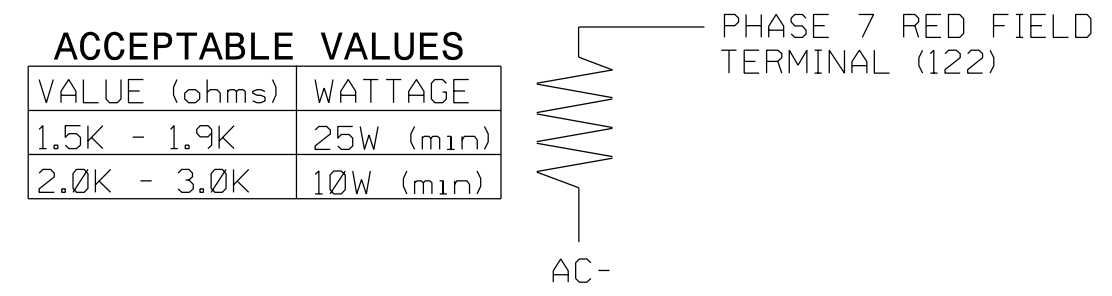

TYPICAL OPTICOM FIELD WIRE DETAIL

(input file, rear view)

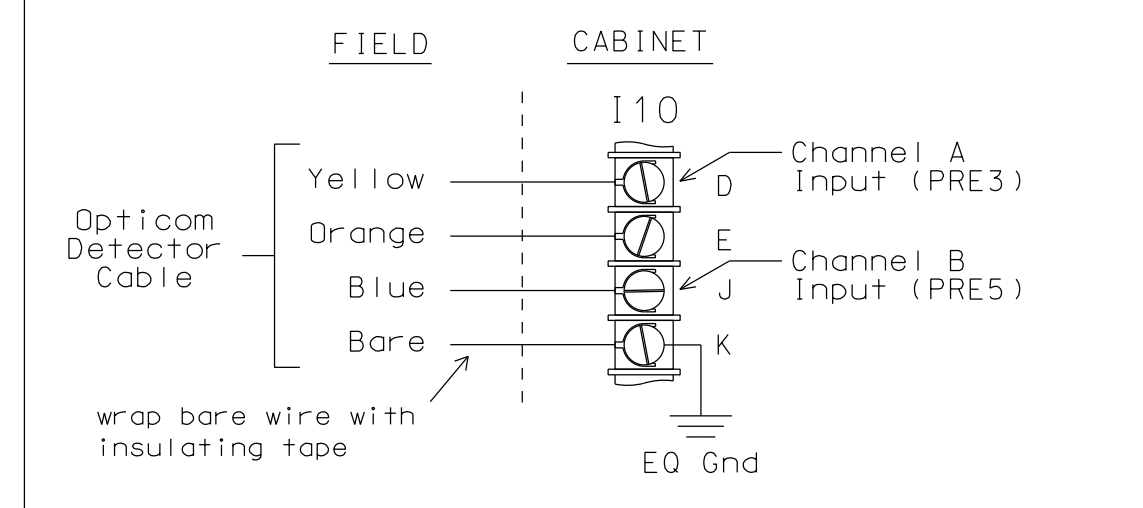

Signal Upgrade - Temporary Design 3 (Electrical Sheet 1 of 2)

ELECTRICAL AND PROGRAMMING DETAILS FOR:		US 301 Byp (N. Wesleyan Blvd) at Lawrence Circle / Tarrytown Mall Entrance	
Prepared for the Offices of: 		SEAL NORTH CAROLINA PROFESSIONAL ENGINEER SEAL 025892 MELISSA B. TOTH	
Division 04	Nash County	Rocky Mount	
PLAN DATE: November 2016	REVIEWED BY: MB Toth		
PREPARED BY: AM Encarnacion	REVIEWED BY:		
REVISIONS	INIT.	DATE	
750 N. Greenfield Pkwy, Garner, NC 27529		Downloaded by: Melissa B. Toth DATE: 1/30/2017 SIG. INVENTORY NO. 04-0169T3	

ATKINS 1616 EAST MILLBROOK ROAD, SUITE 160
 RALEIGH, NORTH CAROLINA 27609
 (919) 876-6888 NCBEEES #F-0326

30-JAN-2017 17:28
 D:\P\onspord\11\onspord\offic\curr\100032135_U-3330_S\signalshd2_S\signalshd2es\gn#01_wir\mpg#04-0169E13.dgn
 ENL45986 - AT L059521