


### INPUT PAGE 2 ASSIGNMENT PROGRAMMING DETAIL FOR ALTERNATE PHASING - LOOP 5A (program controller as shown below)


- NOTES: 1. THIS PROGRAMMING APPLIES FOR INPUT PAGE 2 ONLY. INPUT PAGE 1 WILL USE STANDARD DEFAULT SETTINGS. THIS PROGRAMMING IS NECESSARY FOR PROPER DETECTOR OPERATION DURING ALTERNATE PHASING OPERATION.
2. THE FIRST TASK THIS PROGRAMMING ACCOMPLISHES IS THE DISABLING OF INPUT #9 (DETECTOR 22) SO THAT A VEHICLE CALL WILL NOT BE PLACED TO PHASE 2 DURING ALTERNATE PHASING OPERATION. THE SECOND TASK THIS PROGRAMMING ACCOMPLISHES IS THAT IT REASSIGNS DETECTOR 55 TO INPUT #17 SO THAT THE DELAY ON LOOP 5A CAN BE REDUCED FROM 15 SECONDS TO 0 SECONDS.

FROM MAIN MENU PRESS '5' (INPUTS), THEN PRESS 'NEXT' TO GET TO INPUT PAGE '2'. PRESS THE '+' KEY UNTIL INPUT 9 IS REACHED.

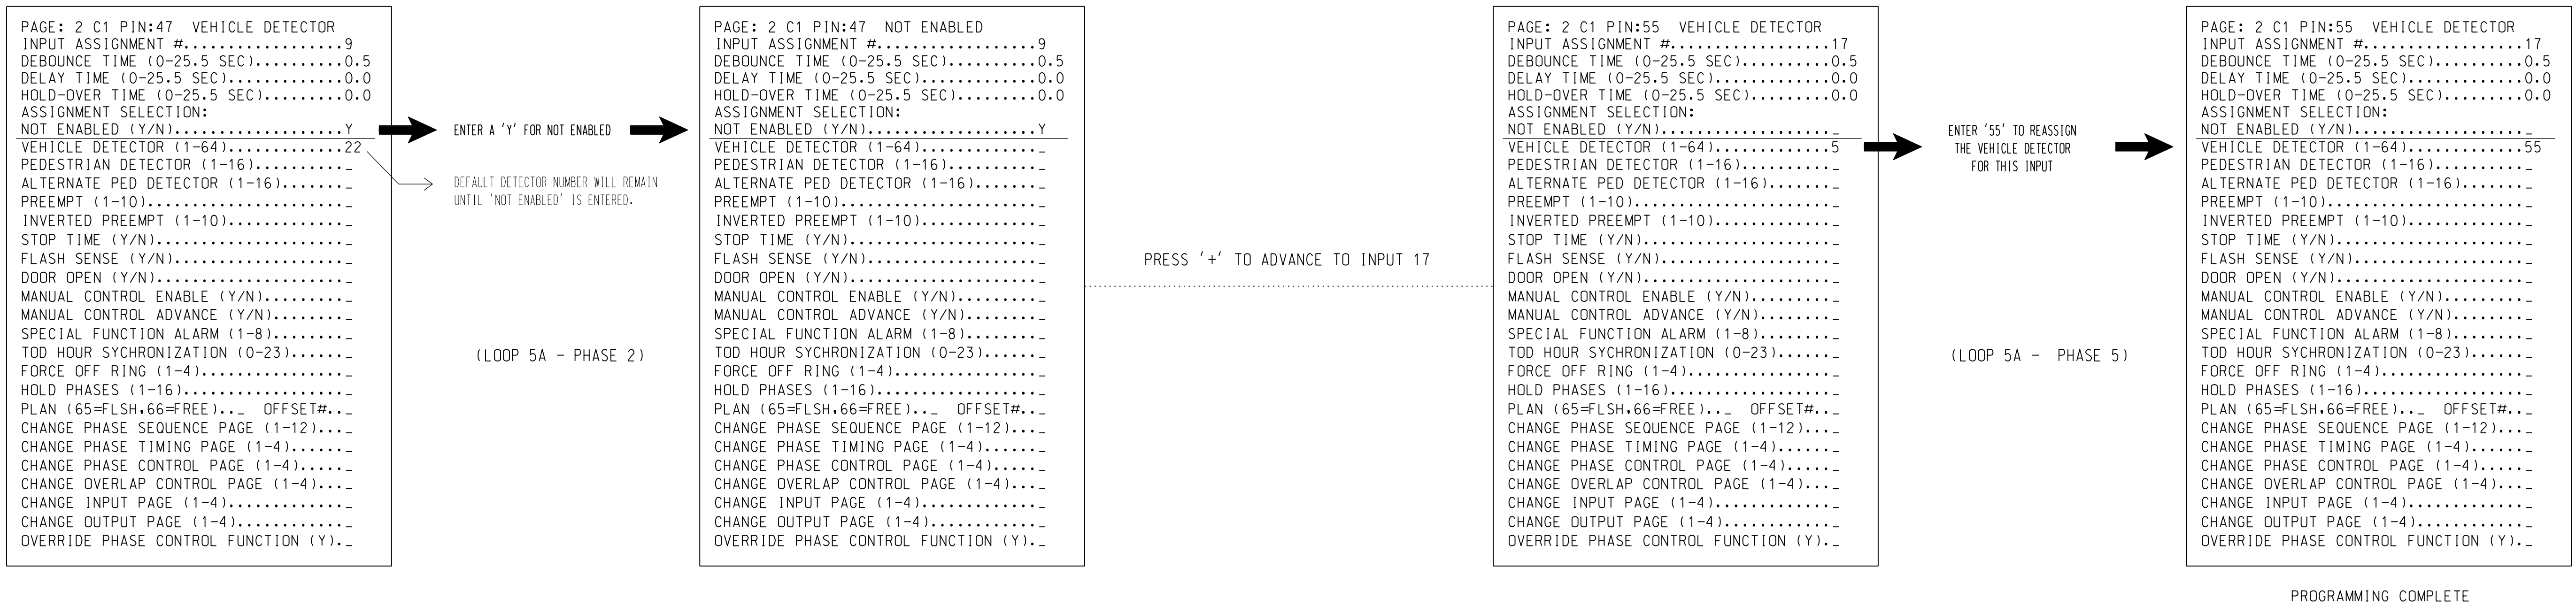

### SPECIAL DETECTOR PROGRAMMING DETAIL - LOOP 5A (ALT.) (program controller as shown below)

FROM MAIN MENU PRESS '7' (DETECTORS), THEN PRESS '1' FOR VEHICLE DETECTORS. PRESS THE '-' KEY TO GET TO VEHICLE DETECTOR #55.

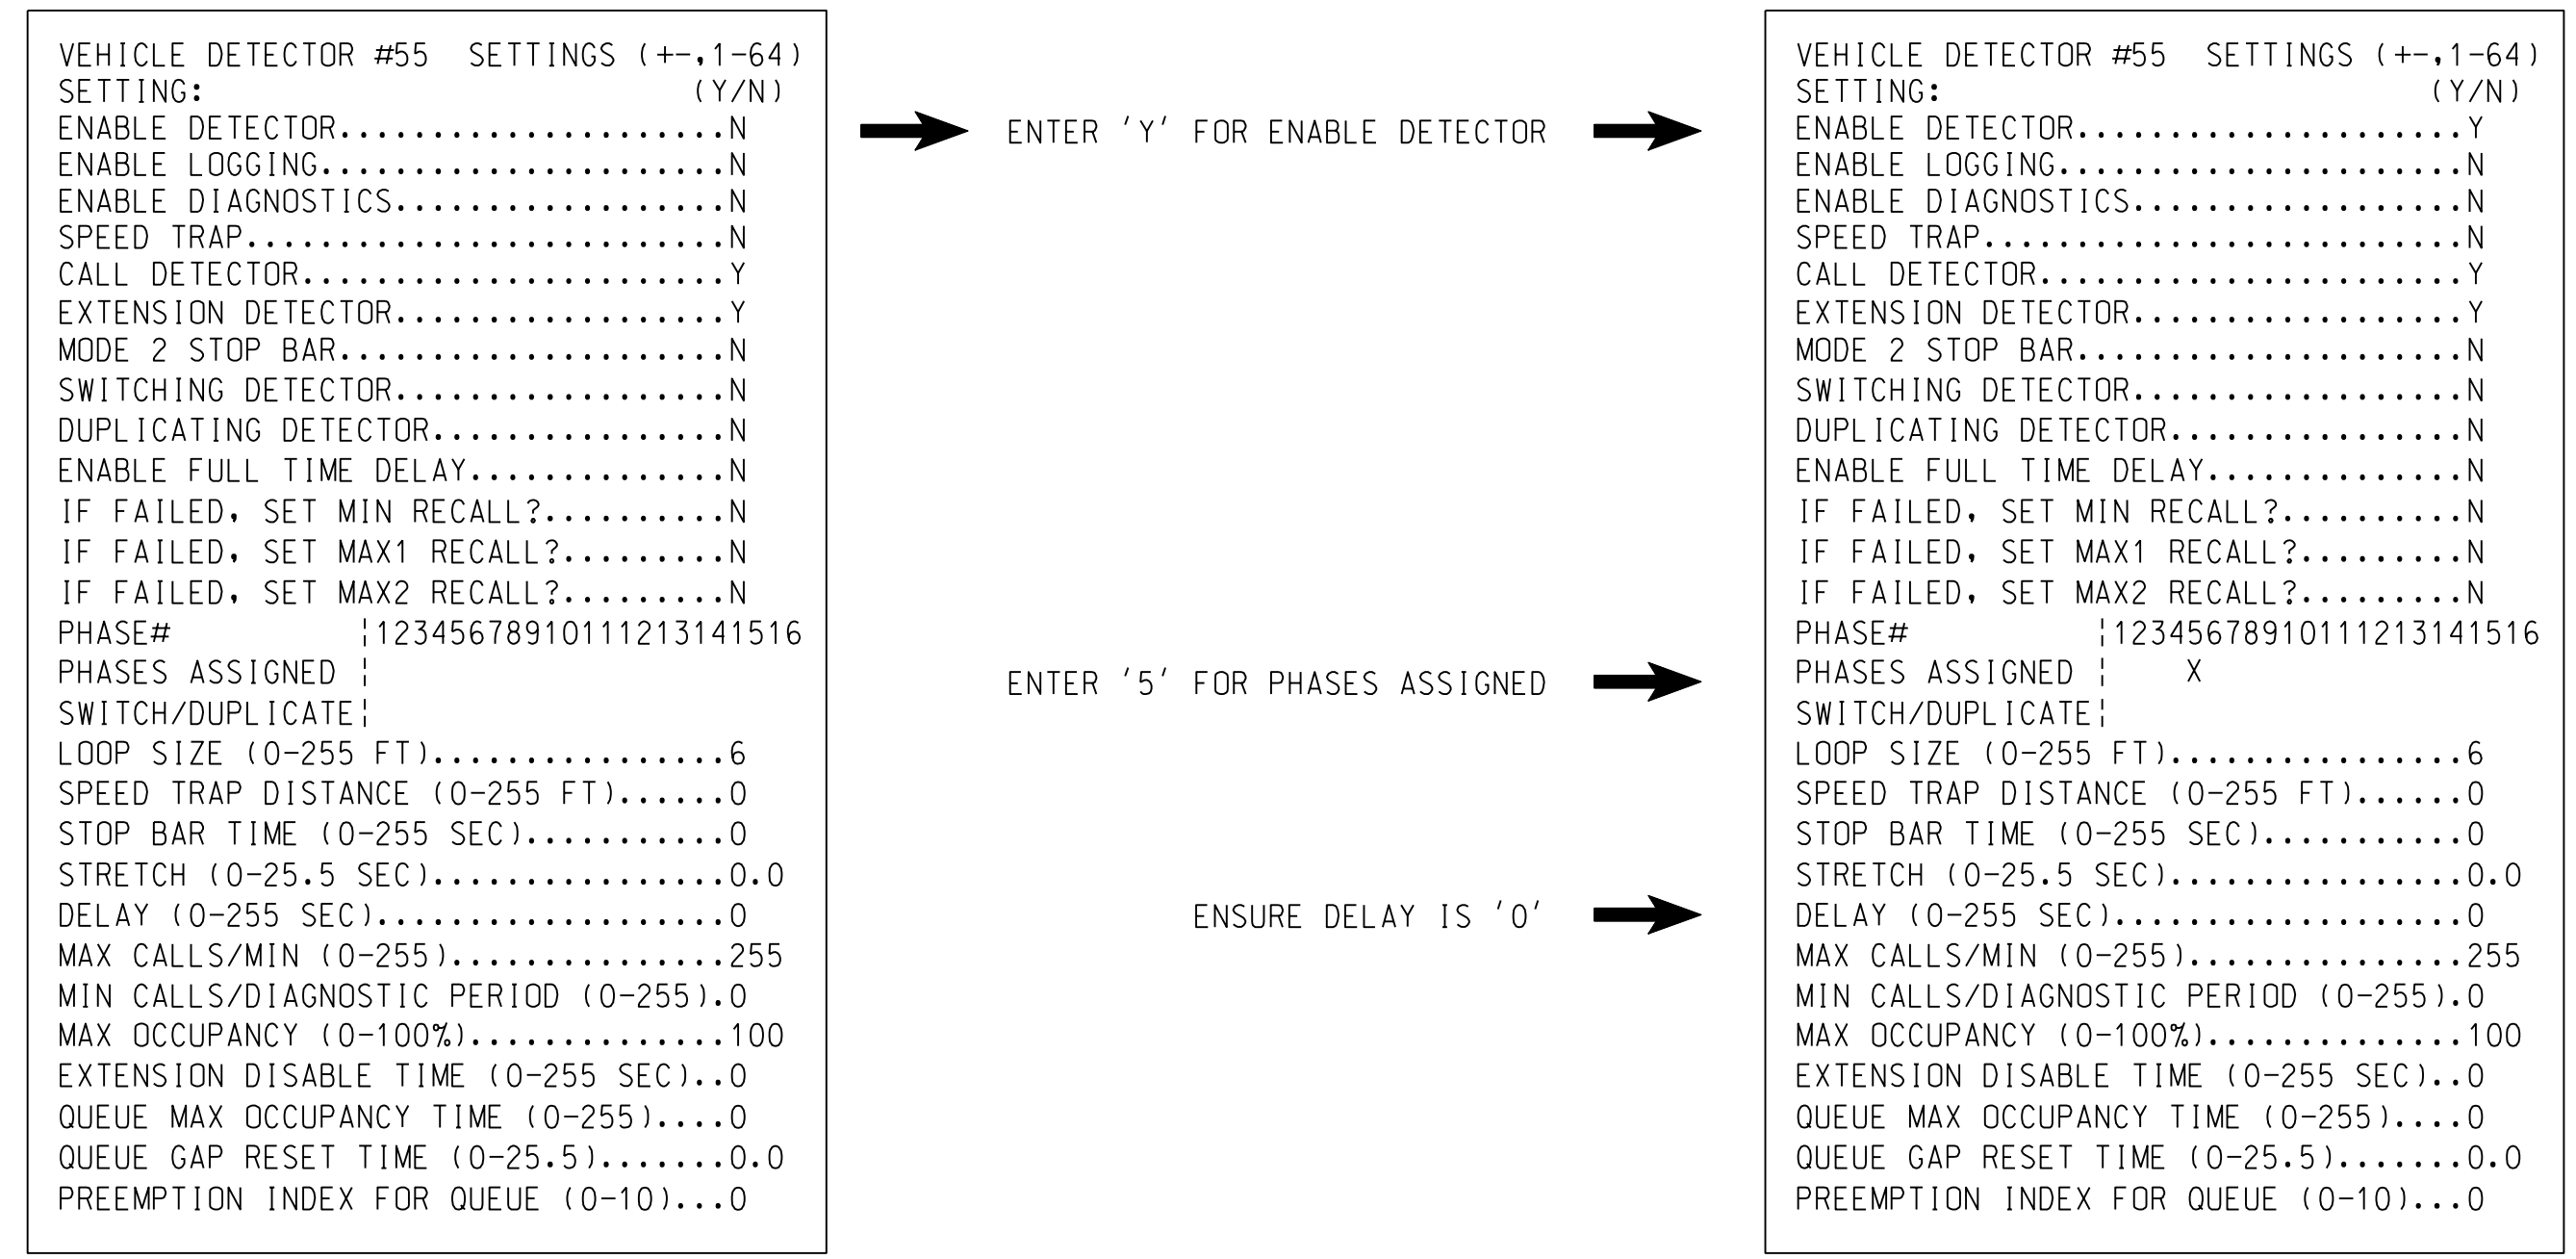

NOTE: DETECTOR IS PROGRAMMED PER THE INPUT FILE CONNECTION AND PROGRAMMING CHART SHOWN ON SHEET 1.

THIS ELECTRICAL DETAIL IS FOR THE SIGNAL DESIGN: 04-0308  
DESIGNED: July 2017  
SEALED: 08/04/2017  
REVISED: N/A

04-AUG-2017 11:02 X:\PFD\fact\m15\_301\T1\off\csl\gms\gms\gms\gms\SIG-08.dgn KMC07 AT NDR\W\CORY

Electrical Detail - Sheet 5 of 7 - Signal Upgrade

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED

**Michael Baker INTERNATIONAL**  
8000 Regency Parkway, Suite 600  
Cary, North Carolina 27518  
Phone: 919-463-5488  
NC License No.: F-1084  
MBAKERINTL.COM

Prepared in the Offices of:

750 N. Greenfield Pkwy, Garner, NC 27529

NC 42/NC 58 (Ward Boulevard)  
at  
NC 42/SR 1163 (Herring Avenue)

Division 4      Wilson County      Wilson

PLAN DATE: July 2017      REVIEWED BY: W M RuhSAM

PREPARED BY: K M Cory      REVIEWED BY:

REVISIONS	INIT.	DATE

DocuSigned by:  
*Kelly M Cory*      8/4/2017

SIG. INVENTORY NO. 04-0308