
NOTE: OVERHANG DIAPHRAGMS TO BE REMOVED AND REPLACED, ARE SHOWN ON "PLAN OF SPAN" SHEETS.


OVERHANG DIAPHRAGMS SHALL BE REMOVED PRIOR TO CLEANING AND PAINTING OF BEAMS AND REPLACED AFTER BEAM REPAIRS AND PAINTING ARE COMPLETE.





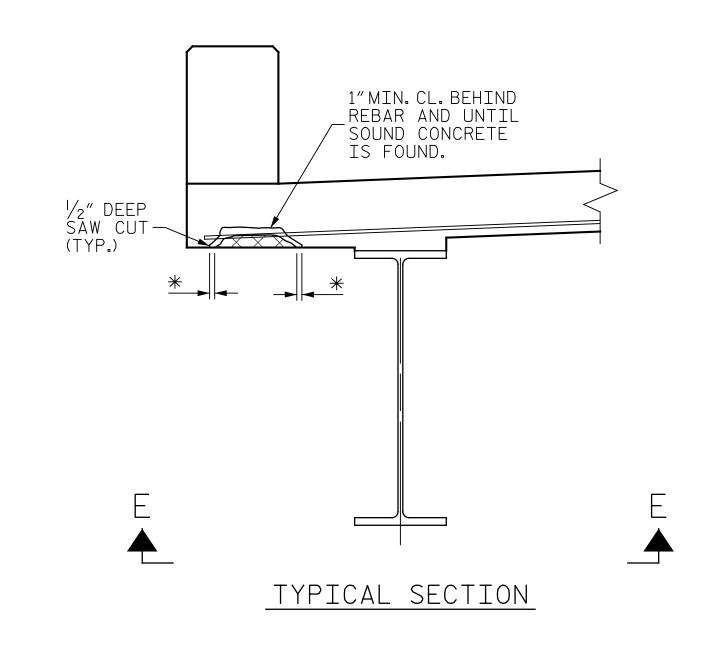


\* REMOVE CONCRETE UNTIL SOUND CONCRETE IS FOUND (1"MIN. DEPTH)

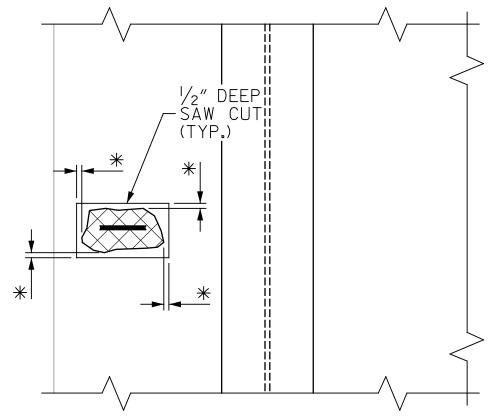


SECTION E-E


OVERHANG DETAILS

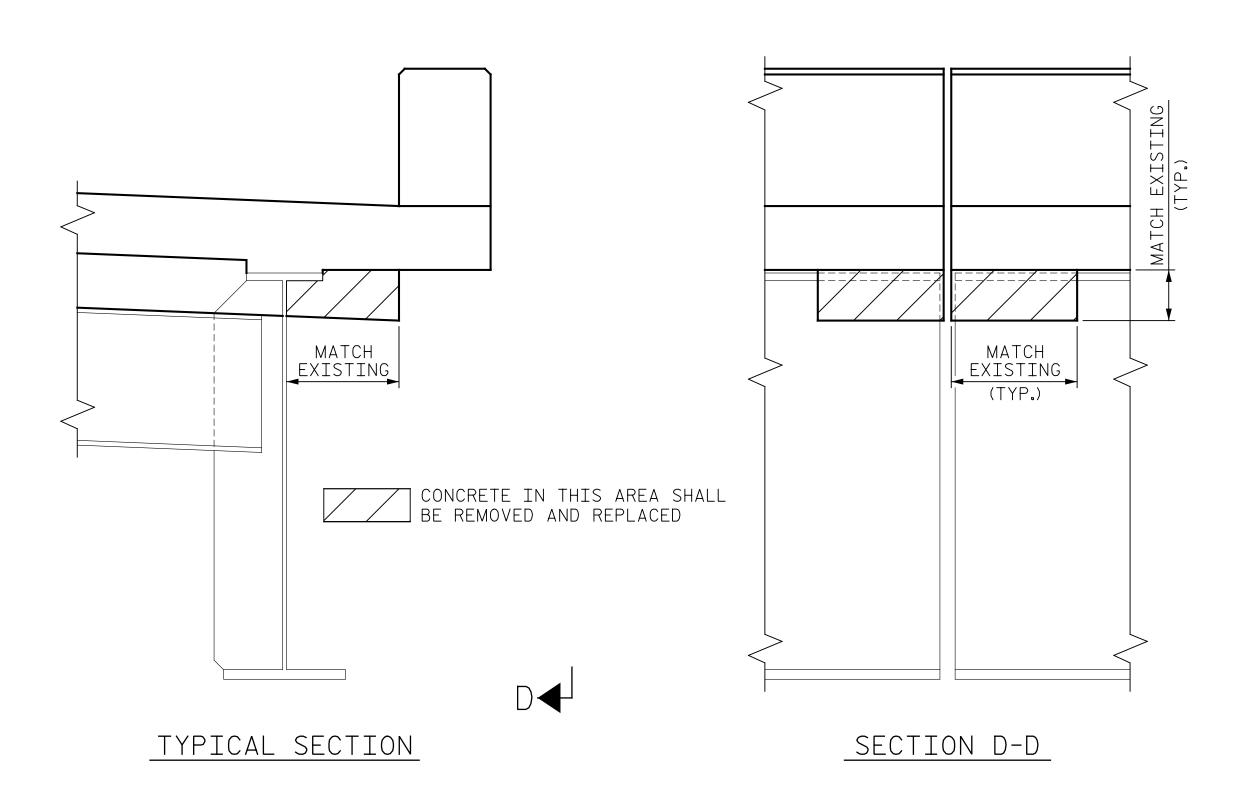

OVERHANG DIAPHRAGM REPLACEMENT DETAILS

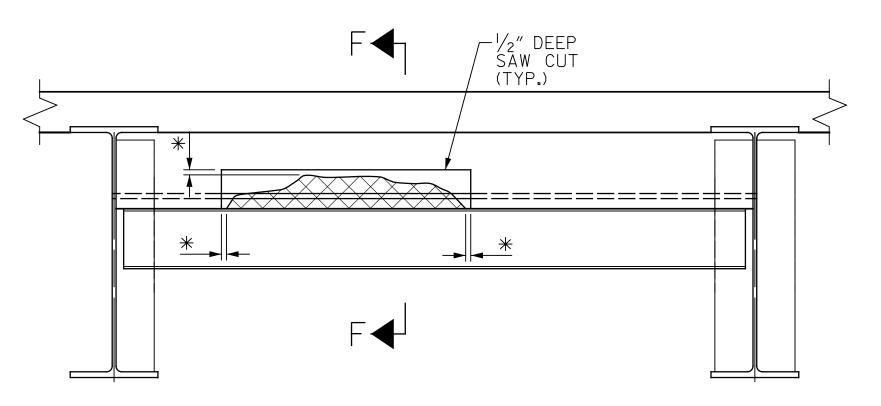

## TYPICAL SECTION

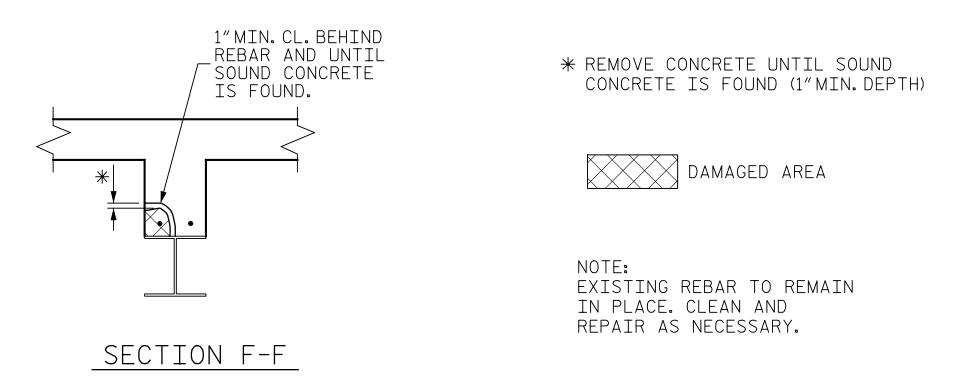

## INTERIOR DIAPHRAGM REPAIR DETAILS

PROJECT NO. I-5889A BUNCOMBE COUNTY

BRIDGE NO. 334, 339, 344, 347, 352, 356, 358, 366, 369, 374, 377, 378

DEPARTMENT OF TRANSPORTATION RALEIGH SEAL 020208

OVERHANG & DIAPHRAGM REPAIR DETAILS

STATE OF NORTH CAROLINA



	DAGULENT NAT CONCERNE	NO.	_
1/3	DOCUMENT NOT CONSIDERED FINAL UNLESS ALL	21	ſ
	FINAL UNLESS ALL	ן די	L
	SIGNATURES COMPLETED	2	

DocuSigned by:

Eir BML J 11/20/2017

BA9F91762D7044A...

	SHEET NO.						
BY:	DATE:	NO.	BY:	DATE:	S-206		
		3			TOTAL SHEETS		
		4			208		



\_\_ DATE : <u>10/17</u> \_\_ DATE : <u>10/17</u> J.BOYER R.NELSON DRAWN BY : \_\_\_\_