



**Strain Pole Attachments**

**NOTE:**

1. Strap all signal cables to the side of the pole with 3/4" stainless steel straps when the distance between the spanwire attachment clamp and the weatherheads exceeds 3'-0".
2. Provide minimum two spanwire pole clamps per pole.
3. It is prohibited to attach two span wires at one pole clamp.
4. For general requirements refer to NCDOT Standard Specifications for Roadway and Structures, January 2018.

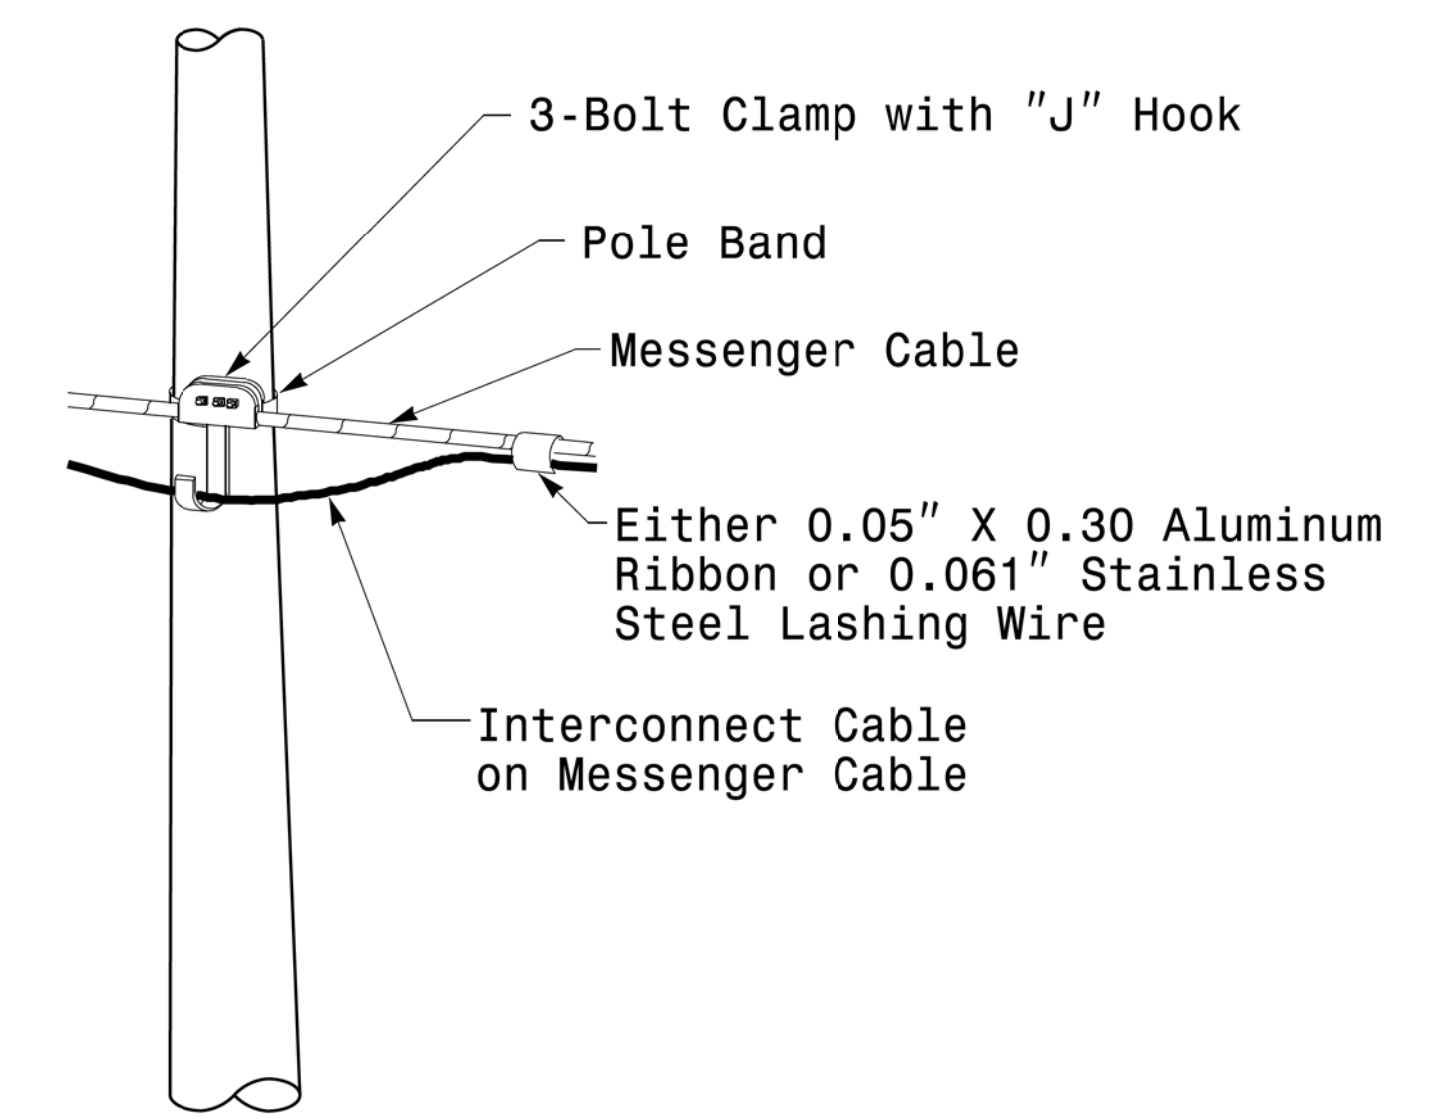

**Attachment of Cable to Intermediate Metal Pole**

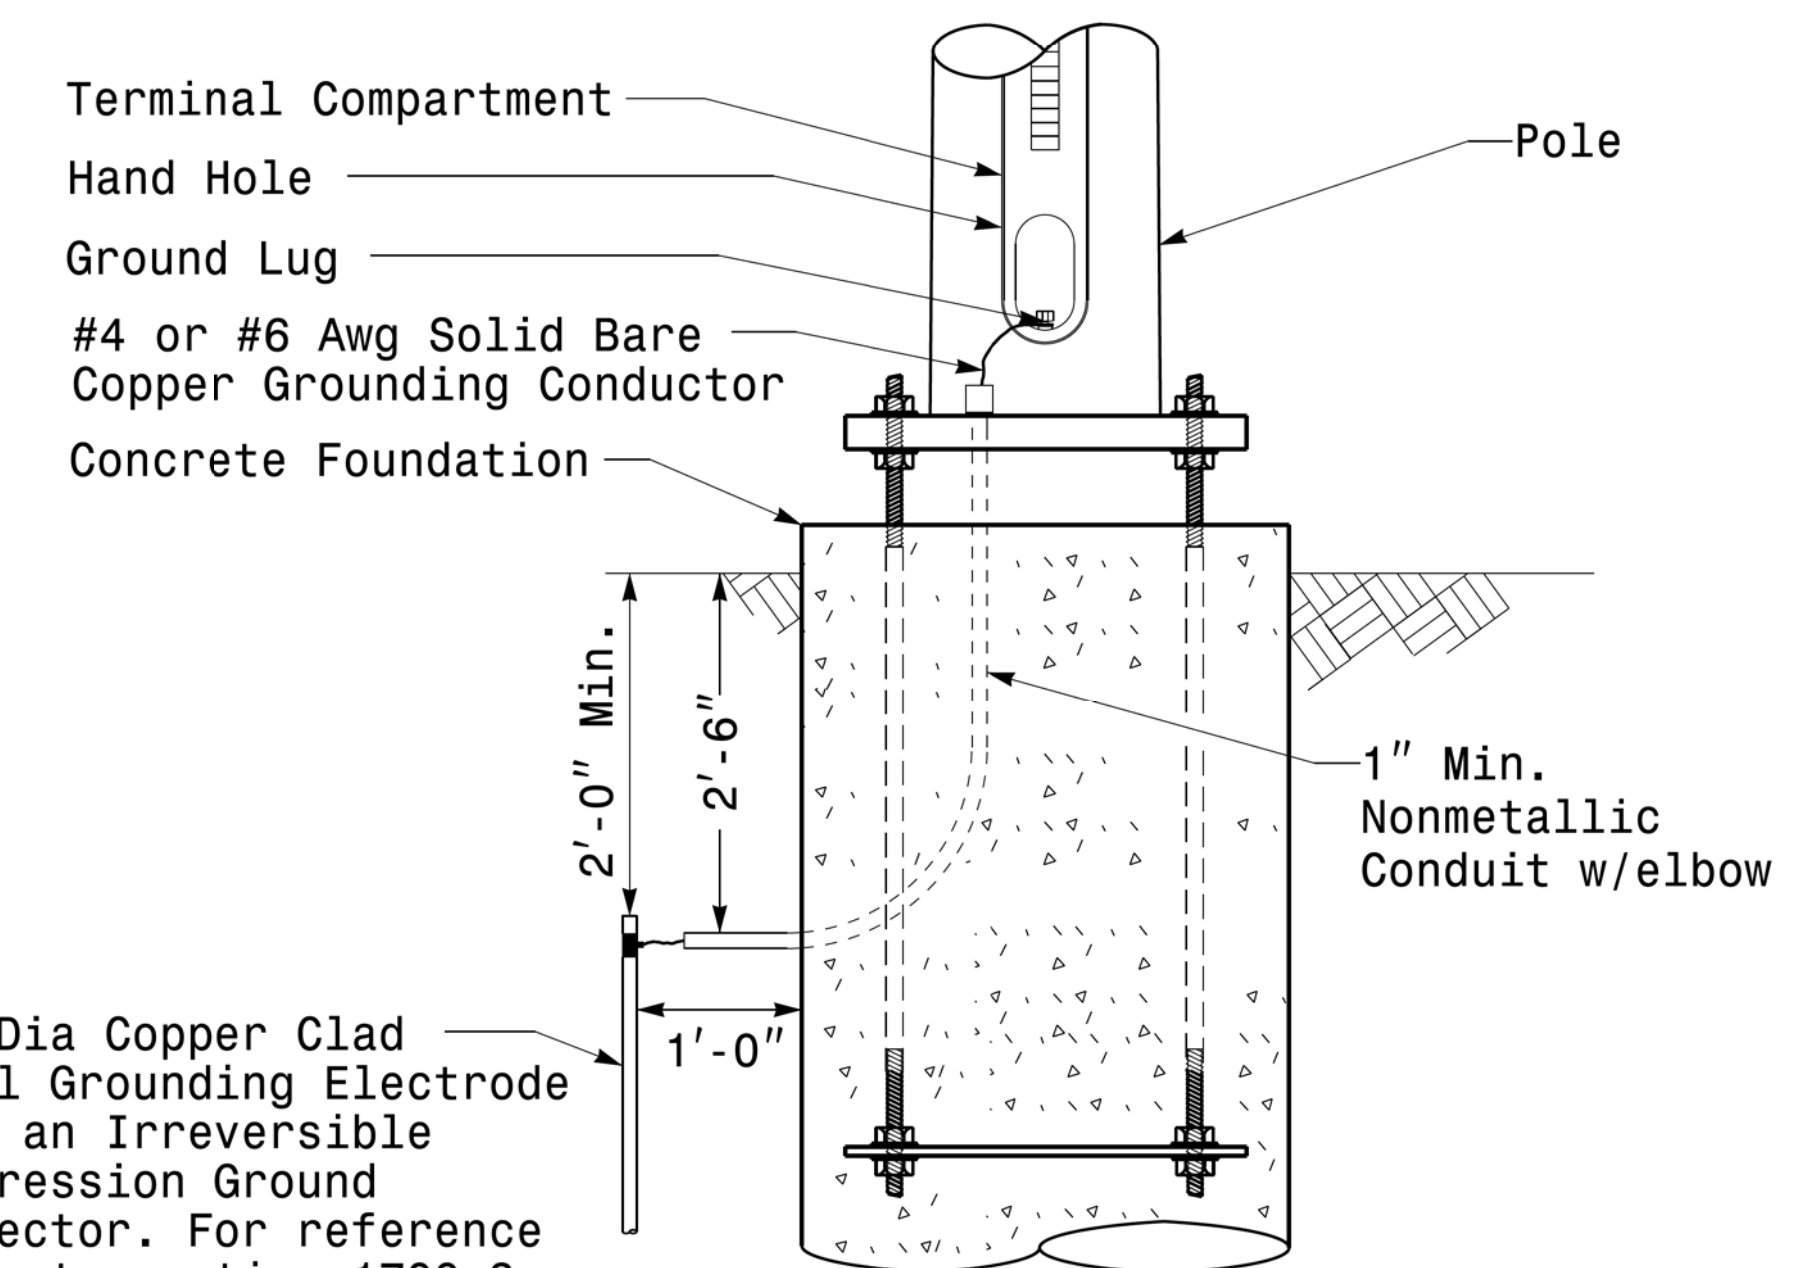

5/8" Dia Copper Clad Steel Grounding Electrode with an Irreversible Compression Ground Connector. For reference refer to section 1700-3 K and L for electrical grounding and bonding requirements, See Note 4.

**Metal Pole Grounding Detail For Strain Pole and Mast Arm**

Prepared in the Offices of:

750 N. Greenfield Pkwy, Garner, NC 27529

SCALE: 0 NA NONE

Typical Fabrication Details For Strain Pole Attachments	
PLAN DATE: OCTOBER 2017	DESIGNED BY: C.F. ANDREWS
PREPARED BY: N. BITTING	REVIEWED BY: D.C. SARKAR
REVISIONS	INIT. DATE

SEAL

DocuSigned by: D. Sarkar  
DATE: 10/11/2017

11-OCT-2017 08:36 S:\4135\SM\TIS Signal\sig1 Design Section\Eastern Region\m6\Sheets\2016\2014 Sig.M6 Std. Fabrication Detail Is-Strain Poles.dgn