


AS-BUILT REPAIR QUANTITY TABLE

	QUANTITIES			
	ESTIMATE		ACTUAL	
SHOTCRETE REPAIRS	AREA SQ. FT.	VOLUME CU. FT.	AREA SQ. FT.	VOLUME CU. FT.
UPSTREAM FACE	87.5	43.8		
CONCRETE REPAIRS	VOLUME CU. FT.		VOLUME CU. FT.	
UPSTREAM FACE	0.0			
EPOXY RESIN INJECTION	LIN. FT.		LIN. FT.	
UPSTREAM FACE	20.0			

NOTES

- VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MINIMUM OF 1" BEHIND REBAR AND MINIMUM 2" CLEARANCE TO SAWCUT. FOR REPAIR DETAILS, SEE "TYPICAL REPAIR DETAILS" SHEET
- REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.
- CONCRETE REPAIRS MAY BE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.
- SEE SHEET S-22 FOR CONCRETE REPAIR DETAILS.

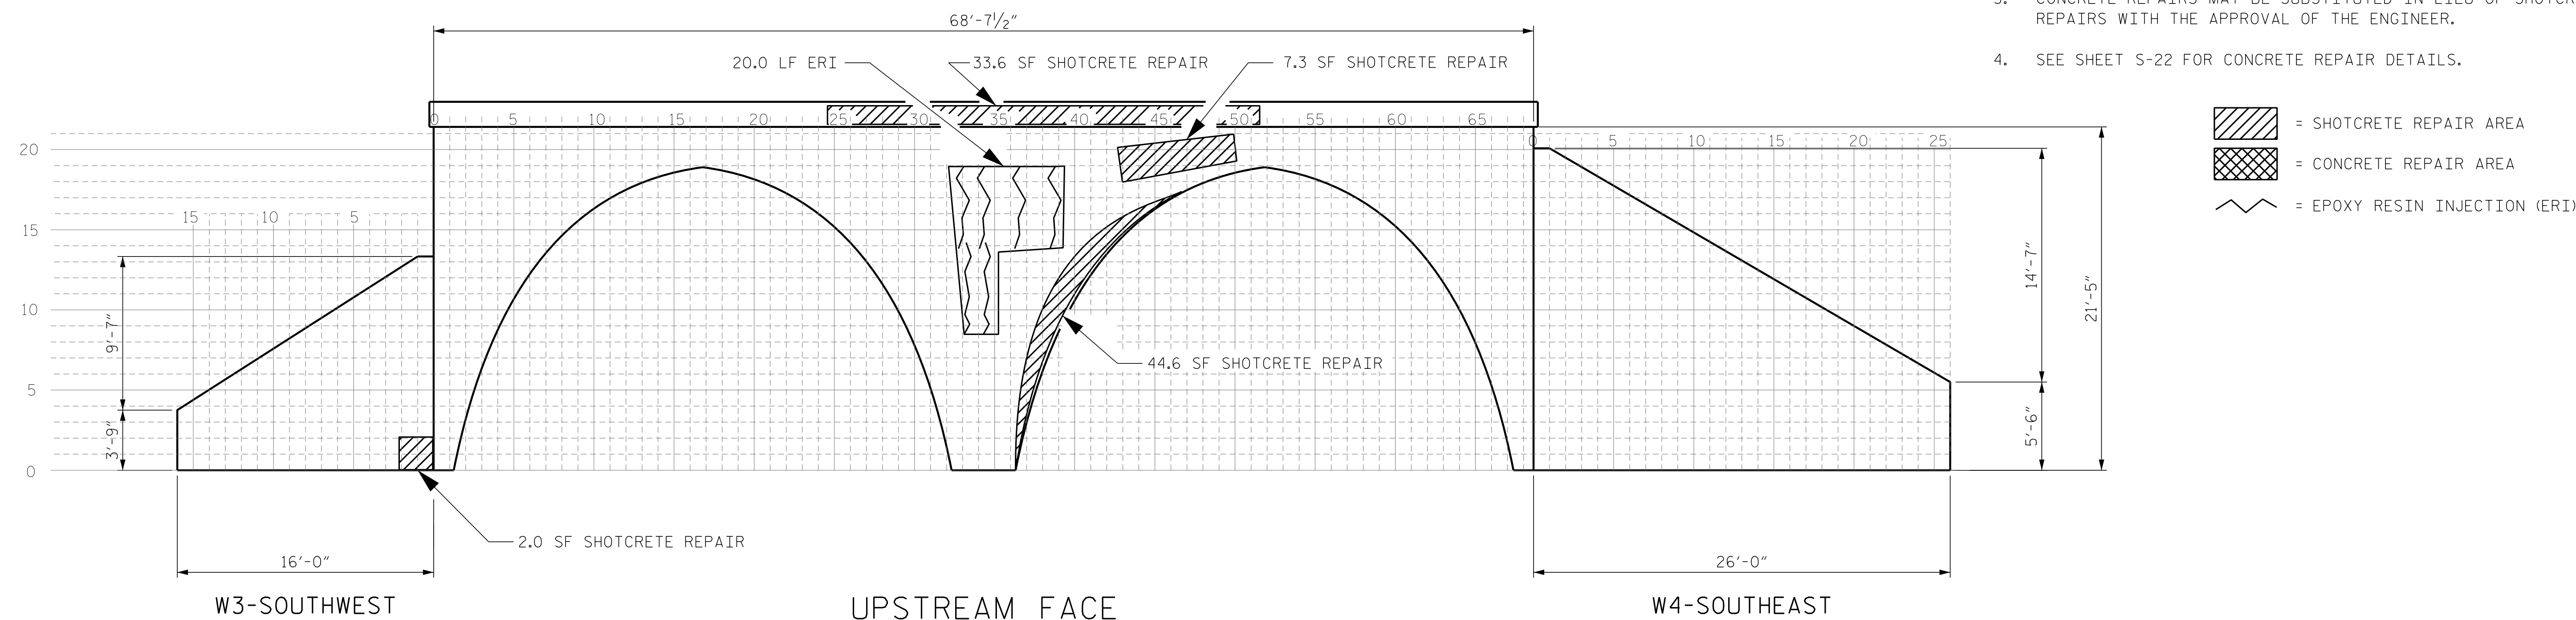

- = SHOTCRETE REPAIR AREA
- = CONCRETE REPAIR AREA
- = EPOXY RESIN INJECTION (ERI)

PROJECT NO. 15BPR.32

 AVERY COUNTY

STRUCTURE: 050002

SHEET 5 OF 6

P:\2018\18153.22_15BPR.32_MCDOT_Culvert_Preservation\DWG\AVERY_050002\Avery 2_CULVERT_PLA.dgn
 12/12/2018 1:57:51 PM

DRAWN BY : A. KLINK DATE : 07/18
 CHECKED BY : T. KOCH DATE : 08/18

DOCUMENT NOT CONSIDERED FINAL
UNLESS ALL SIGNATURES COMPLETED

ENGINEER OF RECORD
12/12/2018

THOMAS K. KOCH
ENGINEER
15431

WETHERILL ENGINEERING

1223 Jones Franklin Rd.
Raleigh, N.C. 27606
Bus: 919 851 8077
Fax: 919 851 8107
LICENSE NO. F-0377

STATE OF NORTH CAROLINA
DEPARTMENT OF TRANSPORTATION
RALEIGH

UPSTREAM HEADWALL AND WINGS

REVISIONS

NO.	BY:	DATE:	NO.	BY:	DATE:	SHEET NO.
1			3			TOTAL SHEETS
2			4			23