

+

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE, IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE INSPECTOR OR ENGINEER THE CONTRACTOR SHALL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE REPAIR QUANTITY TABLE.

CONTRACTOR SHALL SAW CUT TO A MINIMUM OF $\frac{1}{2}$ " BUT REINFORCING STEEL SHALL NOT BE DAMAGED.

CONTRACTOR SHALL REMOVE SURFACE CONCRETE TO VERIFY THAT SAWCUT DEPTH WILL NOT DAMAGE EXISTING REINFORCING STEEL.

CONCRETE REPAIRS MAY BE USED IN LIEU OF SHOTCRETE REPAIRS. WITH THE APPROVAL OF THE ENGINEER.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.


FOR CAP AND PILE REPAIR DETAILS, SEE ``TYPICAL CAP AND PILE REPAIR DETAILS' SHEET S-56.

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MIN. OF 1" BEHIND REBAR AND MIN. 2" CLEAR TO SAWCUT, SEE REPAIR DETAILS.


FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

FOR GALVANIC CATHODIC PROTECTION INTEGRAL PILE JACKET, SEE SPECIAL PROVISIONS.


FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.

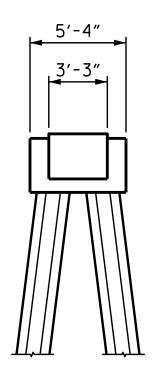

END VIEW SOUTH SIDE

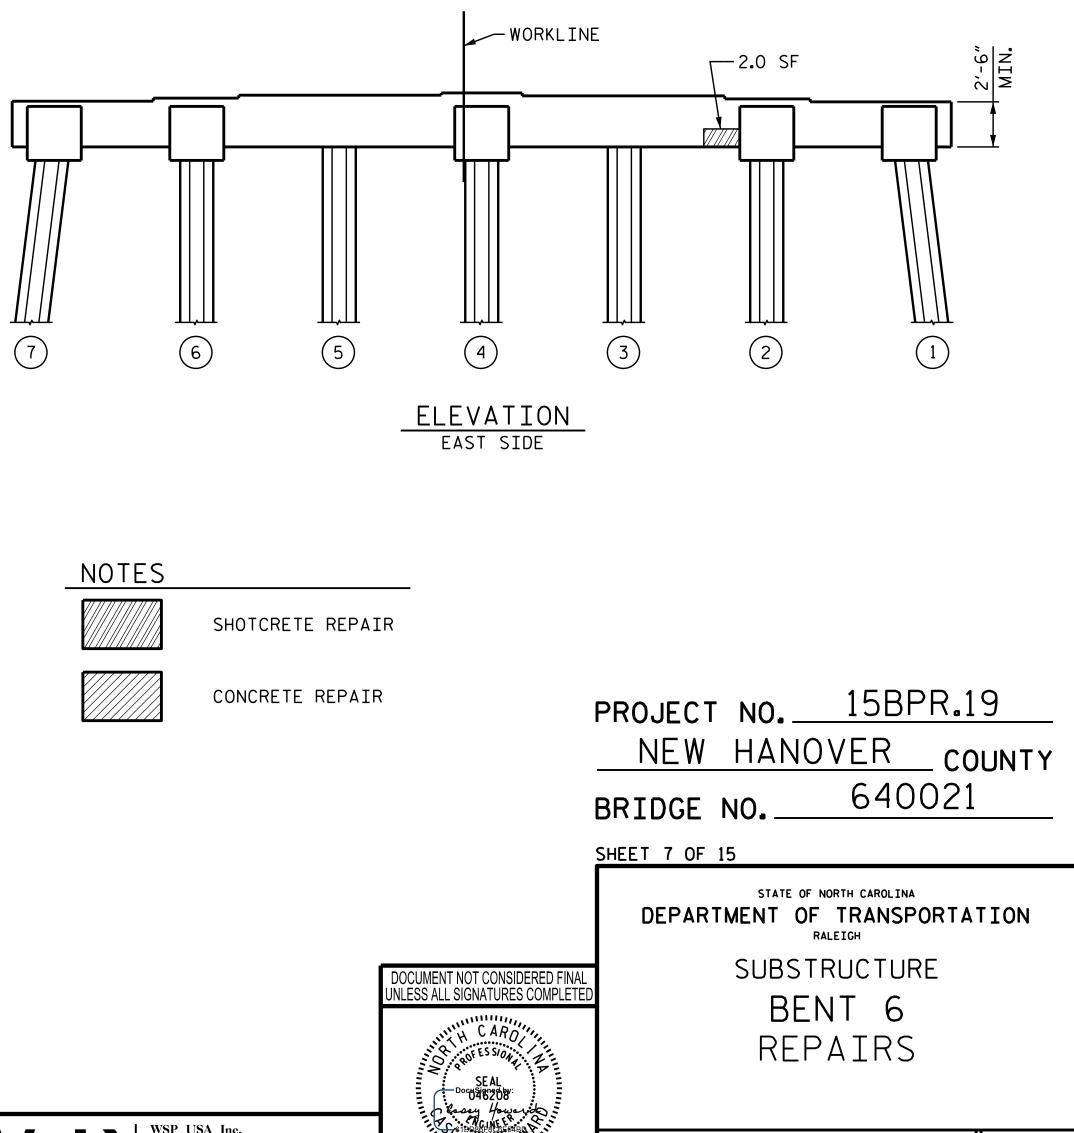

10/19/2020

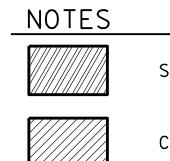



REPAIR QUAN	NTITY	΄ ΤΑΒ	LE			
BENT 6	QUANTITIES					
DEINI O	ESTI	ΜΑΤΕ	ACTUAL			
SHOTCRETE REPAIRS	AREA SF	VOLUME CF	AREA SF	VOLUME CF		
CAP (VERICAL FACE)	4.5	1.5				
CAP (HORIZONTAL FACE)						
22" OCT. PREST. CONC. PILES						
CONCRETE REPAIRS						
EPOXY COATING	AREA SF		AREA SF			
TOP OF CAP *	201.0					
PILE JACKET	LENGTH LENG LN.FT. LN.F					
PILE NUMBERS :						

* EPOXY COATING QUANTITY INCLUDES TOP OF PILE CAPS

REVISIONS				SHEET N		
NO.	BY:	DATE:	NO.	BY:	DATE:	S-38
1			3			TOTAL SHEETS
2			4			58