REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE AS-BUILT REPAIR QUANITITY TABLE.


PAYMENT FOR CLASS II SURFACE PREPARATION IS BASED UPON SQUARE YARDS OF ADDITIONAL DEMOLITION REQUIRED FOLLOWING SCARIFICATION OF BRIDGE DECK. SEE "OVERLAY SURFACE PREPARATION" SPECIAL PROVISION.

FOR EPOXY PROTECTIVE COATING, SEE SPECIAL PROVISIONS.

SUMMARY OF QUANTITIES FOR SPAN "L"			
	ESTIMATE	ACTUAL	
SCARIFYING BRIDGE DECK	155.0 SY		
CLASS II SURFACE PREPARATION	1.9 SY		
CONCRETE DECK REPAIR FOR PC OVERLAY	1.9 SY		
SHOTBLASTING BRIDGE DECK	155.0 SY		
PC MATERIALS	4.8 CY		
PLACING AND FINISHING PC OVERLAY	155.0 SY		
GROOVING BRIDGE FLOORS	1261 SF		
TOP OF CAP EPOXY COATINGS			

END BENT 2

93 SF

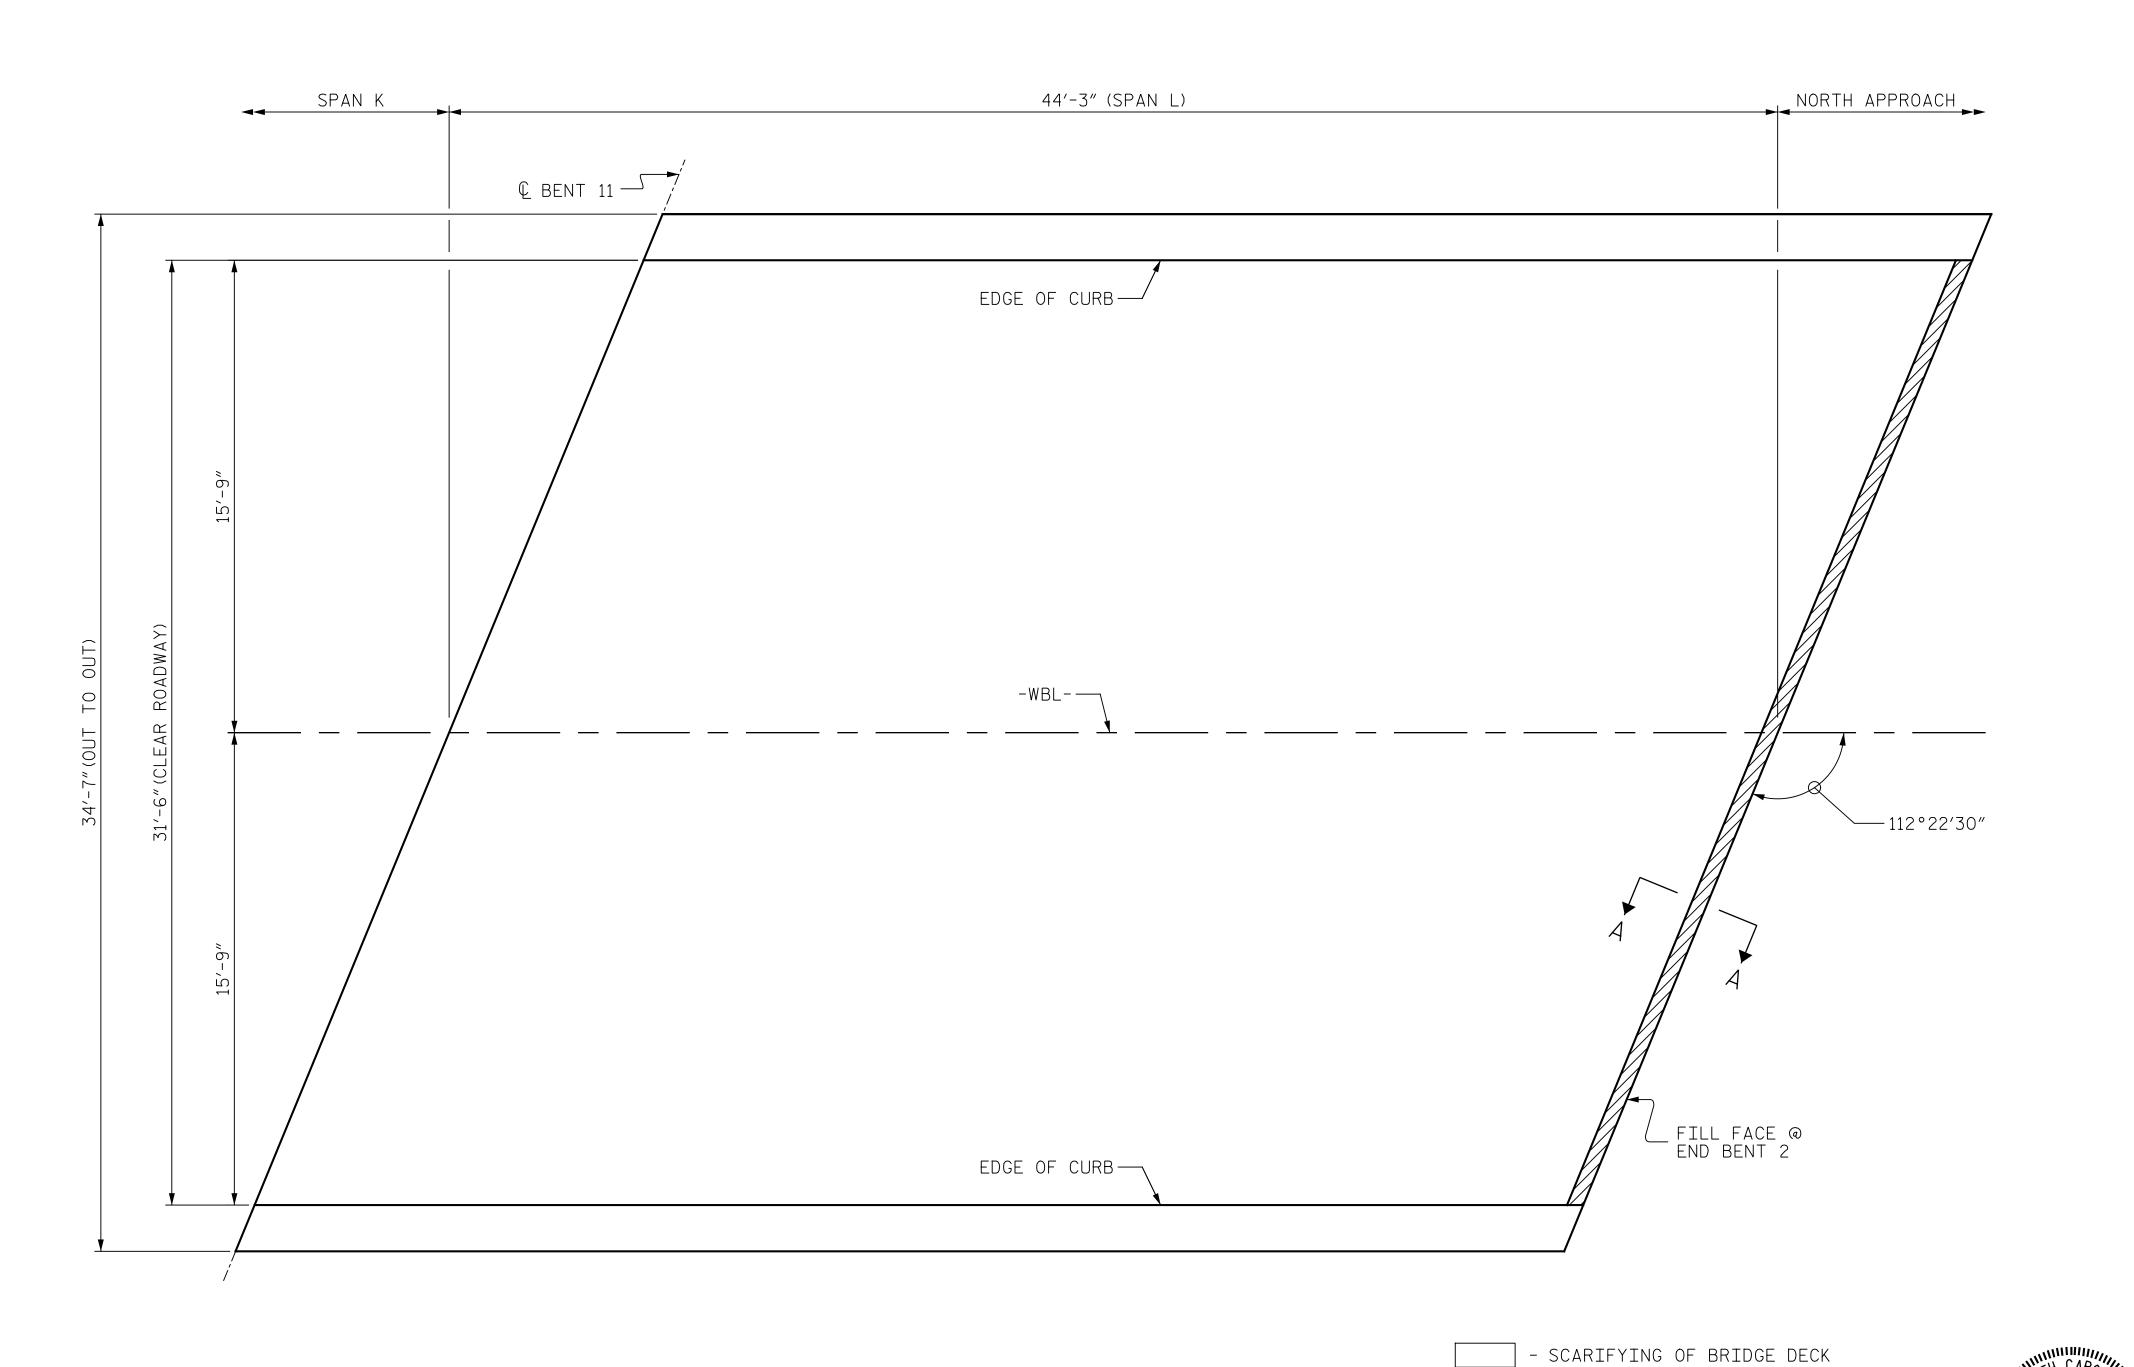

PLAN OF SPAN "L"

(SEE SHEET NO. S2-18 FOR SECTION A-A)

PROJECT NO. B-4626 STANLY, ROWAN AND DAVIDSON _ COUNTY 790008 BRIDGE NO._

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION
RALEIGH

SURFACE PREPARATION SPAN "L"

SEAL 020208 NGINEE Fir Bhil of 9/2/2021

- APPROX.AREA CLASS II SURFACE PREPARATION

PLANS PREPARED BY:

Suite 900

Raleigh, NC 27603
(919) 420-7660

Excellence Delivered As Promised

NC Lic. No. F-0270

our 121002 years		
ACB8082119D74CD	NO.	RY
DOCUMENT NOT CONSIDERED		
FINAL UNLESS ALL	11	
	능	
SIGNATURES COMPLETED	2	

REVISIONS SHEET NO. NO. BY: S2-16 DATE: DATE: TOTAL SHEETS

DRAWN BY :

__ DATE : 3/2021 __ DATE : 4/2021 M. LEE R. NELSON