

AS-BUILT REPAIR QUANTITY TABLE QUANTITIES |BENT 2 (SOUTHBOUND)| ESTIMATE ACTUAL VOLUME CU.FT. VOLUME SHOTCRETE REPAIRS SQ.FT. SQ.FT. CU.FT. CAP 89.1 44.6 COLUMNS 1.7 0.9 VOLUME **VOLUME** CONCRETE REPAIRS SQ.FT. SQ.FT. CU.FT. CU.FT. 30.7 CAP 46.0 EPOXY RESIN INJECTION LIN.FT. LIN.FT CAP 4.5 COLUMNS 0.0 EPOXY COATING SQ.FT. SQ.FT. TOP OF BENT CAP

VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE, MINIMUM OF 1" BEHIND REBAR AND MINIMUM 2" CLEARANCE TO SAWCUT. FOR REPAIR DETAILS, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

NOTES

REPAIR LOCATIONS AND ESTIMATE OF QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATION AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

CONCRETE REPAIRS MAY BE SUBSTITUTED IN LIEU OF SHOTCRETE REPAIRS WITH THE APPROVAL OF THE ENGINEER.

FOR PEDESTAL WALL REPAIR, SEE "TYPICAL CAP AND COLUMN REPAIR DETAILS" SHEET.

FOR SHOTCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR CONCRETE REPAIRS, SEE SPECIAL PROVISIONS.

FOR EPOXY RESIN INJECTION, SEE SPECIAL PROVISIONS.

CLEAN AND REMOVE DEBRIS FROM THE TOP OF THE CAP AND APPLY EPOXY PROTECTIVE COATING. EPOXY COATING SHALL BE APPLIED TO THE TOP SURFACE OF THE CAP. THE CONTRACTOR SHALL NOT COAT THE AREA OF THE CAP BENEATH THE MASONRY PLATES. FOR EPOXY COATING, SEE SPECIAL PROVISIONS.

SHOTCRETE REPAIR AREA



CONCRETE REPAIR AREA


 \sim

- EPOXY RESIN INJECTION (ERI)

PROJECT NO. I-5746C

MECKLENBURG COUNTY

BRIDGE NO. 590320

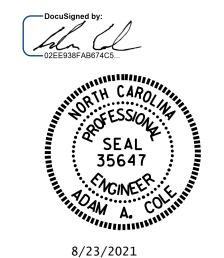

DEPARTMENT OF TRANSPORTATION
RALEIGH

BENT 2 (SOUTHBOUND)

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED 2 REVISIONS SHEET NO. BY: DATE: NO. BY: DATE: SHEETS

8 SHEET NO. BY: DATE: NO. BY: DATE: SHEETS

8 SHEET NO. BY: DATE: NO. BY: DATE: SHEETS

9 2 4 2 274