


END BENT 1 (EAST FACE)

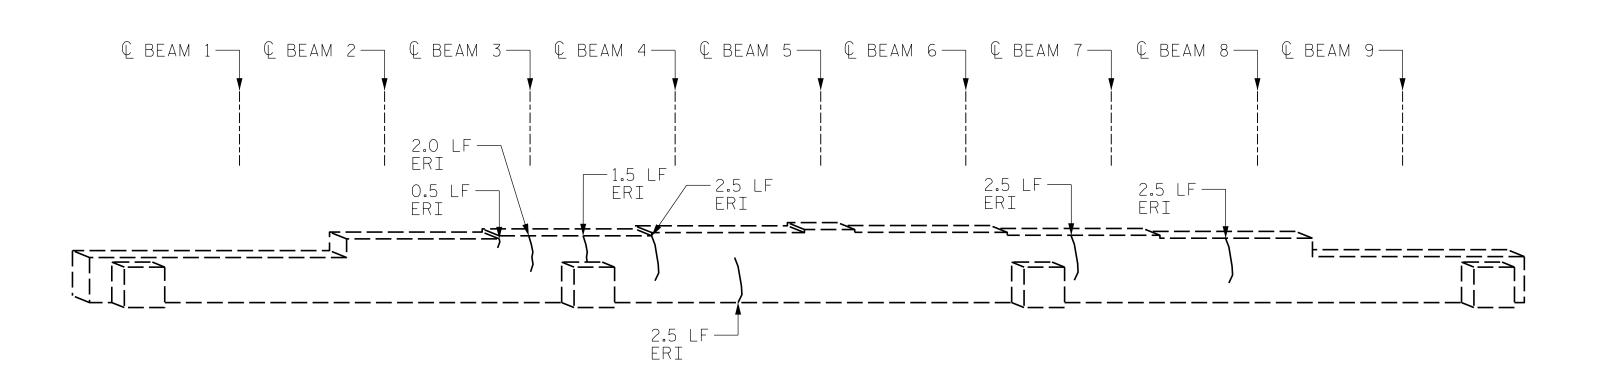

END BENT 2 (WEST FACE)

AS-BUILT REPAIR QUANTITY TABLE QUANTITIES ACTUAL ESTIMATE SHOTCRETE REPAIRS CAP/BACKWALL COLUMN/PILE CONCRETE REPAIRS CAP EPOXY RESIN INJECTION LIN.FT. LIN.FT. 32.5 CAP COLUMN/PILE AREA SQ. FT. EPOXY COATING CAP 398.8

> VALUES IN CHART REPRESENT ESTIMATED REPAIR TOTALS AFTER REMOVAL OF UNSOUND CONCRETE. MINIMUM OF 1"BEHIND REBAR AND MINIMUM 2"CLEARANCE TO SAWCUT. FOR REPAIR DETAILS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

## NOTES:

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE GIVEN WITH THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ADJUST THE ACTUAL QUANTITIES ENTERED INTO THE TABLE ABOVE.

CRACKING LOCATIONS AND QUANTITIES FOR LOCATIONS DESCRIBED AS "SCATTERED THROUGHOUT" IN THE INSPECTION REPORT ARE BASED ON THE BEST INFORMATION AVAILABLE. THE ENGINEER AND CONTRACTOR SHALL IDENTIFY AND REPAIR ALL CRACKS >= $\frac{1}{16}$ " AS DESCRIBED IN THE SPECIAL PROVISIONS AT EACH BENT.

AVERAGE CONCRETE COVER IS EXPECTED TO BE FROM 2"TO 3"ON THE CAP AND FROM 11/2" TO 2" ON THE PILES. ACTUAL CONCRETE COVER SHALL BE DETERMINED BY THE CONTRACTOR AND PRESENTED TO THE ENGINEER PRIOR TO BEGINNING EXCAVATION/ DEMOLITION.

FOR CONCRETE AND SHOTCRETE REPAIRS, SEE "CONCRETE RESTORATION DETAILS" SHEETS.

SHOTCRETE REPAIRS MAY BE REPLACED WITH CONCRETE REPAIRS WITH THE

APPROVAL OF THE ENGINEER.

REPAIRS TO THE BENT CAP MAY REQUIRE BRIDGE JACKING. FOR BRIDGE JACKING, SEE SPECIAL PROVISIONS.


PERFORM ALL CONCRETE REPAIRS PRIOR TO APPLYING THE EPOXY COATINGS.

TOP OF THE CAPS SHOULD BE CLEAN AND CLEAR OF ALL DEBRIS PRIOR TO THE APPLICATION OF THE EPOXY COATING.

COAT ALL THE FREE SURFACE AREA ON THE TOP OF CAPS, INCLUDING CHAMFERS, WITH EPOXY COATINGS. DO NOT COAT UNDER BEARING AREAS.

FOR EPOXY COATING, SEE SPECIAL PROVISION AND STANDARD SPECIFICATIONS SECTION 420-18.

> PROJECT NO. ROBESON COUNTY 770004 BRIDGE NO.

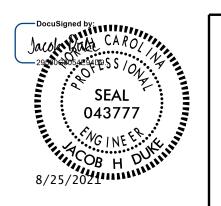

STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH

> SUBSTRUCTURE REPAIRS

END BENTS 1 & 2

DOCUMENT NOT CONSIDERED SIGNATURES COMPLETED

FINAL UNLESS ALL

	VC14	
	KISINGER CAMPO	
D	& ASSOCIATES 301 FAYETTEVILLE ST., SUITE 1500 RALEIGH, NC 27601 (919) 882-7839 NC FIRM LICENSE: C-1506	N Y
	NC FIRM LICENSE: C-1506	4

	KCT	
	KISINGER CAMPO	
_	& ASSOCIATES 301 FAYETTEVILLE ST., SUITE 1500	Ν
$\Box$	301 FAYETTEVILLE ST., SUITE 1500	H
	RALEIGH, NC 27601 (919) 882-7839	ľ
	RALEIGH, NC 27601 (919) 882-7839 NC FIRM LICENSE: C-1506	9

SHEET NO REVISIONS S3-7 DATE: DATE: BY: NO. BY: TOTAL SHEETS 1Ø

JACOB H. DUKE \_ DATE : <u>06/2021</u> DRAWN BY : \_\_\_ \_ DATE : <u>06/2021</u> FIDEL L.FLORES CHECKED BY : \_\_ DESIGN ENGINEER OF RECORD: \_\_\_\_\_\_JACOB H. DUKE \_\_\_ DATE : \_\_\_\_\_06/2021