



**Strain Pole Attachments**

**NOTE:**

1. Strap all signal cables to the side of the pole with 3/4" stainless steel straps when the distance between the spanwire attachment clamp and the weatherheads exceeds 3'-0".
2. Provide minimum two spanwire pole clamps per pole.
3. It is prohibited to attach two span wires at one pole clamp.
4. For general requirements refer to NCDOT Standard Specifications for Roadway and Structures, January 2018.

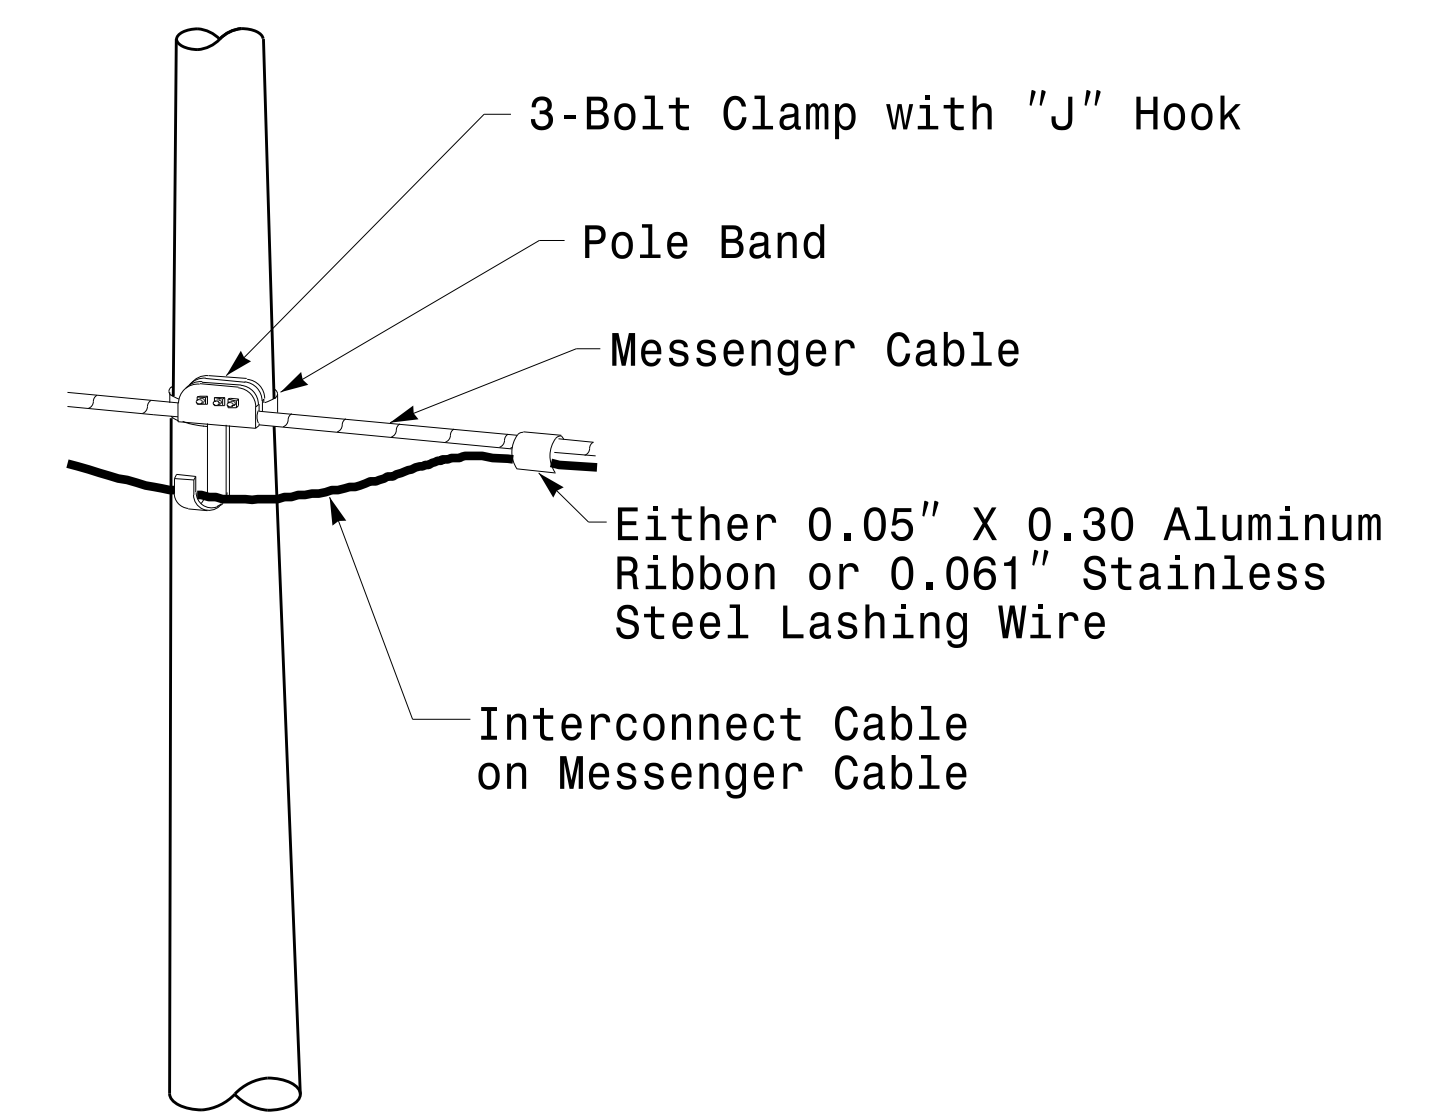

**Attachment of Cable to Intermediate Metal Pole**

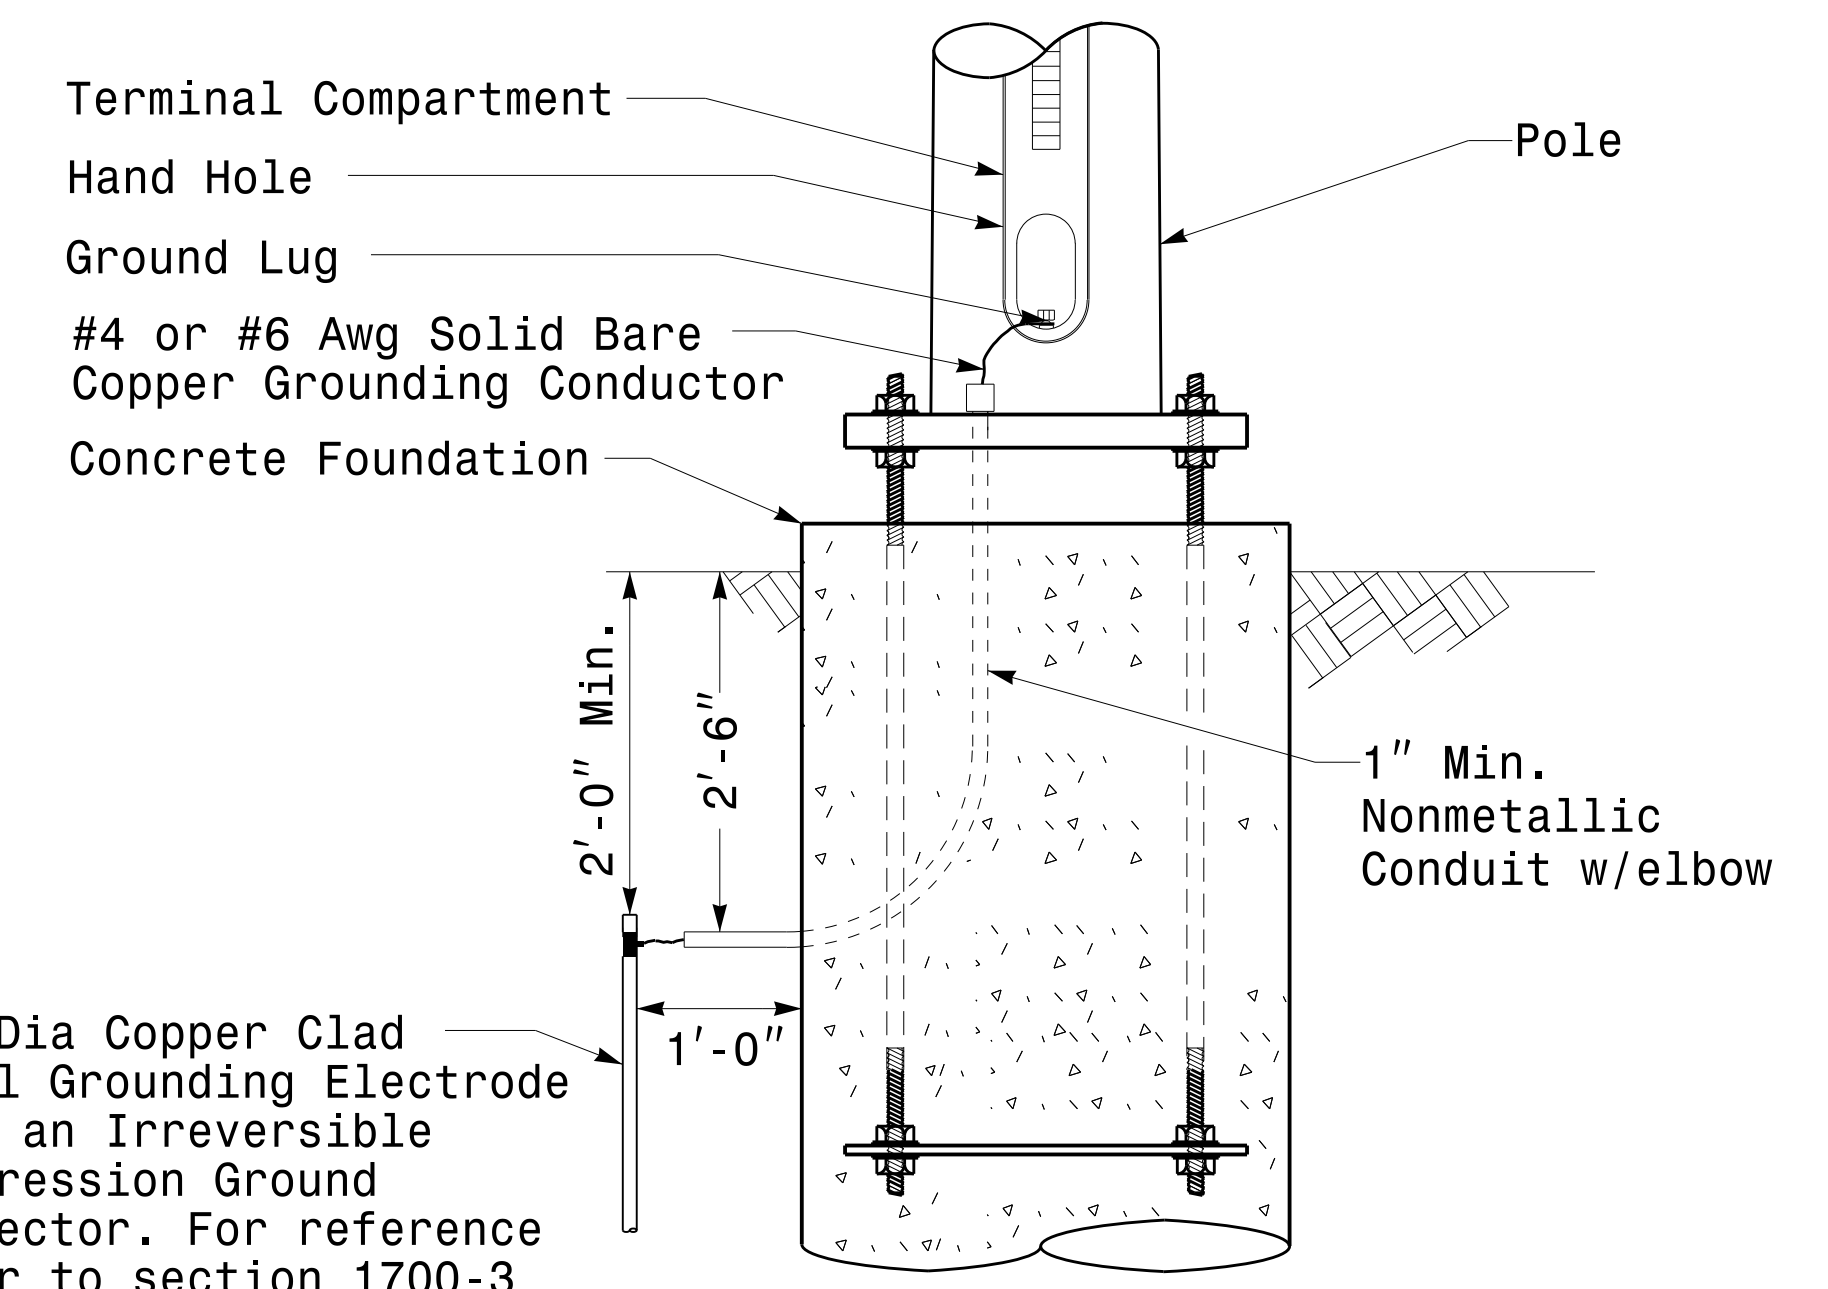

5/8" Dia Copper Clad Steel Grounding Electrode with an Irreversible Compression Ground Connector. For reference refer to section 1700-3 K and L for electrical grounding and bonding requirements, See Note 4.

**Metal Pole Grounding Detail For Strain Pole and Mast Arm**

11-DEC-2017 08:36 136504115 StrainPole.dgn Design Section Eastern Region\m\ Sheets\2016\2014 Sig.M6 Std. Fabrication Detail-Strain Poles.dgn

<p>750 N. Greenfield Pkwy, Garner, NC 27529</p>	<p>Typical Fabrication Details For Strain Pole Attachments</p>		<p>SEAL</p> <p>DocuSigned by: D. C. Sarkar 10/11/2017</p>					
	<p>PLAN DATE: OCTOBER 2017</p> <p>DESIGNED BY: C.F. ANDREWS</p> <p>PREPARED BY: N. BITTING</p> <p>REVIEWED BY: D.C. SARKAR</p>	<table border="1"> <tr> <th>REVISIONS</th> <th>INIT.</th> <th>DATE</th> </tr> <tr> <td> </td> <td> </td> <td> </td> </tr> </table>		REVISIONS	INIT.	DATE		
REVISIONS	INIT.	DATE						