


| TOTAL BILL OF MATERIAL | | | | | | | | | | | | | | | | | | | |
|------------------------|--------------------|---|------------------------------|------------------------|-------------------|------------------------------|------------------|-------------------|-----------------------|---------------------------------------|--------------------------------|-----------------------------------|---------------------------------|--|--------------------------------------|--|---------------------------------------|---|-------------------------|
| BRIDGE NO. | INCIDENTAL MILLING | ASPHALT CONCRETE SURFACE COURSE, TYPE S9.5C | ASPHALT BINDER FOR PLANT MIX | GROOVING BRIDGE FLOORS | POLLUTION CONTROL | CLASS II SURFACE PREPARATION | CONCRETE REPAIRS | SHOTCRETE REPAIRS | EPOXY RESIN INJECTION | PAINTING CONTAINMENT FOR BRIDGE NO... | REPAIR OF EXISTING DECK DRAINS | FOAM JOINT SEALS FOR PRESERVATION | POURABLE SILICONE JOINT SEALANT | PERFORMED SILICONE EXPANSION JOINT SEALS | POLYESTER POLYMER CONCRETE MATERIALS | EPOXY POLYMER CONCRETE MATERIALS (ALTERNATE) | ELASTOMERIC CONCRETE FOR PRESERVATION | REPAIRS TO PRESTRESSED CONCRETE GIRDERS | BRIDGE JOINT DEMOLITION |
| | SO. YDS. | TONS | TONS | SO. FT. | LUMP SUM | SO. YDS. | CU. FT. | CU. FT. | LIN. FT. | LUMP SUM | LUMP SUM | LIN. FT. | LIN. FT. | LIN. FT. | CU. YDS. | CU. YDS. | CU. FT. | CU. FT. | SO. FT. |
| 610006 | - | - | - | 29778.0 | - | 21.3 | - | 81.7 | 108.0 | - | - | 72.0 | 48.0 | 36.0 | 151.8 | 151.8 | - | - | - |
| 030078 | 1000.0 | 90.0 | 10.0 | 39562.6 | LUMP SUM | 78.0 | 7.6 | 54.7 | 2.0 | LUMP SUM | - | 863.2 | - | - | 204.4 | 204.4 | - | 68.8 | - |
| 030081 | - | - | - | - | - | - | 6.3 | 13.9 | 1.0 | - | LUMP SUM | 280.0 | 48.0 | 80.0 | - | - | 20.0 | - | 80.0 |
| TOTALS | 1000.0 | 90.0 | 10.0 | 69340.6 | LUMP SUM | 99.3 | 13.9 | 150.3 | 111.0 | LUMP SUM | LUMP SUM | 1215.2 | 96.0 | 116.0 | 356.2 | 356.2 | 20.0 | 68.8 | 80.0 |

| TOTAL BILL OF MATERIAL | | | | | | | | |
|------------------------|---------------|---|--|------------------------|--------------------------|-----------------------|---|-------------------------------------|
| BRIDGE NO. | EPOXY COATING | CONCRETE DECK REPAIR FOR POLYMER CONCRETE OVERLAY | PLACING & FINISHING POLYMER CONCRETE OVERLAY | SCARIFYING BRIDGE DECK | SHOTBLASTING BRIDGE DECK | SILANE DECK TREATMENT | CLEANING AND PAINTING EXISTING BEARINGS WITH HIGH RATIO CALCIUM SULFONATE | STEEL BEARING KEEPER ANGLE ASSEMBLY |
| | SO. FT. | SO. YDS. | SO. YDS. | SO. YDS. | SO. YDS. | SO. YDS. | EA. | EA. |
| 610006 | 1406.0 | 21.3 | 3637.4 | 3637.4 | 3637.4 | - | - | 1 |
| 030078 | 2116.2 | 78.0 | 4922.1 | 4922.1 | 4922.1 | - | 252 | - |
| 030081 | 20.4 | - | - | - | 7250.1 | 7250.1 | - | - |
| TOTALS | 3542.6 | 99.3 | 8559.5 | 8559.5 | 15809.6 | 7250.1 | 252 | 1 |

15BPR.21
 PROJECT NO. & 15BPR.38
 MONTGOMERY & ANSON COUNTY
 BRIDGE NO. 610006, 030078
 & 030081

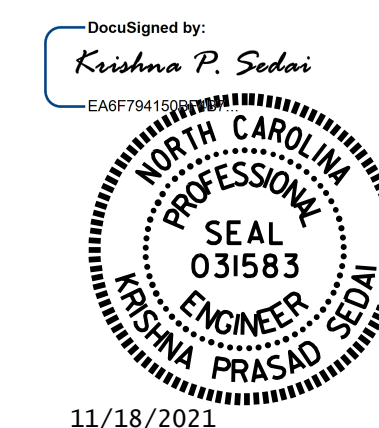

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH
 TOTAL BILL
 OF MATERIAL

DRAWN BY : M. G. SHAIKH DATE : 01/2019
 CHECKED BY : K. P. SEDAI DATE : 02/2019

DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

| REVISIONS | | | | | | SHEET NO. |
|-----------|-----|-------|-----|-----|-------|--------------|
| NO. | BY: | DATE: | NO. | BY: | DATE: | S-1 |
| 1 | | | 3 | | | TOTAL SHEETS |
| 2 | | | 4 | | | 1 |