


NOTES

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

FOR SECTIONS A-A AND B-B, SEE "JOINT DETAILS" SHEET.

FOR POURABLE SILICONE JOINT SEALANT, SEE SPECIAL PROVISIONS.

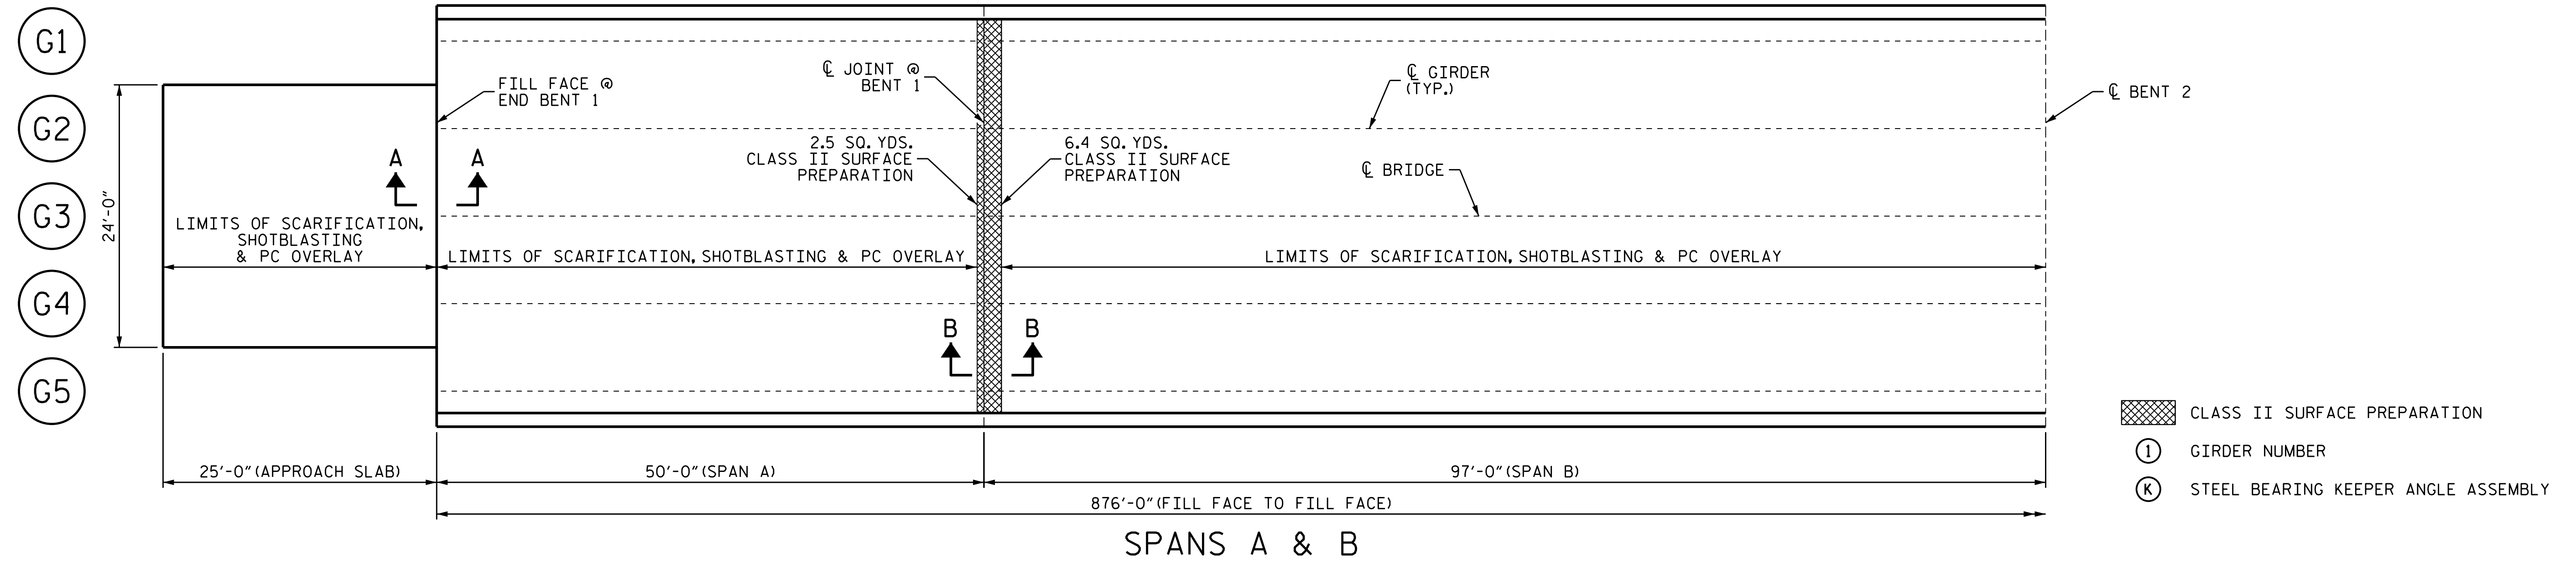


AS-BUILT REPAIR QUANTITY TABLE

APPROACH SLAB REPAIRS			TOP OF DECK REPAIRS SPAN A			TOP OF DECK REPAIRS SPAN B		
	ESTIMATE	ACTUAL		ESTIMATE	ACTUAL		ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	66.7 SQ. YDS.		SCARIFYING BRIDGE DECK	200.0 SQ. YDS.		SCARIFYING BRIDGE DECK	388.0 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	66.7 SQ. YDS.		SHOTBLASTING BRIDGE DECK	200.0 SQ. YDS.		SHOTBLASTING BRIDGE DECK	388.0 SQ. YDS.	
CONCRETE DECK REPAIR FOR PC OVERLAY	0.0 SQ. YDS.		CLASS II SURFACE PREPARATION	2.5 SQ. YDS.		CLASS II SURFACE PREPARATION	6.4 SQ. YDS.	
POLYMER CONCRETE MATERIALS	2.8 CU. YDS.		CONCRETE DECK REPAIR FOR PC OVERLAY	2.5 SQ. YDS.		CONCRETE DECK REPAIR FOR PC OVERLAY	6.4 SQ. YDS.	
PLACING & FINISHING PC OVERLAY	66.7 SQ. YDS.		POLYMER CONCRETE MATERIALS	8.3 CU. YDS.		POLYMER CONCRETE MATERIALS	16.2 CU. YDS.	
POURABLE SILICONE JOINT SEALANT	24.0 LIN. FT.		PLACING & FINISHING PC OVERLAY	200.0 SQ. YDS.		PLACING & FINISHING PC OVERLAY	388.0 SQ. YDS.	
GROOVING BRIDGE FLOOR	507.0 SQ. FT.		FOAM JOINT SEALS FOR PRESERVATION	36.0 LIN. FT.		GROOVING BRIDGE FLOOR	3180.0 SQ. FT.	
			GROOVING BRIDGE FLOOR	1620.0 SQ. FT.				

PROJECT NO. 15BPR.21
MONTGOMERY COUNTY
 BRIDGE NO. 610006

SHEET 1 OF 5

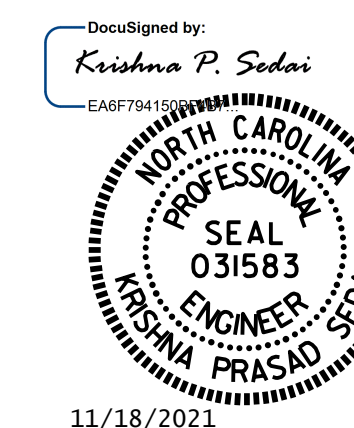

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

**PLAN OF SPANS
 SPANS A & B**

DRAWN BY : R.L.PUTEK DATE : 12/2018
 CHECKED BY : E.BAYISSA DATE : 12/2018

DOCUMENT NOT CONSIDERED
 FINAL UNLESS ALL
 SIGNATURES COMPLETED

REVISIONS						SHEET NO.
NO.	BY:	DATE:	NO.	BY:	DATE:	
1			3			S1-5
2			4			TOTAL SHEETS 34