

	AS-BUILT	REPAIR	QUANTITY TABLE		
TOP OF DECK REPAIRS SPAN G		TOP OF DECK REPAIRS SPAN H			
	ESTIMATE	ACTUAL		ESTIMATE	ACTUAL
SCARIFYING BRIDGE DECK	388.0 SQ. YDS.		SCARIFYING BRIDGE DECK	388.0 SQ. YDS.	
SHOTBLASTING BRIDGE DECK	388.0 SQ.YDS.		SHOTBLASTING BRIDGE DECK 388.0 SQ. YDS.		
CONCRETE DECK REPAIR FOR PC OVERLAY	O.O SQ.YDS.		CONCRETE DECK REPAIR FOR PC OVERLAY 0.0 SQ. Y		
POLYMER CONCRETE MATERIALS	16.2 CU. YDS.		POLYMER CONCRETE MATERIALS	16.2 CU. YDS.	
PLACING & FINISHING PC OVERLAY	388.0 SQ.YDS.		PLACING & FINISHING PC OVERLAY	388.0 SQ. YDS.	
GROOVING BRIDGE FLOOR	3201.0 SQ.FT.		GROOVING BRIDGE FLOOR	3201.0 SQ.FT.	

DRAWN BY :	R.L.PUTEK	DATE :	12/2018	8
CHECKED BY :			12/2018	


+

NOTES

	$\begin{smallmatrix} & & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ & \\ $
	· · · · · · · · · · · · · · · · · · ·
€ BENT 7-	\uparrow
Y BENT I	
	<u> </u>
	i de la constante d
RLAY	LIMITS OF SCARIFICATION, SHOTBLASTING & PC OVERLA
	; 1
	T
	 !
	97'-0" (SPAN H)
	◀
OID TU IFILL FAU	CE TO FILL FACE)

SPANS G & H

REPAIR LOCATIONS AND ESTIMATED QUANTITIES ARE BASED ON THE BEST INFORMATION AVAILABLE. IF ADDITIONAL REPAIRS NOT SHOWN ON THE DRAWINGS ARE DEEMED NECESSARY BY THE ENGINEER, THE ENGINEER WILL NOTE ON THE DRAWINGS THE APPROXIMATE LOCATIONS AND DESCRIPTION OF THE REPAIRS AND ENTER THE ACTUAL QUANTITIES INTO THE AS-BUILT REPAIR QUANTITY TABLE.

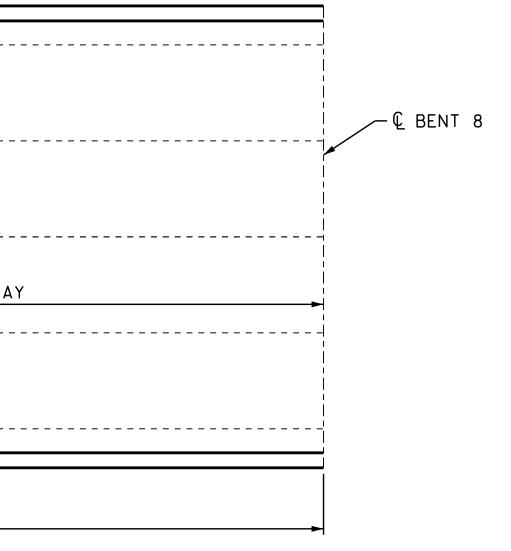

CLASS II SURFACE PREPARATION

- 1 GIRDER NUMBER
- K STEEL BEARING KEEPER ANGLE ASSEMBLY

PROJECT NO	15BPR.21
MONTGON	MERY COUNTY
BRIDGE NO	610006

SHEET 4 OF 5					
DocuSigned by: Krishna P. Sedai EA6F79415000000000000000000000000000000000000	STATE OF NORTH CAROLINA DEPARTMENT OF TRANSPORTATION RALEIGH				
EAGF794150000000 TH CAROL OFESSION SEAL 03I583 PRASAD 11/18/2021	PLAN OF SPANS SPANS G & H				
,,					
	REVISIONS SHEET NO.				
DOCUMENT NOT CONSIDERED	NO. BY:	DATE:	NO. BY:	DATE:	S1-8
FINAL UNLESS ALL	្យ		3		TOTAL SHEETS
SIGNATURES COMPLETED	2		4		34