

AS-BUILT REPAIR QUANTITY TABLE

DECK SURFACE REPAIRS - SPANS 12 THROUGH 15

	ESTIMATE	ACTUAL
SHOTBLASTING BRIDGE DECK	1,329.8 SQ. YDS.	
SILANE DECK TREATMENT	1,329.8 SQ. YDS.	
CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT	0.0 SQ. FT.	


BARRIER RAIL REPAIRS

	ESTIMATE	ACTUAL
EPOXY RESIN INJECTION	0.0 LIN. FT.	


JOINT REPAIR

	ESTIMATE	ACTUAL
BRIDGE JOINT DEMOLITION	64.0 SQ. FT.	

NOTES
 FOR SILANE DECK TREATMENT, SEE SPECIAL PROVISIONS.
 FOR CONCRETE DECK REPAIR FOR SILANE DECK TREATMENT, SEE SPECIAL PROVISIONS.
 FOR SECTION B-B, SEE "JOINT REPAIR DETAILS" SHEET.
 FOR EPOXY RESIN INJECTION, SEE SPECIAL PROVISIONS.
 FOR BRIDGE JOINT DEMOLITION, SEE SPECIAL PROVISIONS.

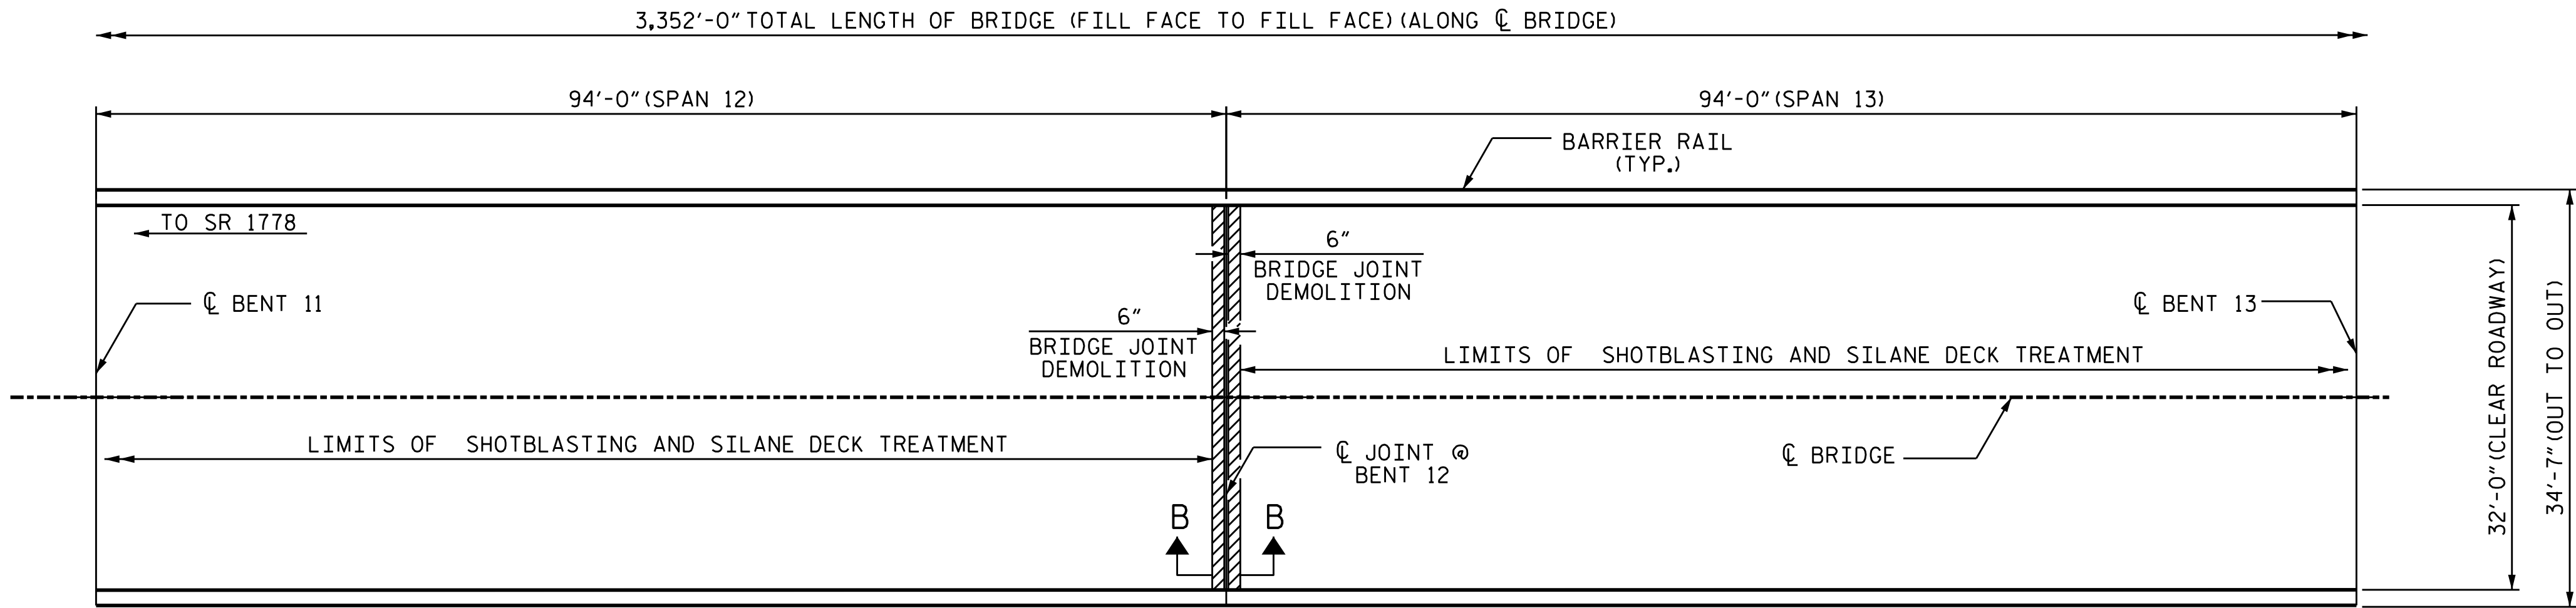

PLAN
(SPANS 12 & 13)

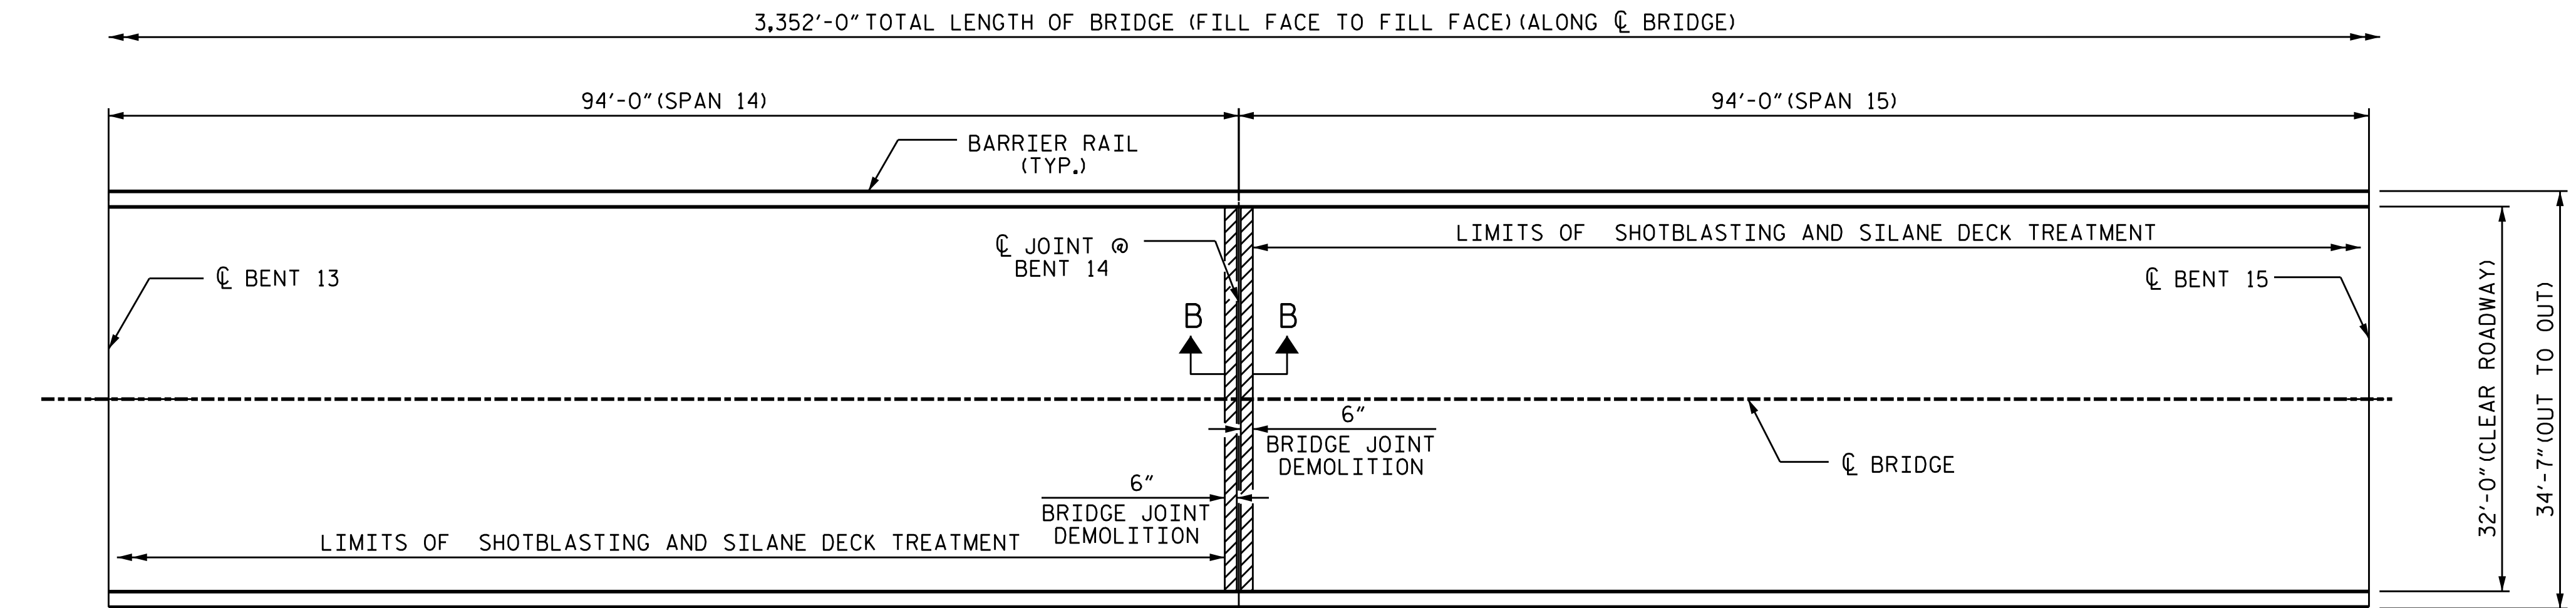


PLAN
(SPANS 14 & 15)

- SHOTBLASTING AND SILANE DECK TREATMENT AREA
- ERI - EPOXY RESIN INJECTION
- BRIDGE JOINT DEMOLITION

PROJECT NO. 15BPR.56
BEAUFORT COUNTY
 BRIDGE NO. 060077

SHEET 4 OF 10

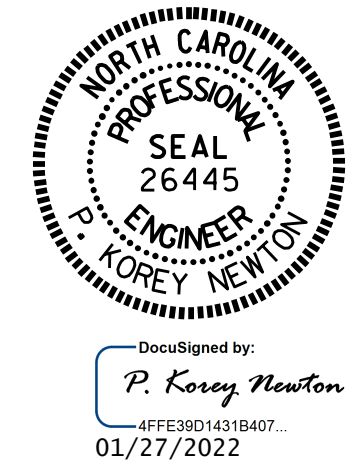

STATE OF NORTH CAROLINA
 DEPARTMENT OF TRANSPORTATION
 RALEIGH

**SUPERSTRUCTURE
 PLAN OF SPANS**

DRAWN BY : S. T. SANDOR DATE : 07/2021
 CHECKED BY : W. C. SMITH DATE : 12/2021

NO.	REVISIONS			NO.	REVISIONS			SHEET NO.
	BY:	DATE:			BY:	DATE:		
1				3			S4-11	
2				4			TOTAL SHEETS 17	

DOCUMENT NOT CONSIDERED FINAL UNLESS ALL SIGNATURES COMPLETED